12/00

RE: Service Welding & Ship Building

NE Canal Bank Road, Lemont, Illinois

RESPONSE TO USEPA 8/11/2000 CORRESPONDENCE

DEC 2 9 2000

RECEIVED

OIL PLANNING & RESPONSE SECTION

Service Welding & Ship Building, has revised their SPCC Plan due to changes made in the operation of the bulk storage plant. Below is an outline identifying the responses to each of the alleged deficiencies noted under Attachment A of above referenced USEPA correspondence.

1. For Failure to Review SPCC Plan at least Every Three Years: An SPCC Plan which indicates the date on which a review of the Plan was conducted, along with the signature and title of an authorized official of the facility, if an amendment to the SPCC Plan is unnecessary. An amendment is necessary whenever there is a change in facility design, construction, operation or maintenance which materially affects the facility's potential for the discharge of oil into or upon the navigable waters of the United States or adjoining shore lines. If an amendment to the SPCC Plan is necessary, the required changes must be made, certified by a Professional Engineer and the amended SPCC Plan must be submitted along with the date of review, and the signature and title of an authorized official of the facility.

Please have Plan Reviewed.

Based upon a re-evaluation of the facility and changes made to the operation over the past few years, the facility's SPCC Plan has been revised, reviewed and re-certified by a Professional Engineer.

2. 40 CFR 112.3 - Requirements for preparation and implementation of Spill Prevention Control and Countermeasure Plans.

Failure to prepare a plan within 6-months after facility became operational and implement same plan within one year after facility became operational.

Egan Marine had developed an SPCC Plan back in 1995 and made improvements to the facility to ensure controls of spills and releases from the bulk plant operations. The plant now has been down-sized and ultimately will only cover the four bulk (boiler) fuel storage tanks proposed to remain in operation. The SPCC requirements remain in effect as designated by the revised SPCC Plan enclosed herein. Service Welding and Ship Building contends that due to the topography of the facility that a release of materials from the bulk storage operations would not reach the Chicago Sanitary & Ship Canal and the SPCC plan and structures installed only assist to minimize this potential. Furthermore, due to the coincident operation of the Egan Marine Corporation barge terminal at the same location which has an approved Coast Guard Facility Response and Mobile Facility Response Plan(s), the expertise to respond to a release from the bulk storage operations has always been in place at the facility.

3. 40 CFR 112.7 - Guidelines for the preparation and implementation of a Spill Prevention Control and Countermeasure Plan



(e)(2) Failure to provide complete discussions and/or implement requirements pertaining to Bulk Storage Tanks

Tank material/construction is not compatible with fluid stored.

Page 14, Not Specified in Plan in Detail.

As specified in the reviewed plan and the revised plan herein, the tanks to remaining in operation are constructed of mild steel, which is compatible with the materials stored, petroleum and vegetable-based by-product.

4. Failure to provide secondary containment for the largest single tank plus an allowance for precipitation. #104, 105, 115, 120, 124, 128

Page 3, III, Not specified in Plan in Detail. Please provide secondary containment.

The secondary containment calculations for each storage area for the tanks to remain in operation (B-1 through B-4, in addition to the temporary soapstock storage tanks to be taken out of operation at such time a market for the product is secured) have been revised to allow for precipitation. Refer to pages 3-4 of the enclosed revised SPCC Plan. All of the remaining tanks have been emptied.

5. Failure to either wrap or coat new buried metallic storage tanks to reduce corrosion (or other effective method compatible with local soil conditions)

Failure to pressure test such tanks on a regularly scheduled basis.

Not Stated in Plan

The SPCC Plan has been revised to indicate that there are no buried metallic tanks located on-site. Refer to page 16 of the revised SPCC Plan.

6. Failure to adequately coat the buried section of a partially buried metallic tank.

Not Stated in Plan

The SPCC Plan has been revised to indicate that there are no buried metallic tanks located on-site. Refer to page 16 of the revised SPCC Plan.

- 7. Failure to control internal heating coil leakage by:
 - 1. Monitoring the stream return or exhaust lines for oil or passing the steam lines through a separation system.
 - 2. Installing external heating system.

^{*}Not Stated in Plan*

The SPCC Plan has been revised to indicate that the discharge from the interpal steam lines will be inspected for purposes of monitoring for leakage. Refer to page 16.

8. To implement fail-safe engineering techniques on the tanks with one of the following: #103, 108, 119.

Not Stated in Plan

- 1. High liquid level alarms with an audible or visual signal;
- 2. High liquid level pump cutoff devices;
- 3. Direct audible or code signal between the tank gauge and pumping station;
- 4. A fast response system to detect oil level such as digital computers;
- 5. Sensing devices should be inspected/tested periodically.

The requirements for automated liquid level monitoring equipment is only required as practical. Due to the fact that the amount of tanks to remain in use has been minimized to four boiler fuel tanks and three vehicle fuel tanks, Service Welding has alternately implemented continuously monitoring of transfer operations by means of visual inspection to prohibit overfills. Refer to page 16 of the revised SPCC Plan.

9. (e)(3) Failure to provide complete discussions and/or implement requirements pertaining to Facility Transfer Operations.

Failure to wrap/coat buried pipelines to reduce corrosion.

Not Stated in Plan

97t .

元 注。

The SPCC Plan has been revised to indicate that there are no buried pipelines at the facility. Refer to page 17 of the revised SPCC Plan.

10. Failure to cap or blank flange the terminal connection at the transfer point of a pipeline when not in service or on standby for an extended time.

Not Stated in Plan

There is no "hard" pipelines in operation at the plant. Refer to page 17 of the revised SPCC Plan.

11. Failure to provide pipe supports which are designed to minimize abrasion and corrosion and allow for expansion and contraction.

Not Stated in Plan

The existing overhead piping in operation at the facility is comprised of steam lines only. The overhead product piping is no longer in use and has been abandoned. Refer to page 17 of the revised SPCC Plan.

12. Failure to regularly assess all above ground valves and pipelines by operating personnel.

Not Stated in Plan

There is no active product piping in use at the plant. Refer to page 17 of the revised SPCC Plan.

13. Failure to warn large vehicles verbally or by appropriate signs to be cautious of aboveground piping.

Not Stated in Plan

There is no active product piping in used at the plant. Refer to page 17 of the revised SPCC Plan.

- 14. (e)(4) Failure to provide complete discussions and/or implement requirements pertaining to Facility Tank Truck Loading/Unloading Rack.
 - (i) Failure to meet the minimum requirements and regulations established by the Department of Transportation regarding tank car and tank truck loading and unloading procedures.

Not Stated in Plan.

The SPCC Plan has been revised to address this item. Refer to page 17 of the revised SPCC Plan.

15. Failure to provide a quick drainage system with a containment volume greater than the largest compartment of any tank car or truck where drainage does not flow into a catchment basin or a treatment facility.

The SPCC Plan has been revised to address this item. Refer to page 18 of the revised SPCC Plan.

16. Failure to provide an interlocked warning light or physical barrier system or warning sign in loading/unloading areas to prevent vehicular departure before complete disconnect of flexible or fixed transfer lines.

Not Stated in Plan

The SPCC Plan has been revised to address this item by the usage of tire chocks to prevent premature departure. Refer to page 18 of the revised SPCC Plan.

17. Failure to inspect drains and outlets on tank cars and tank trucks are inspected for leakage prior to filling and departure.

Not Stated in Plan.

みなるかのはまますかるのでき

The SPCC Plan has been revised to address this item. Refer to page 18 of the revised SPCC Plan.

1. 经基础基础的基础的

18. (e)(8) Failure to include written procedures for required inspection and records of same inspections in the SPCC Plan for a period of three years.

Not Stated in Plan.

The SPCC Plan has been revised to include the retention of the outlined inspection procedures for a period of three years. Refer to page 18 of the revised SPCC Plan.

19. (e)(9) Security (excluding oil production facilities)

Failure to securely lock master flow and drain valves in the closed position or any other valves that will permit direct outward flow of the tanks contents to the surface when in non-operating or non-standby status.

Not Stated in Plan.

اعار كالوارك

The SPCC has been revised to include the inspection of drain valves on a daily basis to ensure that they are in the off position. All transfer operations personnel are trained to ensure that they close all drain valves following product transfers. Refer to page 19 of the revised SPCC Plan.

20. Failure to lock in the off position or make accessible only to authorized personnel starter controls on all oil pumps in a non-operating or non-standby status.

Not Stated in Plan

The SPCC Plan has been revised to indicate that only portable pumps are used in transfer operations. Refer to page 19 of the revised SPCC Plan.

21. Securely cap or blank-flange loading/unloading connections of oil pipelines when not in service or on standby status for an extended time period.

Not Stated in Plan

The SPCC Plan has been revised to indicate that there are no pipelines in operational status at the facility. Refer to page 19 of the revised SPCC Plan.

22. Failure to provide facility lighting which is appropriate with the type and location of the facility and is adequate to discover spills.

Not Stated in Plan

The SPCC Plan has been revised to indicate that adequate lighting is provided in each storage area. Refer to page 19 of the revised SPCC Plan.

23. (e) (10) Personnel, training and spill prevention procedures.

Failure to properly instruct personnel in the operation and maintenance of equipment used to prevent oil discharges and in the pollution control laws, rules and regulations. Missing Daily & Weekly Procedure.

Not Stated in Plan

The SPCC Plan has been revised to indicate the training of appropriate plant personnel (those involved with product transfer operations) on all SPCC Plan procedures. Refer to page 19 -20 of the revised SPCC Plan.

24. The SPCC Plan only covers the western peninsula. The eastern peninsula needs to be addressed.

There are no bulk storage operations taking place within the eastern "peninsula". All storage tanks are located on the western "peninsula". Therefore the SPCC Plan only covers the bulk storage tank operations located on the western "peninsula".



Environmental Management And Resource Consultants, Inc.

P.O. Box 578 • Lemont, IL 60439

630. 257. 9357 • 888. 436. 6272 • Fax 630. 257. 1650

SPILL PREVENTION, CONTROL AND COUNTERMEASURE (SPCC) PLAN

PREPARED FOR:

SERVICE WELDING AND SHIP BUILDING NE Canal Bank Lemont, Illinois 60439

DREDARED RV.

ENvironmental Management And Resource Consultants, Inc. (ENMARC) 229 E. Custer St. Lemont, Illinois 60439

December 2000

SERVICE WELDING AND SHIP BUILDING NE Canal Bank Road, Lemont, Illinois

SPILL PREVENTION, CONTROL AND COUNTERMEASURE (SPCC) PLAN (December 2000)

TABLE OF CONTENTS

SPCC - Certification Form

Professional Engineer Certification Form

SPCC Plan

Pages 1 - 20

LIST OF ATTACHMENTS

Attachment 1 - Topographic Site Map(s)

Attachment 2 - Primary Product MSD Sheet(s)

Attachment 3 - Emergency Response Inventory & Location Map

Attachment 4 - EMC On-Shore Emergency Response Plan

Attachment 5 - EMC Mobile Facility/Emergency Response Plan

Attachment 6 - Written Commitment of Resources

Attachment 7 - Inspection Procedures And Forms

Attachment 8 - Training Log Forms

CERTIFICATION OF SUBSTANTIAL HARM DETERMINATION FORM

FACII	LITY NAME:	Service V	Velding a	nd Ship	Building			·	
FACII	LITY ADDRESS:	NE Can	al Bank	Road (N	Mailing A	Addres	ss: P.O. I	Box 669)	
		Lemont,	<u>Illinois</u>	6043	9			·	
		reference of the second		R					
1.	Does the facility have the operations include						ll to 42,00	0 gallons <u>s</u>	and do
			YES _	X		NO_			
2.	Does the facility have a gallons <u>and</u> is the fac sufficiently large to corarea?	cility without se	econdary	containr	ment for	each	abovegro	und storag	ge area
	arou.		YES _			NO_	<u>X</u>	2	
3.	Does the facility have a gallons <u>and</u> is the faci Attachment C-III or an from the facility cold c	ility located at a alternative forn	distance	(as calc	ulated usceptable	sing th	e approp RA) suc	riate form h that a dis	ula* in charge
			YES _		,	NO _	<u>x</u>		
4.	Does the facility have a gallons and is the facility Attachment C-III or an from the facility would	ility located at a alternative form	a distance nula cons	e (as calc	culated u ceptable	sing the	ne approp	riate form	ula* in
			YES_			NO _	X		•
5.	Does the facility have a gallons and within the greater than or equal to	e past 5 years, h	as the fa			_		-	
			YES _	· ——		NO _	<u>X</u>	<u> </u>	
	alternative formula is use la must be attached to th		n of the re	eliability	and anal	ytical s	soundness	of the alte	rnative
I certified in this	TIFICATION y under penalty of law the document, and that be ation, I believe that the	ased on my income submitted inform	quiry of	those in	dividual	s respo	onsible f	or obtaini	
Signat			_		Title	Owne	er/Preside	ent	
	Dennis Egan		•			12	-/21/	2000	
	(Please Type or Print)	•.	_		Date	•	/_/		

Service Welding and Ship Building NE Canal Bank Road Lemont, Illinois 60439

Spill Prevention, Control and Countermeasures Plan (SPCC Plan, 12/2000)

PROFESSIONAL ENGINEER CERTIFICATION

I hereby certify that I have reviewed and evaluated the enclosed SPCC Plan and am familiar with the provisions of 40 CFR, Part 112, and attest that the SPCC Plan has been prepared in accordance with good engineering practices.

Signature:	S. P. O.		
Name:	Sigitas P. Vaznelis	· .	
Title:	Professional Engineer, Morris Eng	ineering, Inc.	
Registration N	umber:062-044114 (Illinois)	SEAL:	Summinum Comments
Date:	12-15-2000		C C52-044114 REGISTERED PROFESSIONAL

1. 1.1.

SERVICE WELDING AND SHIP BUILDING NE Canal Bank Road, Lemont, Illinois

SPILL PREVENTION, CONTROL AND COUNTERMEASURE (SPCC) PLAN (December 2000)

This SPCC Plan has been prepared in accordance with appropriate engineering practices, and has the full approval of management at a level of authority to commit the necessary resources. This SPCC Plan has been developed in accordance with 40 CFR Part 112.7.

Copies of this Plan will be maintained in the Supervisor's office on-site. Additionally, each SPCC Emergency Coordinator will keep a copy at the office and at home.

GENERAL FACILITY DESCRIPTION:

Name of Facility:

Service Welding and Ship Building (herein after referenced as

....

Service Welding)

10. 16.

Location of Facility:

The north bank of the Chicago Sanitary and Ship Canal, 1/2 mile east of the Lemont Road bridge on the south side of the DesPlaines River. Refer to the Regional Topographic Site Location Map

incorporated under Attachment 1.

Mailing Address of Facility:

P.O. Box 669

Lemont, Illinois 60439

Phone Number: (708)739-6660

Type of Facility:

Bulk Storage of Petroleum Boiler Fuel, Gasoline and Diesel (for onsite fueling operations); and Temporary Storage of Edible Grade, Vegetable-Based Oil (Common Name: Soapstock) -- Refer to Attachment 2 for a copy of the Material Safety Data Sheet(s) for the

products currently stored on-site.

Facility Layout:

Refer to the Site Plan Map incorporated under Attachment 1.

Additional Information:

Service Welding also engages in operations specific to commercial tugboat and barge maintenance and repairs. An additional operation located at the subject location consists of tugboat and barge transportation (fleet) operations owned and operated by Egan

Marine Corporation.

A. Written description of spills, corrective actions taken and plans for preventing recurrence (for spill events within last 12 months).

There has been no major releases to a navigable waterway within the last 12 months.

The small spills which occur are collected using portable pumps and are reintroduced to the product tanks. Residues can additionally be collected by means of manual removal with oil dry, shovels, absorbent pads/booms, etc... These types of deminimus spill cleanup residues, if generated, will be placed for temporary storage in drums, pending off-site transport for disposal. Service Welding is additionally implementing daily and weekly inspection procedures to ensure better housekeeping practices and minimize releases into the environment.

Service Welding has minimized the their tank storage capacity to only include those tanks necessary for their commercial tugboat and barge maintenance/repair operations. The soapstock materials are intended for temporary storage pending procurement of a fair market price for this product. The remaining tanks have been emptied and will not be placed back into operation.

B. Prediction of the direction, rate of flow, and total quantity of oil which could be discharged from the facility as a result of each major type of failure.

Due to the topography of the plant, any release from the 7 - 40,000 gallon ("lay down") tanks used temporarily to store edible grade oil (soapstock) product will flow to the center of the plant which contains a depression within the limestone bedrock with an approximate 1.5 - 2' depth. This structure acts as one of the primary containment system for these storage tanks. Refer to the Site Plan Map (incorporated under Attachment 1) which illustrates the contouring of the storage plant operations. The largest tank within this containment is approximately 40,000 gallons, whereas the current volume of the containment area is in excess of 100,000 gallons. Furthermore, Service Welding has constructed additional concrete diversion structures around the north and east sides of the 40,000 gallon product storage tanks area to prohibit the release of stored materials into the barge slip/Canal.

The 4 - 24,000 gallon boiler fuel tanks that have been chosen to remain in operation are located within a concrete secondary containment structure which will contain 110% of the capacity of the largest tank, plus allows for sufficient free board to accommodate precipitation. (Also note: during and/or immediately after rainfalls, the precipitation accumulation within the secondary containment structures is removed to ensure proper containment remains available).

The petroleum motor fuel tanks dedicated for on-site vehicle fueling purposes have been installed within a concrete secondary containment structure to contain all spills and releases from the tanks.

With regards to the direction and flow rate of the Chicago Ship and Sanitary Canal (Canal), the canal flows from east to west at an average rate of approximately 0.5 miles per hour.

- C. Appropriate containment and/or diversionary structures or equipment to prevent discharged oil from reaching a navigable water course for Onshore facilities:
 - 1. Dikes, berms or retaining walls sufficiently impervious to contain spilled oil;

The soapstock temporary tank storage area is currently contained by means of a two (2) foot high concrete retaining/diversion wall and a depressed area within the bedrock which is the central area of the primary tank storage. This depressed area alone will contain a minimum of 110% of the largest tank (@ 40,000 gallons). The contouring beneath the soapstock storage areas indicate the primary flow direction of spills and releases into the depressed containment area.

Below are the calculations demonstrating sufficient capacity of the current soapstock product containment system at this location:

Est. Capacity of Depressed Area/Soapstock Temporary Storage:

		Total Volume:	128,060 Gallon
99.50	18,963	12,137.50	90,789
99.00	11,976	4,402.75	32,933 `
98.50	3.315	580	4,338
98.15	0.0	0.0	0.0
ELEV	AREA (SF)	<u>VOLUME</u> (CF)	<u>VOLUME</u> (GAL.)

Displacement of Tanks

Not Applicable – the laydown tanks are supported by steel "saddle" structures which place the tanks approximately 24" above ground. The volume displacement of the steel legs of the saddle supports are negligible.

Rainfall accumulation calculations:

Total Area @ 30,942.32 sq.ft. x 2.9 "(ave. Monthly Rainfall*; 0.242 ft.) = 7477.72 cf x 7.48 gal./cf. = 55,933.40 gal.

Available containment capacity = Total Volume @ 128,060 gallons less Rainfall Volume @ 55,933.40 gal. = 72,126.60 gallons (which exceeds 110% of the largest tank @ 44,400 gallons).

Furthermore, as previously described under Item I., Service Welding has installed additional (concrete) containment/diversion structures to ensure the containment of spills and releases from the temporary bulk (soapstock) storage operations. Service

Welding additional removes rainwater accumulation from each containment area immediately following a rain event.

Concrete Containment Area/Boiler Fuel Storage

In reference to the upright, (4-24,000 gallon active) boiler fuel product storage tanks that will remain in operation, Service Welding maintains a concrete secondary containment structure around these tanks. Below is the calculation representing the containment capacity of each containment structure surrounding each pair of boiler fuel tanks:

Dimensions: 30' Wide x 74' Long (= 2220 sq. Ft.) x 3.42 ' High Gross Volume = 7,592.40 cubic feet; (x 7.48) = 56,791 gallons Displacement of Tanks = $10 \times II$ (4 ft)² x 3.42 ft. x 7.48 = 12,858 gallons

Total Available Volume =

43,932 gallons

Rainfall accumulation calculations:

Total Area @ 2220 sq.ft. x 2.9 "(ave. Monthly Rainfall*; 0.242 ft.) = 536.5 cf \times 7.48 gal./cf. = 4,013.02 gal.

Available containment capacity = Total Volume @ 43,932 gallons less Rainfall Volume @ 4,013.02 gal. = 39,919 gallons (which exceeds 110% of the largest tank @ 26,400 gallons).

Concrete Containment Area/Vehicle Fuel ASTs

Regarding the petroleum-based vehicle fueling operations, the current diesel and gasoline tanks are located within a concrete secondary containment structure. The current and proposed boiler fuel tanks are to be re-located to an area equipped with concrete secondary containment. Below are the calculations to demonstrate sufficient containment capacity for these petroleum fuel storage areas:

Vehicle Fuel Tanks: 24' x 15' x 22" Height = 660 cu.ft. = **4950 Gallons** (Note: Because the tanks are elevated on steel structures, the volume displacement resulting from the steel support legs is negligible).

Rainfall accumulation calculations:

Total Area @ 360 sq.ft. x 2.9 "(ave. Monthly Rainfall*; 0.242 ft.) = 87.12 cf x 7.48 gal./cf. = 652 gal.

Available containment capacity = Total Volume @ 4,950 gallons less Rainfall Volume @ 652 gal. = 4298 gallons (which exceeds 110% of the largest tank @ 1650 gallons).

*Note: Source of Date: www.worldclimate.com (Chicago, Cook County, IL)

2. Curbing;

Refer to Item III. A. above.

3. Culverts, gutters or other drainage systems;

None.

4. Weirs, booms or other barriers;

Service Welding does not contain any permanent weirs, booms or other barriers other than the containment structures previously described.

For purposes of responding to spills or releases, Service Welding maintains appropriate spill response equipment to ensure the expeditious containment and removal of all spills and releases. Refer to Attachment 3, for an inventory of all spill response equipment maintained on-site and their location within the plant.

5. Spill diversion ponds;

None.

6. Retention ponds;

None.

7. Sorbent materials;

As referenced under Item 4. above.

- D. Contingency Spill Response Measure
 - 1. A strong oil spill contingency plan following the provision of 40 CFR part 109.

Due to the fact that Service Welding has adequate containment has established effective preparedness and prevention procedures as described herein, a Contingency Plan is not required. However, to ensure that major spills and releases of product materials stored on-site are prevented from discharging to a navigable waterway (the Chicago Ship and Sanitary Canal), Service Welding has elected to establish "in-house" procedures for responding to major spills and releases (i.e., spills and releases that occur or reach outside of the containment system) and has incorporated these procedures herein as part of the SPCC Plan.

Furthermore, because Service Welding shares this location with EMC, a barge and tugboat transportation services operation who by law is additionally mandated to develop emergency response procedures specific to spills or releases that occur as a result of the barging operations, Service Welding will rely on the expertise of EMC, who will be the entity responsible for responding to major spills or releases resulting from on-shore operations that do discharge to the Canal. The same procedures as outlined in EMC's emergency response plan will be implemented in the event a major release from the storage operations is discharged into the Canal. A copy of EMC's Emergency Response Plan(s) as required by 33 CFR Part 154 for the barge transfer and mobile facilities operations are incorporated under Attachment 4 and 5.

SPCC/Contingency Plan Response Procedures

i) Description of Alarm System and Procedures to Activate

Alarm System:

The on-site PA System will be used to identify an emergency, including implementation of the SPCC Contingency Spill Response Procedures herein.

The Emergency Coordinator will be immediately notified in order that implementation of the Contingency Plan can be initiated. The Emergency Coordinator will notify the appropriate Federal, State and local agencies, as necessary. At the sounding of the alarm, all plant personnel will cease their current activity and proceed to the office building or parking area and await further instruction.

ii.) Responsibilities of Emergency Coordinator:

Upon sounding of the alarm or notification of a supervisor, the on-site Emergency Coordinator or alternate will be notified of the emergency and become responsible for the implementation of the Contingency Plan.

In the event more than one designated Emergency Coordinator is on-site, the ranking employee shall be in charge. All employees assigned emergency response duties will report to the Emergency Coordinator for their assignments.

The Emergency Coordinator's responsibilities include:

- Being familiar with:
 - a. The facility contingency plan;
 - b. The facility operations and activities:
 - c. The characteristics and locations of oil substances used or stored on-site;
 - d. The physical layout of the facility; and
 - e. The location of equipment, materials and records in the facility.

- 2. Coordinating the emergency response measures as described in this Plan
- 3. Completion of duties as described in this Plan.

The Emergency Coordinator(s) are authorized to commit the necessary resources, i.e., expend funds, hire contractors, and direct employees as necessary to implement the Contingency Plan.

iii.) Criteria for Implementing the Plan

Reasons for implementing the Contingency Plan may include but are not limited to:

<u>Spills</u>: Any spills of product materials occurring outside of the spill containment areas or structures.

<u>Fire</u>: All fires greater than incipient. Any fire which has the potential for escalating into a major fire, which may jeopardize the control of product materials stored on-site.

<u>Explosions</u>: Any explosion which has the potential for escalating into a major fire and involves product materials, and which jeopardizes the control of these materials.

iv.) Criteria for Assessing Environmental/Public Health Impact

In the event of a fire, explosion, and/or release of product materials to the water or soil outside of the containment systems, the Emergency Coordinator is required to make an assessment of the situation to determine what hazards, both physical and health, are present by the release of the material, and what risk the material hazards present to human health and the environment, both on and off of the site.

It is the Emergency Coordinator's first duty to identify the character, source, amount and extent of any released material. The Emergency Coordinator should estimate or determine, to the extent possible, the amount of material lost.

The Emergency Coordinator must make an assessment of the risk to human health and the environment. He must give consideration to:

- Physical and health hazards
- Prevailing weather conditions
- Likelihood of contaminant migration
- Run off of liquids to surface waters
- Location of human populations and their likelihood of exposure
- Determination of protective clothing and equipment to be used during response activities
- Amounts and concentrations of materials released to the environment
- Amount of time before the situation can be brought under control

73

からます

Likelihood of the initial incident escalating in severity

Service Welding always recommends that the Emergency Coordinator take the most conservative approach to the situation. As part of the assessment process, the Emergency Coordinator will need to determine the nature and severity of the spill event and if coordinating services need to be called in for support, and to what extent, if any, the Contingency Plan will be implemented.

The Emergency Coordinator will establish a command post/communication center from which the Emergency Coordinator directs operations and communicates with outside agencies, local authorities or support services. Any employee assigned to perform a duty on behalf of the Emergency Coordinator must do so in a responsible manner and limit his actions to those specifically assigned to him by the Emergency Coordinator.

v.) <u>Emergency Services Notification Procedures:</u>

In the event of a major release of oil substances (outside of the containment areas), the following persons, will be notified.

Emergency Coordinator	Telephone (Work)	(Home/Pager/Mobile)
Dennis Egan	630/739-6660	972-0948/419-6900/399-3366 (All "630" area code)
Daniel Egan	630/739/6660	972-1116/419-6907/975-6901 (All "630" area code)

If deemed necessary by the Emergency Coordinator, the following services as necessary will be contacted:

Coordinated	Emergency Services	<u>l elepnone</u>
Fire: Lemo	ont Fire Dept.	911
Police: Lem	ont Police Dept.	911
Cook Count	y Sheriff's Dept.	312-458-1000
Ambulance:	Lemont Fire Dept.	630-257-2221
Trauma Cer	nter(s):	
	Silver Cross Hospital Palos Community Hosp. Loyola HospBurn Ctr.	815-740-7050 708-361-4500 312-531-3000
	Response Agencies sponse Center	<u>Telephone</u> 800-424-8002

Illinois Emergency Services &

Disaster Agency

217-782-7860

Metropolitan Water Reclamation

District of Greater Chicago

312-751-5600

U.S. Coast Guard, Marine Safety Office

312-353-1226

Office, Chicago

Emergency Response Contractor

Telephone

HERITAGE (Chicago)

1-800-487-7455 (24-Hour)

NOTE:

If the emergency coordinator determines that the facility has had a release, fire or explosion which could threaten human health or the environment <u>outside</u> the facility, he/she will immediately notify the National Response Center.

The report should contain the following information:

- Name & telephone number of the reporter
- Name & address of the facility
- Time & type of incident
- Name & quantity of material(s) involved
- Extent of injuries, if any
- Possible hazards to human health or the environment outside of the facility.
- Response efforts already initiated or planned

vi.) Emergency Response Procedures

In the event of a fire, explosion, or other major release of oil products outside of the containment area(s), the Emergency Coordinator will be contacted immediately and shall assume responsibility for implementing the Contingency Plan and/or responding to the emergency as necessary. Any employee who discovers an emergency situation, shall immediately activate the alarm system, leave the immediate area and notify his supervisor or other responsible person and proceed to the office and/or parking lot following a safe route. The supervisor shall immediately notify the Emergency Coordinator as listed above.

Fire:

The fire department should always be summoned immediately to have trained professionals on hand or to respond if the fire has progressed beyond an incipient fire. If it is safe to do so, responding (trained) employees, under the direction of the Emergency Coordinator, may begin fire fighting measures. This includes:

Application of portable or other fire extinguishing equipment;

Removing or isolating materials which may contribute to perpetuating or to exacerbating the incident.

Should the fire escalate to a level beyond incipient, response procedures are to be given up to fire responders.

The Emergency Coordinator shall direct non-responding personnel to remove themselves to a place of safety, upwind of the incident. If evacuation is necessary, the evacuation procedures will be followed.

As soon as possible after the discovery of the fire, explosion, or major release, the Emergency Coordinator will order a controlled and orderly shut down of operations and processes. The Emergency Coordinator will also monitor processes or operations which were shutdown in response to the emergency for build-up of pressure, leaks, ruptures, etc., and initiate the rescue of injured employees, if it is safe to do so. The Emergency Coordinator shall also take steps to contain or prevent the runoff of impacted fire fighting water and the migration of product(s) involved in the incident by application of spill absorbent media or use of heavy equipment to construct temporary berms, and/or use of vacuum systems to intercept and remove any resulting migration of materials.

Upon resolution of the fire, the Emergency Coordinator shall initiate actions for the clean-up and decontamination of the site, and the equipment used to respond to the incident. The Emergency Coordinator will also provide for the characterization, treatment, storage or disposal any contaminated debris, water and soil generated by the event. Operations will not be resumed until the facility and emergency equipment are returned to full capability of their intended use.

Additional Information:

Under no circumstances should employees attempt to fight fires without summoning the fire department first. <u>Employees should never jeopardize their lives or safety in attempts to control or fight fires</u>.

Spills:

If a major spill should occur outside of the spill containment areas or exceed the capacity of the containment structure, the Emergency Coordinator will initiate a response to control, contain and recover the spilled substance. The Emergency Coordinator must evaluate if the facility's employees are capable of making an effective response, and have adequate personal protection. Initial response efforts for releases or spills from tank storage areas include:

- Removing, isolating, extinguishing or turning off all possible ignition sources;
- Shut down of facility operations in an orderly fashion and monitoring for dangerous conditions such as build-up of pressure, ruptures, leaks, etc.
- Locating the source of the spill:
- Shutting off, capping, plugging or patching the source of the spill, or

transferring the material into a secure storage unit, if it can be done so safely;

- Placing containment boom or other material around the spilled material and its source;
- Removal of materials in the immediate vicinity of the affected area as necessary to minimize aggravation of the incident;
- Recovery of the spilled substance using pumps, vacuum equipment, absorbent;
- Placing the material in an appropriate secure container, tank or barge within an (unaffected) storage area in accordance with appropriate storage procedures.

If the spill is too large for the facility employees to handle expeditiously, or the spill event has resulted in the discharge of oil into the Canal, the Emergency Coordinator shall be prepared to contact an emergency response contractor or other services which may assist in the containment, recovery and clean-up of the spilled material. The Emergency Coordinator shall also contact the appropriate environmental regulatory agencies and coordinated emergency services.

Should a spill occur outside of a containment area, the Emergency Coordinator must take actions immediately to prevent migration of the substance or into navigable waterways.

vii.) Criteria for Facility Evacuation

The decision to evacuate the facility or locality falls to the Emergency Coordinator, given the specifics of the incident. Non-essential personnel may be evacuated at the discretion of the Emergency Coordinator —and will be instructed where to assemble by the Evacuation Officer.

Evacuation Procedures

Responsibilities:

- a. The Emergency Coordinator is responsible for implementing the evacuation procedure.
- b. Each Supervisor is responsible for directing employees and visitors in his/her section to the proper exit and their assigned safe area.
- c. The Evacuation Officer (designated by the Emergency Coordinator) is responsible for designating evacuation routes, rendezvous points and accounting for all evacuated employees and visitors.

Procedure:

- a. The Emergency Coordinator will notify supervisors if an evacuation may be necessary.
- The Emergency Coordinator will assess the conditions and order an evacuation or other actions required. The evacuation signal will be given by verbal notification and/or alarm signal (continuous short blasts over the PA).
- c. When an evacuation is announced, stop work. Supervisors will direct employees in their areas to the closest available exit. All exits within any buildings are clearly marked with lighted or distinguishable signs.
- d. All employees must leave the facility and report to the designated assembly area which will typically consist of the office area and/or parking lot or access road into the facility. Do not run. Do not linger in entrance ways or driveways; stay together in your assigned safe area.
- e. Each employee must report to the Evacuation Officer at the assigned safe area.
- f. The Evacuation Officer will specify a safe route of evacuation and a rendezvous point for employees to meet for a final accounting and further instructions.
- g. The Evacuation Officer must report to the Emergency Coordinator when his/her employees have cleared the facility.
- h. The Emergency Coordinator will notify the Evacuation Officer when it is safe to re-enter the facility.
- i. Stay outside the facility until notified by the Evacuation Officer when it is safe to re-enter.

Emergency Precautions:

- a. Keep calm, think, avoid panic and confusion.
- b. Know all exit locations. Be sure you know the safest and quickest way out of all buildings.
- c. Do not lock office doors when vacating the facility. The Emergency Coordinator and emergency support personnel must have visual access to all areas to ensure that the facility is clear of personnel.
- d. Do not delay evacuation of the facility for any reason.

- e. Do not assist in fire control unless properly trained, qualified and requested to do so by the Emergency Coordinator.
- f. When evacuating the facility, <u>WALK</u> to the nearest safe exit. Report to the personnel assembly area as directed and wait for instructions.
- h. Keep out of the way, stay clear of the facility, and <u>DO NOT</u> interfere with the emergency operations.

Evacuation Routes/Plans:

In the event of an emergency, employees may be instructed to evacuate the plant.

Notification of evacuation will be given either by voice instruction or by an alarm signal (continuous short blasts over the PA).

Employees will proceed to the parking or office reception area, or another area indicated by the Emergency Coordinator where all employees will be accounted for by a ranking employee. A person shall be appointed by the Emergency Coordinator to act as the Evacuation Officer. The Evacuation Officer will instruct you to leave the site and specify a route of evacuation. You will be instructed to proceed to a rendezvous point where the Evacuation Officer will confirm everyone has been safely evacuated.

Upon giving the employees their evacuation instructions, the Evacuation Officer shall observe the employees' evacuation, and report to the Emergency Coordinator when all employees have left. The Evacuation Officer shall then leave the site, and proceed to the rendezvous point, checking along the way for stragglers or employees with disabled vehicles. At the rendezvous point, the Evacuation officer will confirm that all employees have safely arrived. If any employees are missing, the Evacuation Officer should report their absence immediately to the Emergency Coordinator, and local authorities. The Evacuation officer will then instruct you if you should proceed home or await further instructions.

viii.) Post-Emergency Response Procedures

Upon conclusion of the incident, the Emergency Coordinator will be responsible for the following event's conclusive efforts:

- direct and provide for the clean-up, characterization, treatment, storage or disposal of cleanup residues, or contaminated soil or water, or other materials involved in the incident.
- All emergency equipment is decontaminated, properly disposed of, resupplied, or fit for its intended use before operations resume.
- Maintain complete details of the incident, including an activity log, records
 of treatment, storage or disposal, medical or accident reports, and other
 information describing the incident, response and resolution.

ix). Emergency Equipment

Attachment 3 provides an inventory and description (Incl. Map) of the location of equipment available on-site to respond to fires, spills or releases of materials.

Heavy equipment and vehicles available for emergency response are maintained and inspected on a schedule established by the maintenance personnel.

Pumps, compressors, blowers, etc. are inspected and maintained as use dictates.

x.). Amendment of Contingency Plan

The Contingency Plan will be reviewed, and immediately amended, if necessary, whenever:

- The plan fails in an emergency;
- The facility changes in its design, construction, operation, maintenance or other circumstances — in a way that materially increases the potential for fires, explosions or releases, or changes the response necessary in an emergency;
- The list of emergency coordinators changes;
- 2. A written commitment of manpower, equipment and materials required to expeditiously control and remove any harmful quantity of oil discharged.

Enclosed under Attachment 6 referenced above is a signed written commitment of manpower, equipment and materials to effectively respond to a major discharge of oil.

- E. Additional Spill Prevention and Containment Procedures.
 - 1. Facility drainage;

A topographic survey of the plant operations was completed. The primary drainage pathways are to the center of the facility to an approximate 1.5' - 2 feet depressed area located with the bedrock. The southern section of the facility adjacent to the Canal is relatively flat.

Bulk storage tanks;

Service Welding has the following storage tanks presently in use:

Total # of tanks	Tank Identification Number	Approximate Dimensions/Volume	Product Stored
7	40-1 Thru 40-7	13'x40'/40,000 Gal.	Veg. oil product/Soapstock
4	B-1, B-2, B-3, B-4	9'x20'/15,000 Gal.	Boiler Fuel
1	# 8	4'x15'/1500 Gal.	Diesel Fuel tank for road vehicles
1	#9	4'5'/500 Gal.	Gasoline tank for yard vehicles
1	#10	4'x8'/800 Gal.	Diesel Fuel for yard vehicles

The seven soapstock storage tanks are to be in use temporarily. Service Welding and Ship Building will be emptying these tanks of their product as soon as a buyer can be procured.

 Tank materials of construction and conditions of storage such as pressure and temperature, etc.

All tanks presently in use are of mild steel construction which is compatible with the product that is being stored, i.e., vegetable oil product (soapstock) and petroleum products. All products are stored at ambient pressure and ambient temperature.

ii. Secondary means of containment (entire contents of the largest single tank plus sufficient freeboard to allow for precipitation).

Refer to Item C.1. Additionally, secondary containment areas will be inspected on a routine basis for precipitation accumulation. Any precipitation accumulation will be inspected daily and removed to ensure sufficient capacity remains.

- iii. Drainage of rainwater from the diked area into a storm drain or an effluent discharge.
 - a. By-pass System

There are no storm drains from the ASTs' containment systems located on-site. Currently, Service Welding is managing the stormwater accumulation within containment areas by means of discharge under a NPDES permit issued by the Illinois EPA, Division of Water Pollution Control (Permit # ILR 005304).

b. Inspection of the run-off rainwater.

Currently, precipitation is collected within the containment structure. Prior to discharge, Service Welding inspects the stormwater accumulated within the containment areas itself for evidence of free-phase product. All free-phase product will be removed via pumps or absorbent pads/booms prior to discharge of the stormwater to the

Canal. Testing of the stormwater discharge has revealed the <u>lack</u> of applicable constituents, i.e., oil and grease, pH and selected petroleum constituents above the effluent discharge standards of 35 IAC Subtitle C (Part 304).

Additionally, formal inspection procedures have been developed to address the immediate response to small deminimus spills and to maintain good "housekeeping" operations. A copy of the inspection procedures and forms are incorporated under Attachment 7.

c. By-Pass Valve Operation

Not Applicable.

d. Adequate records are kept of events.

Not applicable. The stormwater is managed under an NPDES Stormwater permit.

iv. Buried metallic storage tanks

There are no underground storage tanks present at the facility.

v. Partially Buried Metallic Storage Tanks

There are no partially buried storage tanks present at the facility.

vi. Periodic Integrity Testing

On an annual basis, the tanks remaining in permanent use will be emptied and the interiors visually inspected for signs of degradation. Additionally, every five years the tanks will be subject to ultra-sonic testing. The results of these tests will be maintained on record for three years.

vii. Internal heating coils

Only Tanks B-1 and B-2 are equipped with internal heating coils. The steam is vented from these tanks to the atmosphere. As part of the daily inspection of the plant, the steam effluent will be inspected to ensure there is no product in the discharge steam line.

viii. Aboveground tank spill control overflow equipment.

Due to the small number of tanks (boiler fuel) to remain in operation and the small number of transfers that take place from the barge to the tanks, in lieu of automatic tank gaging devices, all tank filling operations are manned during the entire process of loading to prevent the potential for overfilling. With regard to the smaller (gasoline & diesel) fueling tanks, the supplier is required to visually inspect the tanks during loading and ensure no spills or overfills occur.

ix. Plant effluent inspection.

The only effluent that is discharge form the facility is the stormwater that accumulates within the AST containment structures. These are visually inspected for free phase oil prior to discharge to the canal.

x. Visible oil leaks inspection.

All tanks and associated containment areas are inspected during the daily operations of the facility. Due to the limited number of tanks that are in active operation, only one person is dedicated to inspect the tanks and plant on a daily basis/weekly basis. Any visible oil leaks will be immediately removed. Attachment 7 provides procedures to be followed during an inspection.

xi. Mobile or portable oil storage tanks.

None.

3. Facility transfer operations, pumping, and in-plant process (onshore);

There are currently only 11 tanks that are in active use at this time at the plant. The 7 - 40,000 gallon tanks are full at this time and are intended to be emptied at such time a buyer can be obtained for this product. There are no transfers occurring from these tanks. They are presently serving as bulk storage units. The only remaining active tanks at this location are the four (4) 24,000 gal. boiler fuel tanks. These tanks are used to store boiler fuel that is stripped from the fuel barges that are maintenanced by Service Welding. Barge to tank transfers (of boiler fuel only) are done so by means of an on-site vacuum tanker and flex hosing and are additionally subject to the provisions of EMC's Coast Guard Emergency Response Plan. Tank to tank transfers are completed using portable pumps and flex hosing. Portable "drip pans" are used to contain spillages from valve connections during tanker to tank and tank to tank transfer of materials. There is no product piping in operation at the plant. Additionally, there is no buried piping located on-site.

When the vehicle fuel tanks (gasoline and diesel ASTs) are fueled, the supplier additionally is required to utilized drip pans to contain any deminimus spills from valve connections during transfer operations.

- 4. Facility tank car and tank truck loading/unloading rack;
 - i. IDOT Requirements --

IDOT's requirements regarding Loading/Unloading (49 CFR 177, Subpart B) is specific to hazardous materials. Service Welding only manages boiler fuel through on-site transfers. Boiler fuel is not a hazardous material. The only materials accepted at the facility which would be subject to Subpart B would be the gasoline shipments provided by an off-site supplier. It is the responsibility of the supplier to comply with Subpart B. Service Welding has

communicated this to the supplier and primarily has emphasized the following:

- No smoking during loading
- Handbrake to be set
- Attendance of vehicle during duration of unloading operation
- Assurance that all valves and hoses are closed and sealed following off-loading

ii. Containment system

Fueling of the small vehicle fuel storage tanks is completed along side the west end of the containment area. The containment system walls for these tanks and the adjacent building will act as diversion structures to contain any major spills or leaks from the unloading operations associated with the filling of the small gasoline and diesel fuel tanks, until such time response action can be implemented. The general topography from this area is sloped primarily toward the south and therefore and major spills or releases will be contained by the building and containment structure to the south and east.

Additionally, transfers of boiler fuel from barge to tanks is completed by means of a small (max. 3000 gal.) on-site vacuum tanker (which is thus subject to the provisions of EMC's Coast Guard Response Plan) When unloading from the vacuum tanker to one of the boiler fuel tanks, the vacuum tanker is parked along the west side of the "B" tanks' containment system. In the event of a major release from the vacuum tanker itself, the containment wall would act to prohibit the release from reaching the nearest entrance into the Canal and the topography dictates the flow of materials towards the "depressed" area, which has enough demonstrated capacity to contain the contents of the trucks capacity.

- iii. Physical barrier system, (loading/unloading areas). During transfer operations all tankers will use chocks to prevent premature departure during loading and unloading.
- iv. Tanker truck inspection During unloading all equipment, including the transport tanker, is continuously monitored to ensure there is no leakage from the vehicle's tanker or hose connections. Emphasis will be placed on inspection of the vehicle prior to loading and off-loading.

5. Inspections and records;

The ASTs are inspected on a daily basis and the entire plant is inspected weekly. Inspections are completed by one dedicated individual, Mr. Daniel Egan. In the event an incident, malfunction or deterioration is observed, the inspection will be recorded and the response action taken shall additionally be recorded. The results of periodic integrity testing of the tanks shall also be recorded.

All records of such inspections shall be maintained for three years from the date thereof.

i. There are security personnel (under contract) on-site 24 hours a day to ensure access to the facility is prohibited except by authorized personnel. Additionally, there is an 8' cyclone fence (topped with barbed wire) surrounding the entire facility, with locking gate access for vehicles.

gerrane and

- ii. The drain valves on each of the tanks are maintained in closed position when in non-operating status. These are inspected on a daily basis to ensure they are closed. Transfer operations personnel are additionally trained to ensure that the valves are tightly closed following each transfer.
- iii. Only portable pumps are used for transfer operations.

AND CHARACTER OF THE PERSON OF

- iv. There are no active product pipelines in use at the facility. Only portable flexible hosing is used for transfer operations specific to the boiler fuel tanks. The soapstock storage tanks are only in temporary (bulk storage only) use and no transfer of these materials is taking place. The overhead piping associated with the former transfer operations of these materials has been taken out-of-use.
- v. There are overhead lights located at each of the storage areas to provide adequate lighting during night time hours. Additionally, the plant is closed and gated during evening hours and is subject to 24 hour security surveillance.
- 7. Personnel, training and spill prevention procedures;
 - i. Personnel Training

Service Welding realizes that implementation of the SPCC Plan would not be possible without proper education and training of its employees involved with product management on how to respond to emergencies and excise precautions to prevent sudden or non-sudden releases. All plant personnel involved with AST storage or management operations are trained specific to the SPCC procedures.

The initial and continuing training program includes:

- Communication about all products used or stored on-site;
- Proper management of equipment during product storage and transfer operations
- Emergency notification procedures;
- Emergency response procedures;
- Evacuation procedures;
- Spill, fire and release preventative measures and controls.

Presently there are two persons involved with the day to day AST management operations:

Daniel Egan, Plant Manager

Andrew Chanda, USCG licensed tankerman.

Copies of the personnel training for these individuals is maintained on record at the facility.

ii Frequency of Training


All operations personnel involved in the management of the AST systems on-site will be subject to SPCC briefings at such time there is a spill event or failure, malfunctioning components and any changes made to the SPCC plan herein.

Furthermore, the AST/SPCC Management Personnel are required to attend competent person seminars every five years in accordance with the United States Coast Guard requirements.

ATTACHMENT 1:

REGIONAL SITE TOPOGRAPHIC MAP AND TOPOGRAPHIC SITE PLAN MAP

SPCC PLAN (12/2000) -- SITE TOPOGRAPHIC LOCATION MAP SERVICE WELDING & SHIP BUILDING, NE CANAL BANK ROAD, LEMONT, ILLINOIS

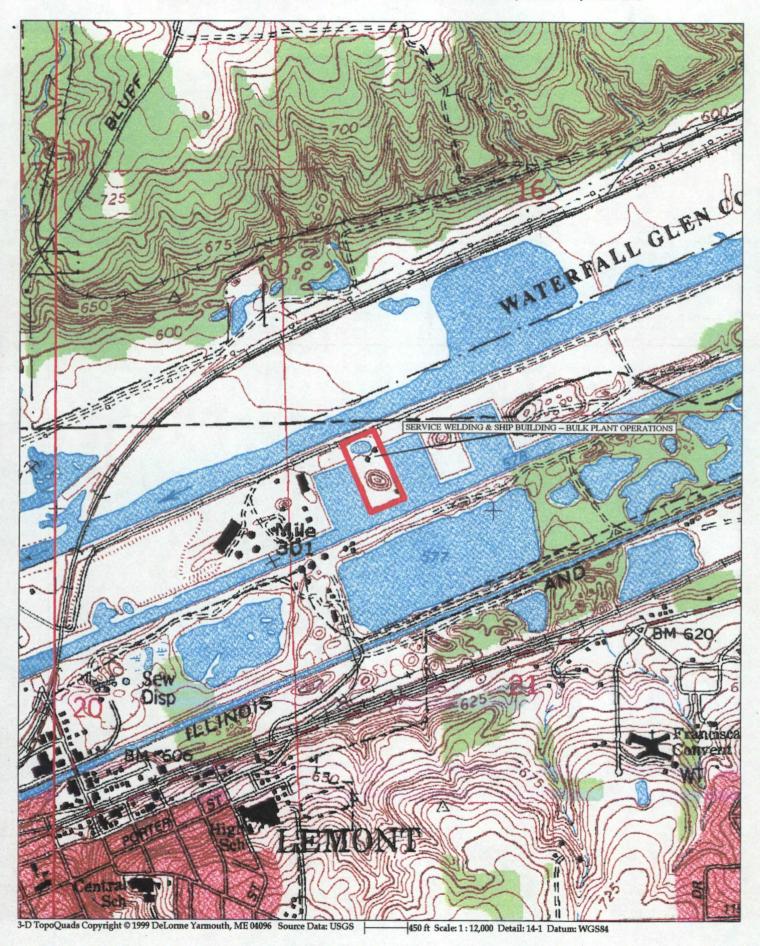

ATTACHMENT 2:

STORAGE PRODUCT MATERIAL SAFETY DATA SHEET(S)

ly be used to comply with DIA's Helped Communication I PR 19 6.1200. Stant - meutred for specific requirements for their section I protection in the protection of the Parking Seek Cry. 5 566. Faries Parking ocatus. Illinois 6 ection II — Hezardous ection II — Hezardous	ARCHER DANIE	·		24-7444	of Administration	
CFR 19 6.1200. Stant neutred for specific requirements of their er Lane Secretarias Name richer Daniels Midliters parass, Street, Chr. 5 666. Faries Parkuay ecatus Illinois 6	ARCHER DANIE	·	Four No. 2171 Four No. 2171 Four No. 21714 Totapharus Number	24-7444	nce must be marked to	
etion II — Hazardous	To Occur 3	·	Fax No. 217/4 Fax No. 217/4 Totaphore Number	24-7444	nce must be marked to	
Socostocke ection I mutaturers Name rcher Daniels Midl dress Parker, Street, Chr. 1 166 Faries Parkery scatus Illinois 6 ection II Hazardous	To Occur 3	·	Fax No. 217/4 Fax No. 217/4 Totaphore Number	24-7444	nce must be marked to	
Socostocke setton I mutatorers Name rcher Daniels Midl dress Parker, Sree, Chr. 1 166 Faries Parkery scatur Illinois 6 setton II Hazardous	Co. Dept. Fac No.	X 1	Totophare Number	5	nce must be marked to	
retion I retions Name Ther Daniels Midlers Parker, Street, Cry. 1 166 Faries Parkery Scattle Illinois 6 Retion II Hazardous	Dopt. Fax No.	X 1	Totophare Number	5		
references Name Ther Daniels Midl dress prepare, Street, Cy, 1 566 Faries Parkusy Scatus Illinois 6 Section R — Hazardous	Fac No.		Telephone Number	5		
cher Daniels Midlers Purpos, Stee, Ch. 1 666 Faries Parkuay Scatus - Illinois 6 Section II - Hazardous			Telephane Numbe		<u> </u>	
does pupper, Steek Cy, 1 166 Facios Parkuay ocatus - Illinois 6 setion II - Hazardous			Telephane Numbe			
ector II - Hazardous			As above		,	
estur II Lincis 6			Cara Francisco			
action II Hazardous	25256		U-84 /7906/90			
ection II - Hezerdous		,	May 26. 19	188	•	
			Squalury of Pres	-		
					•	
	Ineredients/Identit	y Internation				-
esardous Companionio (Bassil					Other Upwell	
	is Chamina Identity; Con	menter Manne(S)	OSHA FEL	ACCIM TLY		معموما وي
	<u>, j</u>					
······································						
 			·			
·	•					
						
						
·						
•					'	
					•	
						-
···········						
•						
				·		
						
Section III — Physical(Penical Character	ristics	·			
Barling Point			Specific Greaty			
	<u>•</u>	212°F		(0.	9236 - 1.000)	}
Vapor Pressure (pun Hg.)	•		Mattery Point			
· · · · · · · · · · · · · · · · · · ·		Liquid	1			
Vescr Cenery (AR - 1)			Everyone No.	•	····	
		Liquid	(Bully Academy -	. 1]	·	
Screenly in White		-			•	
	49:					
Appearance and Oder	a leaded maller		S _t .			
	n liquid yello		10			
Section IV - Fire and	Explosion Hezard	Deta			• .	•
			Planmable Lim		LEL	LUEL
Floor Port (Mathed Libert)	ሳ			-		1
Plant Point Planted Lieuts 540 P (CC	•					
Plant Partification Liberty 540°P (CC Entropositing Media						
Plant Particulation 11 540°P (CC Entropyshing Made Hater sp	ray, dry chemi	cal, fcam o	or carbon di	oxide		
Plant Partification Liberty: 540 P (CC Entropeating Made	ray, dry chemi	cal, fcam o	or carbon di	oxide		
Plant Portification Library 540°P (CC Entropyshing Made Hater sp	ray, dry chemi	cal, fcam o	or carbon di	oxide	· ~ \	
Plant Portification Library 540°P (CC Entropyshing Made Hater sp	ray, dry chemi	cal, fcam o	er carbon di	oxide	QH	
Page Particulated Lines 540°P (CC Entropyshing Made Hater Sp. Spread Fee Repairs Page 14	ray, dry chemi	cal, fcam o	or carbon di	oxide	84	
Plant Portification Library 540°P (CC Entropyshing Made Hater sp	ray, dry chemi	cal, fcam (or carbon di	oxide	84	
Plant Partification 11500 540 °P (CC Entropyment) Made Kater sp Special Fire Pighting Process.	ray, dry chemi	cal, form	or carbon di	oxide	-SH-	-

	Unelate		Conditions to Avoid			
•	State	+	 			
	<u> </u>	X	Extended heat	lng		·
CALIBITA	Materiells to Avoid	ŋ	Oxidizing ager	1 r <		
ous Decer	npassion or Pypro	ducto				
Acre	May Occur		Conditions to Avoid	-		
men Labor					·	
	Will Not Occur	l x	,			
tion VI -	- Health Hazar	d Data				
wish of Entry		7		Sin17		Ingestion?
M Hearnes	Aque end Chanc	, 				· · · · · · · · · · · · · · · · · · ·
		·				·
				<u> </u>	 	
	:					
смодельсту:	; N	ד קדו		IARC Menographs	,	CSIA Required?
 	•					
	zome of Esposure		· •			
	:					
des Candille		_				
AGN VARIA	meted by Exponen					
	<u> </u>					
angement energ	Phil Aid Process	~				
			· 			
			ada Mandilan and No.			
etion VII	- Proceution	g (mr 9				
	- Precaution					
es in Se Ta		nd is A	lamest or Sprint			
Contain	ion in Case Mose	nd by Au	lamest or Sprint			
Contain	ion in Case Mose	nd by Au	ck-110			
Contain	ann in Case Mene rei spille an right absorbe	ne in Au nd pi	ck-un.	hot water		
ops to So Ta Combaile Clean v	en in Case Mee es spills ar cith absorbe i Morney In ap	ne te Au rei pi reit m	ck-up. this or wash with	hot water	estes foll	ow federal,
contain Contain Clean were Character state of	n Cise Mee es spills ar rith absorbe i Meres In ap or local re	ne to Au ant ma properi gulati	ck-up. dia or wash with tate land fill fo	hot water	estes foll	ow federal,
contain Contain Clean were Character state of	en in Case Mee es spills ar cith absorbe i Morney In ap	ne to Au ant ma properi gulati	ck-up. dia or wash with tate land fill fo	hot water	estes foll	ow federal.
Clean water Capena state Capena	in in Case Means and III and in Apparent in Apparent in Apparent in Apparent in Hamilton i	peoper	cheto Speed cheto cheto cheto cheto or wash with tate land fill fo lons.	hot water		ow federal,
Clean were	in in Case Messons so it is appointed in appointed in appoint in appoint in items of the interval in items of the interva	peoper	ck-up. dia or wash with tate land fill fo	hot water		ow federal,
Clean water Capena state Capena	in in Case Messons so it is appointed in appointed in appoint in appoint in items of the interval in items of the interva	peoper	cheto Speed cheto cheto cheto cheto or wash with tate land fill fo lons.	hot water		ow federal.
Clean were	in in Case Messons so it is appointed in appointed in appoint in appoint in items of the interval in items of the interva	peoper	cheto Speed cheto cheto cheto cheto or wash with tate land fill fo lons.	hot water		ow federal.
contrain Contrain Clean was Dispose scate of scate of sca	in in Case Mess se soille er cith absorbe In ap se local re 84 Token in Hen excessive b	ne is flat nd pi ent me propri quiet ding ent	ck-up. chia or wash with ate land fill follows. Sorne	hot water		ow federal.
Clean water Clean to the Character of th	in in Case Messons so it is appointed in appointed in appoint in appoint in items of the interval in items of the interva	ne to Report of the Property o	ck-up. chia or wash with ate land fill follows. Sorne	hot water		ow federal.
Clean water Clean Williams Processed	is in Case Mass se soille ar cith absorbe In ap se local re 84 Telen in Han excessive been	ne is fla rd pi rd pi record gulat ding and	ck-up. chia or wash with ate land fill follows. Sorne	hot water r non toxic w	quality.	ow federal.
Clean water Clean to the Character of th	in in Case Mass set aprilla ar righ absorbe In apport In appor	proper ment ment ment ment ment ment ment ment	ck-un. chia or wash with late land fill for lons. Sonny	hot water	quality.	ow federal.
Clean water Clean Williams Processed	is in Case Mass se soille ar cith absorbe In ap se local re 84 Telen in Han excessive been	proper ment ment ment ment ment ment ment ment	ck-un. chia or wash with late land fill for lons. Sonny	hot water r non toxic w	quality.	ow federal.
Clean water Clean Williams Processed	in in Case Mass se spills ar righ absorbs In app se local re 84 Teles in Her extraction (Speed) Morrance (Case Assorbs	proper ment ment ment ment ment ment ment ment	ck-un. chia or wash with late land fill for lons. Sonny	tain product	quality.	ow federal.
Clean water Clean Williams Processed Clean Williams Processed Clean Williams Processed Clean Williams Clean Willia	in in Case Mass se spills ar righ absorbe In app se local re 84 febrain in Here Extraction (Severy in Mechanics) (Case Behaus Machanics) (C	property of the second	chesser speed chesser speed chesser speed with the land fill for lons.	tain product	QUALITY.	ow federal.
Clean wire Characters to contain the contain the Characters to contain the con	in in Case Mass se spills ar righ absorbs In app se local re 84 Teles in Her extraction (Speed) Morrance (Case Assorbs	property of the second	chesser speed chesser speed chesser speed with the land fill for lons.	tain product	quality.	ow federal.

JAN-17-1995 11:40 ADMT DECATUR IL

MATERIAL SAFETY DATA SHEET....

MANUFACTURER/SUPPLIER: Service Welding and Shipbuilding 1.O. Box 660 Lemont Illinois 60439

EMERGENCY TELEPHONE NUMBER (708) 739-6660

Chemical Name: ACIDULATED SOYBEAN OIL

Trade Name: ACID OIL

Hazardous Ingredients: None

Hazardous Mixtures of Other Liquids, Solids, or Gases: By-product of vegetable oil processing,

not hazardous.

PHYSICAL DATA

Boiling Point (F°): >400° F

Vapor Pressure (mm Hg) @ 20° C: 1

Vapor Density (air=1): >1

Solubility in Water: Very Soluble

Specific Gravity (H2O): 0.95

Percent Volatile by Volume @ 100° C: <2.0

Evaporation Rate: NA

Appearance and Odor. Dark brown liquid or semi-liquid with a strong odor.

FIRE AND EXPLOSION HAZARD DATA

Flash Point: >350° F

Extinguishing Media: CO2 foam or dry chemical

Special Fire Fighting Procedures: Use self-contained breathing apparatus

Unusual Fire and Explosion Hazards: A flammable vapor-air mixture may form if the porduct is heated

above the flash point.

HEALTH HAZARD INFORMATION

Threshold Limit Value: No known health hazards.

Effects of Overexposure: None under normal handling conditions.

Emergency and First Aid Procedures:

Contact Areas: Wash with soap and water. Ingestion: Induce vomiting and call a physician

Inhalation: Apply artificial respiration if needed. Call a physician.

REACTIVITY DATA

Stability: Stable

Incompatability: Compressed oxygen and other oxidizing agents.

Hazardous Decomposition Products: Fumes may be toxic if product is heated to decomposition.

Hazardous Polymerization: Will not occur.

· SPILL OR LEAK PROCEDURES

Steps to be Taken in Case Material is Released or Spilled:

Pump or scoop into containers. Use absorbent or flush with detergent and hot water.

Waste Disposal Method:

Use an approved land-fill or incinerate. Ensure compliance with local, state or Federal regulations.

SPECIAL PROTECTION INFORMATION

Ventilation: Mechanical. Protective Gloves: Rubber.

Eye Protection: Splash-proof goggles. Other Protective Equipment: Coveralls.

SPECIAL PRECAUTIONS

Precautions to be Taken in Handling and Storing: Use normal handling conditions. Store in tanks away from heat sources that exceed the flash point.



MATERIAL SAFETY DATA SHEET

CHEMICAL PRODUCT & COMPANY IDENTIFICATION

TRADE NAME

REFORMULATED GASOLINE

CAS NUMBER

MIXTURE

MSDS NUMBER

5467

PRODUCT CODE

ND

SYNONYM(S)

MOTOR FUEL

UNLEADED GASOLINE

APPLICABLE TO ALL GRADES

MANUFACTURER

Koch Petroleum Group, LP.

PO Box 2608

Corpus Christi, TX

78403

TELEPHONE NUMBERS - 24 HOUR EMERGENCY ASSISTANCE

Koch Petroleum Group, L.P.: 361-241-4811

CHEMTREC:

800-424-9300

TELEPHONE NUMBERS - GENERAL ASSISTANCE

8-5 (M-F, CST)

361-241-4611

8-5 (M-F, CST) MSDS

316-628-6468

Assistance

COMPOSITION / INFORMATION ON INGREDIENTS

Ingredient Name	CAS Number	Concentration*	Exposure Limits / Health Hazarda	
GASOLINE, UNLEADED	MIXTURE	82 - 100 %	Gasoline: 300 ppm 8-Hour TWA (ACGIH) 500 ppm 15-Min STEL (ACGIH)	
TOLUENE	108-88-3	0 - 20 %	200 ppm 8-Hour TWA (OSHA) 300 ppm CEILING (OSHA) 50 ppm 8-Hour TWA (ACGIH)	
XYLENES	1330-20-7	0 - 18 %	100 ppm 8-Hour TWA (OSHA) 100 ppm 8-Hour TWA (ACGIH) 150 ppm 15-Min STEL (ACGIH)	
ETHYL-T-BUTYL ETHER	637-92-3	0 - 18 %	5 ppm 6-Hour TWA (ACGIH)	
TERT-AMYL METHYL ETHER	994-05-8	0 - 18 %	ND	
METHYL-T-BUTYL ETHER	1634-04-4	0 - 15 %	40 ppm 8-Hour TWA (ACGIH)	
ETHYL ALCOHOL	64-17-5	0 - 10 %	1000 ppm 8-Hour TWA (OSHA) 1000 ppm 8-Hour TWA (ACGIH)	
NHEXANE	110-54-3	0-7%	500 ppm 8-Hour TWA (OSHA) 50 ppm 8-Hour TWA (ACGIH)	
T-BUTYL ALCOHOL	75-65-0	0-7%	100 ppm 8-Hour TWA (OSHA) 100 ppm 8-Hour TWA (ACGIH	

Ingredient Name	CAS Number	Concentration*	. Exposure Limits / Hoelth Hazards
ETHYLBENZENE	100-41-4	0-4%	100 ppm 8-Hour TWA (OSHA)
			100 ppm 6-Hour TWA (ACGIH) 125 ppm 15-Min STEL (ACGIH)
			123 ppin 10-min 0122 (100si i)
CYCLOHEXANE	110-82-7	0-3%	300 ppm 8-Hour TWA (OSHA)
			300 ppm 8-Hour TWA (ACGIH)
METHYL ALCOHOL	67-56-1	0-3%	200 ppm 6-Hour TWA (OSHA)
			200 ppm 8-Hour TWA (ACGIH)
	Conse		250 ppm 15-Min STEL (ACGIH)
1.2.4-TRIMETHYLBENZENE	95-63-6	0-2%	25 ppm 8-Hour TWA (ACGIH)
BENZENE	71-43-2	0 - 1.3 %	1 ppm 6-Hour TWA (OSHA)
			5 ppm 15-Min STEL (OSHA)
	•		0.5 ppm 8-Hour TWA (ACGIH)
			2.5 ppm 15-Min STEL (ACGIH)
NAPHTHALENE	91-20-3	0-1%	10 ppm 8-Hour TWA (OSHA)
			10 ppm 8-Hour TWA (ACGIH)
			15 ppm 15-Min STEL (ACGIH)
CUMENE	98-82-8	0-1%	50 ppm 8-Hour TWA (OSHA)
		•	50 ppm 6-Hour TWA (ACGIH)

[&]quot;Values do not reflect absolute minimums and maximums; these values are typical which may vary from time to Sme.

This Material Safety Data Sheet is intended to communicate potential health hazards and potential physical hazards associated with the product(s) covered by this sheet, and is not intended to communicate product specification information. For product specification information, contact your Koch Petroleum Group, LP. representative.

HAZARDS IDENTIFICATION

EMERGENCY OVERVIEW

WARNING

HEALTH HAZARDS MAY CAUSE CARDIAC SENSITIZATION MAY BE HARMFUL OR FATAL IF SWALLOWED OR INHALED MAY BE INVALIDED ON INFALED
MAY BE IRRITATING TO THE SKIN, EYES AND RESPIRATORY TRACT
ASPIRATION HAZARD IF SWALLOWED-CAN ENTER LUNGS AND CAUSE DAMAGE
OVEREXPOSURE MAY CAUSE ONS DEPRESSION
POTENTIAL REPRODUCTIVE HAZARD POTENTIAL CANCER HAZARD DANGER-CONTAINS BENZENE-CANCER HAZARD SEE "TOXICOLOGICAL INFORMATION" (SECTION 11) FOR MORE INFORMATION

FLAMMABILITY HAZARDS EXTREMELY FLAMMABLE FORMS EXPLOSIVE MIXTURES WITH AIR MAY CAUSE FLASH FIRE

REACTIVITY HAZARDS STABLE

POTENTIAL MEALTH EFFECTS. SION

IRRITATING. Contact may cause reddening, itching and inflammation. Repeated or prolonged contact may result in drying, reddening, itching, pain, inflammation, cracking and possible secon / is son with tissue damage. Defetting egent.

Absorption from prolonged or repeated skin contact may cause systemic toxicity.

POTENTIAL HEALTH EFFECTS, EYE

Direct contact may cause irritation, redness, tearing and blurred vision.

Exposure to vapors, furnes or mists may cause irritation. Direct contact may cause pain, tears, burns, sensitivity to light, swelling and possible corneal damage.

POTENTIAL HEALTH EFFECTS, INHALATION

Breathing of the mists, vapors or fumes may irritate the nose, throat and lungs. Symptoms may include sore throat, coughing, labored breathing, sneezing and burning sensation, depending on the concentration and duration of exposure.

Expense to high concentrations of mists may lead to oil chemical pneumonia.

May cause central nervous system depression or effects. Symptoms may include headache, excitation, euphoria, dizziness, incoordination, drowsiness, light-headedness, blurred vision, latigue, tremors, convulsions, loss of conscioueness, come, respiratory errest and death, depending on the concentration and duration of exposure. Repeated or prolonged exposures may cause behavioral changes.

May cause cardiac sensitization, including arrhythmia (irregular heart beat) and death due to cardiac arrest.

Overexposure to this material may cause systemic damage including target organ effects listed under "Toxicological Information" (Section 11).

Other specific symptoms of exposure are listed under "Toxicological Information" (Section 11). POTENTIAL HEALTH EFFECTS, INGESTION

May cause initiation of the mouth, throat and gastrointestinal tract. Symptoms may include salivation, pain, hauses, vomiting and diarrhes.

Aspiration into lungs may cause chemical pneumonia and lung damage.

Exposure may also cause central nervous system symptoms similar to those listed under "Inhalation" (see inhalation section).

Overexposure to this material may cause systemic damage including target organ effects listed under "Todoological Information" (Section 11).

Other specific symptoms of exposure are listed under "Toxicological Information" (Section 11).

4 FIRST AID MEASURES

BICH

Immediately wash skin with plenty of soap and water white removing contaminated clothing and shoes. Get medical attention if irritation develops or persists.

Place contaminated clothing in closed container for storage until laundered or discarded. If clothing is to be laundered, inform person performing operation of contaminant's hazardous properties. Discard contaminated leather goods.

FVE

Flush immediately with large amounts of water for at least 15 minutes. Eyelids should be held away from the symbol to ensure thorough rinsing. Get medical attention if imitation persists.

Plemove to fresh air. If not breathing, institute rescue breathing, if breathing is difficult, ensure airway is clear and give congren.

Keep affected person warm and at rest. GET IMMEDIATE MEDICAL ATTENTION.

Printed On 04/24/2000

INCESTION :

Do not induce variting back of danger of aspirating liquid into lungs, causing serious damage and chamical pneumonitis. If spontaneous variting occurs keep head below hips to prevent aspiration and monitor for breathing difficulty. Gastric lavage should be performed only by qualified medical personnel.

Keep affected person warm and at rest. GET IMMEDIATE MEDICAL ATTENTION.

NOTES TO PHYSICIAN

Aspiration of low viscosity petroleum hydrocarbons may cause severe pneumonitis (oil pneumonia). Vemiting should not be induced. In unconscious victims, use of an endotracheal tube should be considered, if gastric lavage is undertaken. If spontaneous vemiting has occurred after ingestion, the patient should be menitored for of difficult breathing, as adverse effects of aspiration into the lungs may be delayed up to 48 hours.

In cases of scuts poisoning, artificial respiration with administration of oxygen may be useful for support. DO NOT GIVE EPINEPHRINE, EPHEDRINE OR SIMILAR ADRENERGIC DRUGS. THEY MAY INDUCE FATAL VENTRICULAR FIBRILLATION. Electrocardiographic monitoring should be carried out with severely ill patients to articipate possible cardiac arrest.

Anomia may require the usual supportive measures. Medical evaluation of acute overexposure should include hematological determinations until stable. In severe acute and chronic poisoning, both remail and hepatic demage may occur and should be unticipated in such cases. Respiratory and pulmonary problems may require special attention. After severe acute symptoms have been alleviated, it may be advisable to consider periodic monitoring of the patient until such time as the likelihood of other adverse effects can be discounted.

INHALATION ABUSE: Gasoline is one of the solvents used by chemical substance abusers. These patients may present acute or chronic CNS signs or symptoms as well as arrhythmias.

FIRE FIGHTING MEASURES

HAZARDOUS COMBUSTION PRODUCTS

Combustion may produce COx. NOx and SOx.

EXTINGUISHING MEDIA

Use water spray, dry chemical, alcohol foam, all purpose AFFF or carbon dioxide to extinguish fire. BASIC FIRE FIGHTING PROCEDURES
Shut off source of flow if possible.

Evecuate area and fight fire from a safe distance.

If leak or spill has not ignited, ventilate area and use water apray to disperse gas or vapor and to protect personnel attempting to stop a leak. Use water apray to cool adjacent structures and to protect personnel.

Containers can build up pressure if exposed to heat (fire). Stay away from storage tank ends. Withdraw immediately in case of rising sound from venting safety device or any discoloration of storage tank due to fire.

Be aware that a BLEVE (Boiling Liquid Expanding Vapor Explosion) may occur unless auriaces are kept cool with water.

Firefighters must wear MSHA/NIOSH approved positive pressure breathing apparatus (SCBA) with full face mask and full protective equipment.

UNUSUAL FIRE & EXPLOSION HAZARDS

Extremely flammable. Vapors form flammable or explosive mixtures with air at room temperature. Vapor or gas may spread to distant ignition sources and flash back.

Explosion hazard if exposed to extreme heat or to physical or thermal shock.

Flash Point

-40 °F (-40 °C) TAG CLOSED CUP

AutoIgnition Temperature

536 - 853 °F (280 - 456 °C) 1.4 %

Flammability Limits in Air, Lower, % by Volume

....

Flammebility Limits in Air, Upper, % by Volume

7.5 %

ACCIDENTAL RELEASE MEASURES

EMERGENCY ACTION

Eliminate and/or shut off ignition sources and keep ignition sources out of the area. Keep unnecessary people away, isolate hezard area and deny entry. Stay upwind. Isolate for 1/2 mile in all directions if tank, rail our or tank truck is involved in fire. Evacuate area endangered by release as required. (See Exposure Control/Personal Protection - Section 8).

ENVIRONMENTAL PRECAUTIONS

Eliminate all sources of ignition. Isolate hazard area and deny entry.

If product is released to the environment, take immediate steps to stop and contain release. Caution should be exercised regarding personnel satisty and exposure to the released product. Notify local authorities and the National Response Center, if required.

SPILL OR LEAK PROCEDURE

Keep unnacessary people away. Isolate area for at least 25-50 meters (80-160 feet) to preserve public safety. For lease spills, consider initial evacuation for at least 300 meters (1000 feet).

Keep ignition sources out of area and shut off all ignition sources. Absorb spill with inert material (e. g. dry sand or earth) then place in a chemical waste container. Large Spills: Dike far ahead of liquid spill for later disposal.

Use vapor suppressing foam to reduce vapors. Stop leak when safe to do so.

See Execute Controls/Personal Protection (Section 8).

HANDLING & STORAGE

HANDLING

Ground lines and equipment used during transfer to reduce the possibility of static spark-initiated fire or explosion. Use non-sparking tools. Do not out, grind, drill, weld or reuse containers unless adequate precautions are taken against these hazards.

Do not eat, drink or smoke in areas of use or storage.

STORAGE

Store in tightly closed containers in a cool, dry, isolated, well-ventilated area away from heat, sources of ignition and incompatibles. Avoid contact with strong oxidizers.

Empty containers may contain product residue. Do not reuse without adequate precautions.

8 EXPOSURE CONTROLS / PERSONAL PROTECTION

ENGINEERING CONTROLS

Ventilation and other forms of engineering controls are the preferred means for controlling exposures.

EYE PROTECTION: PERSONAL PROTECTION EQUIPMENT (PPE)

Wear chemical strictly goggles and face shield. Have the washing facilities readily available where the contact can occur.

SKIN PROTECTION: PERSONAL PROTECTION EQUIPMENT (PPE)

Avoid skin contact with this meterial. Use appropriate chemical protective gloves when handling.

Use good personal hygiene.

RESPIRATORY PROTECTION: PERSONAL PROTECTION EQUIPMENT (PPE)

A NIOSHMISHA approved air purifying respirator with an appropriate cartridge or canister may be appropriate under certain circumstances where airborne concentrations are expected to exceed exposure limits. Protection provided by air purifying respirators is limited. Use a positive pressure air supplied respirator if there is any potential for an uncontrolled release, exposure levels are not known, or any other circumstances where air purifying respirators may not provide adequate protection.

9 PHYSICAL & CHEMICAL PROPERTIES

ODOR AND APPEARANCE

CLEAR, COLORLESS LIQUID WITH A SHARP, PENETRATING, AROMATIC ODOR

NO = No Date

NA = Not Applicable

Printed On

04/24/2000

Boiling Point 80 - 90 °F (27 - 32 °C)

Specific Gravity ND

Melting Point -130 °F (-90 °C)

Percent Volatile 100 %

Vepor Pressure 6.4 - 15 psia ● 100 °F (38 °C)

Vapor Density 3-4
Bulk Density ND

Solubility in Water NEGLIGIBLE

Octano/Water Partn NO Volatile Organic ND Pour Point ND

DH Value ESSENTIALLY NEUTRAL

Freezing Point ND Viscosity ND

Evaporation Rate MODERATELY FAST

Molecular Formula MIXTURE

Motecular Weight NA

Chamical Family HYDROCARBON MIXTURE

Ottor Threshold F

10 STABILITY & REACTIVITY

STABILITY/INCOMPATABILITY

Incompatible with oxidizing agents. See precautions under Handling & Storage (Section 7). NAZARDOUS REACTIONS/DECOMPOSITION PRODUCTS
Combustion may produce COx, NOx and SOx.

#3 mm

11 TOXICOLOGICAL INFORMATION

ROUTES OF EXPOSURE

del.

ور عليا

inhelation, ingestion, skin and eye contact.

TOTACOLOGICAL DATA

الند

Acuse or chronic overexposure to this material or its components may cause systemic unicity, including severes criects to the following: lidency. liver, spleen, pancreas, thymus, blood, edranals, pituitary and thyroid. Other systems or target organs include the following: immune, respiratory, cardiovascular and nervous systems.

Exposure to components of this material may cause the following specific symptoms, depending on the concentration and duration of exposure; anomia.

This material may contain benzene. Benzene is carcinogenic to laboratory animals when given by intubation or by inhalation. There is an association between occupational exposure to benzene and human leukemia. Carcinogenic determinations: IARC Human positive and Animal suspected carcinogen; NTP Known carcinogen; ACGIH Suspected carcinogen; OSHA carcinogen. Acute benzene poisoning causes central nervous system depression. Chronic exposure affects the hematopoietic system causing blood disorders including anemia and pancytopenia. Mutagenic and clastogenic in mammalian and non-mammalian test systems. Reproductive or developmental toxicant only at doses that are maternally toxic, based on tests with animals.

This material may contain toluene. Toluene is an eye, skin, and respiratory tract irritant as well as a central nervous system depressant. Overexposure may result in damage to the brain, liver, kidney, cardiovescular, respiratory and neurological systems. Protonged and repeated exposure may result in behavioral effects, anemia, and color vision abnormalities, blindness and hearing loss. It has been shown to produce reproductive effects in both humans and laboratory animals. It has also been reported to produce cardiac sensitization. Repeated or protonged exposure to toluene may result in skin absorption, which may result in toxic effects. IARC has determined that there is inadequate evidence for the carcinogenicity of toluene in humans and experimental animals (IARC Class 3).

This material may contain ethanol. Repeated ingestion of ethanol can result in alcohol abuse, causing behavioral changes, mamory lose, impaired judgement, decreased appettle, irregular heartbests, and decreased fertility. Prolonged and repeated ingestion of ethanol has also been associated with cancers of the mouth, pharynx, esophagus and liver. Ethanol ingestion by pregnant women can cause miscarriage, low birth weight, premature birth and fetal alcohol syndrome. In males, acute and chronic alcohol ingestion may affect gonadal hormone tevels. It may also affect the liver, iddney, brain, blood and cardiovascular system.

This product contains n-hexans. n-Hexans is a sidn, eye and respiratory tract irritant. It is a cardiec sensitizer, central nervous system depressant and a neurotoxin. Acute exposure may result in dizziness, asphysia, anesthesia, brain demage and cerdiec arrest at high concentrations. Repeated or prolonged exposure may result in peripheral neuropathy, characterized by progressive weateness, facial and limb numbness, color vision abnormalities and paralysis of the limbs. It has been observed to cause damage to the tostes and fetal effects in a two generation animal study. NTP has reported it to cause liver tumors in female mice. Persons with skin, lung, liver or iddney disorders may be at increased risk.

This material may contain tert-butyl alcohol. Chronic exposure to tert-butyl alcohol (TBA) by the oral route produced some evidence of cancer in male rate, and female mice, equivocal evidence in male mice and no evidence in female rate. Overexposure may also effect the central nervous system, heart, liver, isomey and urinary bladder. Exposure by both the inhalation and oral routes to experimental animals has produced some evidence of reproductive and fetal effects (in some cases with material toxicity).

This material may contain methyl atcohol. Methyl alcohol is a stin and eye initiant. It is slightly toxic by inhelation, eith absorption and ingestion. It has been shown to produce neurotoxicity and is a central nervous system depressent. Poisoning may affect the eyes, tidneys, heart, brain and liver. Intoxication may result in inebristion. Symptoms may occur within 12-18 hours after exposure and may include: headache, dizziness, nauses, vomiting, diarrhes, ringing in ears, dufiness, restlessness, diminished appetits, westeress, abnormal rapid heart best and leg cramps. Blurred or dimmed vision with optic neuritis, rhythmical movement of eyeball, dilated, unresponsive pupils, eye pain, concentric constriction of visual fields, intolerance to light and optic nerve strophy, with transient or permanent blindness. Effects on vision may be delayed. It has been shown to produce reproductive/letal effects in leboratory animals.

This material may contain naphthetene. Naphthetene can be harmful by any route of exposure. Humans may be more sensitive to nephthetene than laboratory animals. Naphthetene can cause skin and eye irritation and acute central nervous system effects. It can also cause blood effects, including hemolytic and aplastic shemis, cataracts, liver and iddney damage. Following maternal exposure, naphthetene has also been reported to cause fetal blood system, liver and possibly eye damage. In a 2-year lifetime inhalation bloassay, female mice showed a significantly increased incidence of pulmonary alveolar and brenchiolar adenomes. On this basis, NTP has determined that there is some evidence of naphthetene carcinogenicity in temale mice. Both male and female mice showed evidence of chronic inflammation and its associated response in the respiratory system.

Printed On 04/24/2000

: 3

7

niend menormes fritt einswise at sussettenswa landtagusse begresbig bris battegen bruits som annon men and nervous system damage (compaines referred to solvent or painter's syndrome). Internional deliberately concentrating and inhaling this product may be that or Verteal.

WARNING: The use of any mydrocarbon fuel in an area without adequate ventilation may result in hazardous levels of combustion products and inadequate corpor levels.

CARCINOGENICITY

Wholly vaporized unleaded gasoline produced an increased incidence of liver cancers in female mice and kidney cancers in male rats following a two-year inhalation period. Subsequent investigations indicate that kidney damage, linked to kidney cancer, may be specific to the male rat. IARC has determined that there is limited evidence for the carcinogenicity of unleaded gasoline in experimental animals and inadequate evidence in humans. (IARC Class-2B). Solvent extracts of pasoline exhaust particles produced skin cancer in laboratory animals leading IARC to categorize gasoline engine exhaust as a possible human cancer hazard.

This material contains ethylbenzene. Ethylbenzene has shown clear evidence of carcinogenicity in male rate and some evidence of carcinogenicity in temple rate and male and female mice. TERATOGENICITY, MUTAGENICITY, OTHER REPRODUCTIVE EFFECTS This product contains components which have been shown to be positive in mutagenicity assays.

This product contains components which may cause adverse reproductive and/or developmental effects.

Program women may be at an increased risk from exposure. Consumption of alcoholic beverages may Onhance tode effects.

This product may contain methyl tert-budyl ether (MTBE). Chronic exposure to very high concentrations (3000) and 8000 ppm) of MTBE resulted in an increased incidence of tumors, produced urinary system effects and meternal and/or fetal toxicity in laboratory animals. This meterial was tested in a number of mutagenicity essays and the results were generally negative. However, they were positive in a Mouse Lymphoma Assay. The significance of these findings for human health hazards is unclear. Damages genetic material in some short-term test systems. May cause adverse reproductive and/or developmental effects. These effects appear to occur at doses that are maternally toxic.

PRE-EXISTING CONDITIONS AGGRAVATED BY EXPOSURE

Pre-existing medical conditions which may be aggrevated by exposure include disorders of the kidney, liver, stan, blood, eyes, immune, cardiovascular, respiratory and nervous systems.

12 ECOLOGICAL INFORMATION

ECOTOXICOLOGICAL INFORMATION ND

13 DISPOSAL CONSIDERATIONS

WASTE DISPORAL

This product, as supplied, when discarded or disposed of, is a hazardous waste according to Federal regulations (40 CFR 251) due to its ignitability and benzene content. Under the Resource Conservation and Recovery Act (RCRA), it is the responsibility of the user of the product to determine, at the time of disposal, whether the material is a hazardous waste subject to RCRA.

The transportation, storage, treatment and disposal of RCRA waste material must be conducted in compliance with 40 CFR 282, 263, 264, 268 and 270. Disposal can occur only in properly permitted facilities. Check state and local regulations for any additional requirements as these may be more restrictive than federal laws and regulations. Chemical additions, processing or otherwise attering this material may make the waste management information presented in this MSDS incomplete, inaccurate or otherwise inappropriate. Disposal of this material must be conducted in compliance with all federal, state and local regulations.

14 TRANSPORT INFORMATION

BILL OF LADING - BULK (U. S. DOT) Gasolina, 3, UN1203, PG II RQ, (Xylanes, Benzene) BILL OF LADING • NON-BULK (U. S. DOT) Gaselina, 3, UN1203, PG II, RQ (Xylenas, Benzene) U. S. Department of Transportation (DOT) Requirements

General Transportation Information for Bulk Shipments

Proper Shipping Name

Gasolina

Hazard Class

3

LINVNA Code

UN1203

Packaging Group

PG II

Labels Required

Flammable Liquid

Placards Required

Flammable Liquid, UN1203

Resortable Quantity

See Regulatory Information (Section 15)

General Transportation Information for Non-Bulk Shipments

Proper Shipping Name

Gasoline

Hazard Clase

UNNA Code

UN1203

Packaging Group

PG II

Labels Required

Flammable Liquid

Placards Required

Flammable Liquid, UN1203

Reportable Quantity

See Regulatory Information (Section 15)

The above description may not cover shipping in all cases, please consult 49 CFR 172.101 for specific shipping information.

5 REGULATORY INFORMATION

PEDERAL REGULATIONS

All ingredients are on the TSCA inventory or are not required to be listed on the TSCA inventory.

Consult OSHA's Benzene standard 29 CFR 1910.1028 for provisions on air monitoring, employee training. medical monitoring, etc.

This product may be subject to export notification under TSCA section 12(b); contains: tert-Amyl methyl ether (CAS# 994-05-6), Mornyl tert-butyl ether (CAS# 1634-04-4), Cyclohexane (CAS#110-82-7).

A release of this product, as supplied, is exempt from reporting under the Comprehensive Environmental sepones Compensation and Liability Act (CERCLA) by the petroleum exclusion. Releases may be reportable to the National Response Center (800-424-8802) under the Clean Water Act, 39 U.S.C. 1321(b)(S) and (5). Check state and local regulations for any additional requirements as these may be more restrictive than federal types and regulations. Failure to report may result in substantial civil and criminal panalties.

This product, as supplied, contains current, methenol, hexane, toluene, MTBE, ethylbenzene, cyclohexane. naphthalene, xylenes and benzene which are Hazardous Substances as per 40 CFR Part 302.4. The reportable quantities for currene, methanol, hexane, toluene, MTBE, ethylbenzene, cyclohexane, naphthi eas of this product that results in a release of cumens, methand, hexans, toluens, MTBE, ethylbenzens, cyclohexane, nephthalene, xylenes and berzene equal to or exceeding the reportable quantity must be reported to the National Response Center (800-424-6602) and appropriate state and local regulatory agencies as described in 40 CFR Pert 302.6 and 40 CFR 355.40, respectively.

This product contains one or more components designated as hazardous substances or toxic pollutants purbulant to the Federal Clean Water Act (40 CFR 118.4 Table A; 40 CFR 401.15). Any unpermitted introduction of this product into a facility etormwater or wastewater discharge may constitute a violation of the Clean Water Act. Facilities must notify the appropriate permitting agency prior to introducing this product into the eforementioned discharges.

This product contains one or more substances listed as hezerdous, toxic or flammable air poliutants under Section 112 of the Clean Air Act.

There may be specific regulations at the local, regional or state/provincial level that pertain to this product. STATE REGULATIONS

WARNING: This product contains a chemical known to the State of California to cause cancer and birth defects or other reproductive harm.

> Printed On NA = Not Applicable

SARA Listed Ingredi					CAS	Number	Maximu	m %
Following ingredients of	of this	s product are listed in	BARAS	13 - 40		•		
Health	2*	Flammability	4	Reactivity	.0			
HMS RATINGS	•							
NFPA RATINGS Health	1	Flammability	4	Reactivity	0	Special H	lazards	-
Reactivity Hazard: -						•		
Immediate Hezard: X		Delayed Hazard: X		Fire Hazard: X		Pressure	Hazard: •	
SARA TITLE ID PATING	8	· 7322 30.	4		is .			

SARA Listed Ingradient Name	CAS Number	Maximum %
TOLUENE	108-88-3	20.0
XYLENES .	1330-20-7	18.0
METHYL-T-BUTYL ETHER	1 634-04-4	15.0
NHEXANE	110-64-3	7.0
T-BUTYL ALCOHOL	75-65-0	7.0
ETHYLBENZENE	100-41-4	4.0
CYCLOHEXANE	110-82-7	3.0
METHYL ALCOHOL	67-56- 1	3.0
1.2.4-TRIMETHYLBENZENE	95-63-6	2.0
BENZENE	71-43-2	1.3
NAPHTHALENE	91-20-3	1.0
CUMENE	98-82-8	1.0

6 OTHER INFORMATION

DISCLAIMER

NOTICE: The Information presented herein is based on data considered to be accurate as of the date of preparation of this Massfel Safety Data Sheet. However, MSDS may not be used as a commercial specification anest of menufacturer or seller, and no warranty or representation, expressed or implied, is made as to the accuracy or comprehensiveness of the foregoing data and safety information, nor is any authorization given or implied to practice any patented invention without a license. In addition, no responsibility can be assumed by vendor for any damage or injury resulting from abnormal use, from any failure to adhere to recommended practices, or from any hazards inherent in the nature of the product.

Current Revision Date 11-Apr-2000

Replaces Sheet Dated

23-Dec-1998

Completed By

Safety & Emergency Response, Kach Industries, Inc.

Material Safety Data Sheet



Emergency Medical Telephone (800) 441-3637

NO. 1 DEESEL FUELNO. 1 FUEL OIL

L MATERIAL IDENTIFICATION

Name .

-J 04

No. 1 Diesel Fuel No. 1 Fuel Oil

CAS Registry Number Minture; See Section XI Transportation Emergency Phone 1-(800) 424-9500 (Chamtree)

Chemical Family

Product Code 3501/4195

Mitted Petroleum Hydrocurbon

IL OSMA MAZARIO DETERMINATION

The material is hexardous at defined by OSHA's Hazard Communication Standard, 29 CFR 1910.1200. Refer to Section XI of this MSDS for federal and state regulatory information.

Hausdons Ingredients

CAS Registry Number Tinic) Minner Concentration

Hydrocarbous (Aromatic & Paraffinic) Naphthaloge Missure 91-20-3 >90% Approx. 3%

Hamedous Physical Properties
Class II Combustible Liquid - NFPA 30-1987.

III. PHYSICAL DATA

Appearance and Oder

Clear Uquid; Paraffinic odor

Bolling Point/Range

330° - 572°F

Vapor Pressure (mailig), 68°F

Ž

Specific Gravity (E₁O=1)

0.81

S Voluties (by volume)

NII

Sciebility in Water

deform

Vepor Density (Air = 1.4)

IV. REACTIVITY DATA

Stable: _X_

Unstable

Huzardous Decomposition Materials: Incomplete combustion may produce carbon monocide.

Conditions to Avoid: Oxidizing reaterials, heat, flame,

Hazardous Polymerization: Will not occur.

GASC02100 taly 1989

9

FIRE AND EXPLOSION HAZARD DATA

LITTLE D.S

VEL 6

Plash Point (Method used): 115F (TCC)

Autolgaition Temperature: 410'F

Handle and store in accordance with NFPA procedure for Class II Combustible Liquid.

Entinguishing Media: Uso water spray, dry chemical, CO, foam.

一次的海州中国共和国特色

Special Fire Fighting Procedures: Use water to keep fire-exposed containers cont. If leak or spill has not ignited, use water spray to disperse the vapors and to provide protection for personnel attempting to stop a ical. Water spray may be used to firsh spills away from exposures.

·公司的 [18]

Unusual Fire and Explosion Hazards: Products of combustion may contain curbon mountide, carbon disside and other toxic gaterials. Do not enter caclesed or confined space without proper protective equipment including respiratory protection.

National Fire Protection Association (NFPA) Classification

HAZARD PATING Lesst-0 Stight-1 Moderate-2

Health 0 Pire 2 Reactivity 0

High-3 Barremo-4

VL TRANSPORTATION AND STURAGE

Storage Conditions:

Store is accordance with National Pire Protection Association regulations.

Shipping Information:

DOT

Proper Stateping Name: Diesel Pael or Fuel Oil

Baseré Class

Combustible Liquid

UNINA No.:

NA 1993

DOT Label(e):

None

DOT Plecards

· Combustible

LATA/DAO:

Proper Shipping Name:

Grs Oll

Hazard Class:

3 (TMO 3.3)

UN No.

UN 1202

IMORCAO Label:

Flavorable Liquid

Special Informations

Not restricted over 140°F

Packaging Groups

BEALTH HAZARD INFORMATION

Exposure Limits for No. 1 Diesel Poel, No. 1 Poel Off

PEL: None Established

Do Poul AEL: None Established

TLV: None Established

Exposure Limits for Petroleum Distillates

PEL: 400 poer: 1600 me/m3 TWA

Exposure Limits for Naphthalene

Du Post AEL: None Established

PEL: 10 poin 50 me/m

STEL 15 ppm. 75 me/m

TLV: 10 ppm 50 me/m

STEL 15 pen: 75 mg/m'

GASC0210/July 1989

2

Primary Routes of Exposure/Entry: Skin, Inhalation.

Mints and Symptoms of Expeture/Medical Conditions Aggreeated by Experience

Studies with mice or rets have shown that some petroleum distillates have caused either damage or immors of the kidneys or tumors of the liver. However, kidney effects were not seen in similar studies involving guines pigs, dogs or monkeys. Also, the significance of the liver tumors in redents in highly speculative.

Mouse skin pointing studies have shown that petroleum middle distillates (boiling range of 100° - 700°F; naphths, jet fuel, diesel fuel, kerosene, etc.) can cause skin cancer when repeatedly applied and never washed from the animal's skin. The relative significance of this to human health is uncertain since the petroleum distillates were not washed from the skin and resulting skin effects (irritation, cell damage, etc.) may play a role in the tumorigenic response. A few studies have shown that washing the animal's skin with soap and water between treatments greatly reduces the envelopment effect of some potroleum oils.

Studies in mice and rets have shown that chronic exposure (8 hours/day, 7 days/week, 24 months) to unfiltered diesel exhaust produced tensors of the long and also lymphomes. On the basis of these studies, NIOSH recommends that whole diesel exhaust be remarked as a notential carcinoses.

The product contains petrolous hydrocarbons, and at with many petrolous products, it may cause irritation to the eyes, lungs or skin after prolonged or repeated exposure. Extreme exposure or application into the lungs may cause procuredate. Overexposure may cause westeness, besches, names, confusion, blurted vision, drousiness and other nervous system effects; greater exposure may cause distincts, attended speech, flathed face, unconsciousness or convolutions.

Naphthalene is a potential irrhant to eyes, skin and lungs and usty demags the blood, eyes and kidney effect prolonged or reposted exposure.

Listed as Carcinogen or Potential Carcinogen by

NIT IARC

OSHA

YEL EMERGENCY AND FIRST AID INFORMATION

Material

Byes: in case of contact, immediately thus eyes with pleasy of water for at least 15 minutes. Call a physician.

Side: In case of contact, immediately wash this with scap and plenty of water. If irritation develops, consult a physician.

Inhalation: If inhaled, remove to fresh sir. If not breathing give artificial respiration. If breathing is difficult, give cayges. Call a physician.

Ingustion: If smallowed, do not induce vomiting. Give large quantities of water. Never give anything by mouth to an unconscious person. Call a physician.

Notes to Physician: Clastric lavege by qualified modical personnel may be considered, depending on quantity of unterial ingested.

IX. SPILL LEAK AND DESPOSAL INFORMATION

In Case of Spill or Louis. This material is combustible. Coursia spill immediately in smallest possible area. Recover as much product as possible by such methods at vacuuming, followed by recovering residual finide by using absorbent materials. Nonrecoverable product, conteminated soil, debris and other materials should be piaced in proper containers for ultimate disposel. Avoid weeking, draining or directing material to storm or sanitary sowers.

NOTE: Review FIRE AND EXPLOSION HAZARDS before proceeding with clear up. Use appropriate PERSONAL PROTECTIVE EQUIPMENT during clean up.

Waste Disposal Methods Recycle as much of the recoverable product as possible. Treatment, storage, transportation and disputal sense be in accordance with applicable Pederal, State/Provincial, and Local regulations.

GA9C0Z10/July 1989

L. PRECAUTIONARY MEASURES

Respiratory Protection: Select appropriate NIOSH-approved respiratory protection when needed to avoid inhalation of mist or vapors and to maintain exposures below acceptable limits.

计操制性数的标题6

VentBation: Natural or general mechanical ventilation normally adequate.

1. 供商等的现在分级表

Protective Cleves: Impervious gloves, such as neopresse or NBR, should be worn when the potential exists for prolonged or represent skin exposure.

Eye Protections Chemical goggles required when exposed to spray or mist or if spinshing is probable.

Other Protective Equipments Coveralis if spinshing is proveble. Launder contaminated clothing before reuse.

Subty Precautions. Avoid contact with eyes, skip, or clothing.

IL REGULATORY INFORMATION

FEDERAL REGULATIONS

CERCIA 40 CFR 343

The material contains the following hazardous substance which, when released in quantities equal to or exceeding the Reportable Quantity, triggers National Response Center notification requirements.

Hamelous Substance Not Applicable Reportable Quantity

SUPPLYUND AMENDMENTS AND REAUTHORIZATION ACT OF 1984, TITLE III SECTIONS 582, 564, 511, 313, 313

SECTION 302/304 - Extremely Hazardons Substances (40 CFR 355)

The meterial does not contain extremely hazardous rebutances at greater than 1.0% concentration; however, it is possible that this material may contain extremely hazardous substances at a lower concentration so that a large enough spill could warrant an Emergency Release Report under Section 304.

SECTION 311/312 - MSDS and Chemical Inventory Reporting Requirements (46 CFR 370)
The material should be reported under the following EPA heartd categories:

z Immediate (Acute) Health Hazard

Sedden Release of Pressure

x Deleyed (Chronic) Heelth Hiszard

Reactive
Not Applicable

I Pire

NOTE: See Section II for the concentration of any ingredients classified as hazardous by OSHA.

SECTION 3LS - List of Tests Chemitents (40 CFR 372)

The material contains the following chemical(s) at a level of 1.0% or greater (0.1% for carcinogens) on the list of Touic Chemicals and is subject to touic chemical release reporting requirements.

Toric Chemical Naphthalese CAS Registry Number

Approx. Concentration
(Upper Boried)

TOXIC SUBSTANCES CONTROL ACT (TSCA), 40 CFR 710

This numberial is a mixture as defined by TSCA. The chemical ingredients in this material are in Section 2(b) Chemical Substance inventory and/or are otherwise in compliance with TSCA. In the case of ingredients obtained from other manufacturers, Conoco relies on the assurance of responsible third parties in providing this statement.

GASC0210/July 1989

4

RESOURCE CONSERVATION AND RECOVERY ACT (RCRA), 40 CFR 361, SUBPART C AND D The material, when discarded or disposed of, is not specifically listed as a hazardous waste in Federal regulations; however, it could be considered bazardous if it meets criteria for being tonic, corrosive, ignicable or reactive according to U.S. EPA definitions (40 CFR 261). Additionally, it could be designated as hazardous according to state regulations. This material could also become a hazardous waste if it is mixed with or comes in contact with a listed bazardous waste. If such country or mixing occurs, check 40 CFR 261 to determine whether it is a hexardous weste. If it is a hexardous weste, Regulations 40 CFR 262, 263, 264 and 268 may apply.

FEDERAL WATER POLLUTION CONTROL ACT. CLEAN WATER ACT. 40 CPR 40LIS. 49 CFR 116

The material contains the following ingredient(s) which is considered hazardoes if spilled in navigoble waters.

Ingredicat

Petroleum Hydrocarbos

Reportable Quantity

Plim or these woon or discoloration of the water surface or adicining shoulist

EAZARDOUS MATERIALS TRANSPORTATION REGULATIONS. 49 CFR 171-175 The unsterial contains the following incredient(s) which is considered a hazardous substance at defined by 49 CFR 171.8 if spilled while being transported in commerce.

Intredient

Not Applicable

Reportable Quantity

FOREIGN RECULATION

CANADIAN BAZARDOUS PRODUCTS ACT (WHMIS)

The material is a WHMIS Controlled Product and a Canadian MSDS is available.

STATE REGULATIONS

CALIFORNIA SAFE DRIVEING WATER AND TOXIC ENTORCEMENT ACT OF 1966 (PROPUSITION 95)

The anterial contains the following ingredient(s) known to the State of California to cause causer, birth deducts or other reproductive harm. Read and follow label directions and use ours when bandling or using all potrologic products.

beredlent

None

15- --

· • • • • •

*...

::

PENNSYLVANIA WORKER AND CONDITIONITY RIGHT TO KNOW ACT

The muterial contains the following hazardous substances:

Categories: H = Hazardons Subtance (≥ 1.0%)
S = Special Hazardons Substance (≥ 0.01%)

E = .Environmental Hazard (≥ 1.0%)

CAS Registry Number Ineredient **Morolt** Aromatic & Perefficie Missere

Hydrocarbons

Nuphthalene 91-20-3

Nonhazerdoes ingredicat(s) information is withhold as trade secret in accordance with Section 11 of Pounsylvania Worker and Community Right to Know Act.





GASC0220

Revised 1-82P-1993

Printed 6-SEP-190

١.

No. 2 Diesel Fuel

CHEMICAL PRODUCT/COMPANY IDENTIFICATION

Material Identification

CAS Number

68478-34-6

· "你有一个的时间,这种情况。

Tradenases and Symonyms
Diesel Fuel No. 2, Low Sulfur
Diesel Fuel No. 2, High Sulfur

3502, 3504, 3510, 3512

Company Identification

MANUFACTURER/DISTRIBUTOR

CONOCO INC. P.O. BOX 2197 HOUSTON, TX 77252

PHONE NUMBERS

Product Information

1-713-293-5550

Transport Emergency Medical Emergency

CHENTREC 1-800-424-9300

1-800-441-9637

COMPOSITION/INFOGMATION ON INGREDIENTS

Components Material

GAS Number

Diesel Fuel, No. 2

68476-34-6 100

HAZARDS IDENTIFICATION

Potential Health Effects

Primary Routes of Exposure/Entry: Skin, Inhalation.

Signs and Symptoms of Exposure/Medical Conditions Aggravated by Exposure:

The product may cause irritation to the eyes, lungs, and skin after prolonged or repeated exposure. Extreme

(Condeted)

HAZARDS IDENTIFICATION(Contract)

overexposure or aspiration into the lungs may cause lung damage and death. Overexposure may cause weakness, headache, nausea, confusion, blurred vision, drowsiness, and other nervous system effects; greater exposure may cause dizziness, slurred speech, flushed face, unconsciousness, and convulsions.

It is highly unlikely that human exposure at or below the recommended exposure level poses a significant health hazard. In this regard, good workplace practices and proper engineering designs will minimize exposure.

Decomposition Products:
Studies in mice and rate have shown that chronic exposure (8 hours/day, 7 days/week, 24 months) to unfiltered diesel exhaust produced tumors of the lung and also lymphomas. On the basis of these studies, NIOSH recommends that whole diesel exhaust be regarded as a potential carcinogen.

Carbon monoxide is a gas that can result from incomplete combustion of hydrocarbons, from detoxification of some chemicals like methylene chloride, tobacco smoke, and even from natural body processes. Carbon monoxide binds tightly to hemoglobin and interferes with oxygen transport to body tissues. Overexposure can cause headache, nausea, nervous system depression, coma, and death.

Carcinopenicity Information
None of the components in this material is listed by IARC, NTP, OSHA
or ACGIH as a carcinogen.

FIRST AID MEASURES

First Ald INHALATION

If inhaled, remove to fresh air. If not breathing, give artificial respiration. If breathing is difficult, give oxygen. Call a physician.

SKIN CONTACT

Wash skin thoroughly with soap and water after handling. If irritation develops and persists, consult a physician.

EYE CONTACT

In case of contact, immediately flush eyes with plenty of water for at least 15 minutes. Call a physician.

INGESTION

If swellowed, do not induce vomiting. Immediately give 2 glasses

Condessed)

ينجعب دق

64.00

ACCIDENTAL RELEASE MEASURES(Continued)

NOTE: Vapors released from the spill may create an explosive atmosphere.

一體實際企業事長

文物的"空间的"的标准"工作"

Initial Containment
Dike spill. Prevent material from entering sewers, waterways, or
low areas.

Spill Clean Up Soak up with sawdust, sand, oil dry or other absorbent material.

MANDLING AND STORAGE

Mandling (Personnel)
Avoid breathing vapors or mist. Wash thoroughly after handling.
Wash clothing after use.

Mandling (Physical Aspects)
Ground container when pouring. Keep away from heat, sparks and flames. --

Storage
Store in a well ventilated place. Keep container tightly closed.
Store in accordance with National Fire Protection Association recommendations. Store away from heat, sparks and flames, oxidizars.

EXPOSURE CONTROLS/PERSONAL PROTECTION

Engineering Controls .
Use only with adequate ventilation. Keep container tightly closed.

Personal Pretective Equipment
Respiratory Protection: Select appropriate NIOSH-approved
respiratory protection when needed to avoid inhalation of
mist or vapors and to maintain exposures below acceptable
limits.

Protective Glaves: Impervious glaves, such as neoprene or NBR, should be worn when the potential exists for prolonged or repeated skin exposure.

Eye Protection: Bafety glasses with side shields. Chemical goggles required when exposed to spray or mist or if splashing is probable.

Other Protective Equipment: Coveralls if aplashing is probable. Launder contaminated clothing before reuse.

Exposure Guidelines Exposure Limits No. 2 Diesel Fuel PEL (OSHA) TLV (ACGIH)

None Established None Established

(Confrast)

÷:•

...

47 %

47

FIRST AID MEASURES(Control)

of water. Never give anything by mouth to an unconscious person. Call a physician.

Notes to Physicians
Activated charcoal mixture may be administered. To prepare
activated charcoal mixture, suspend 50 grams activated charcoal in
400 mL water and mix thoroughly. Administer 5 mL/kg, or 350 mL
for an average adult.

FIRE FEGITING MEASURES

Flammable Properties

Flash Point 130 F (54 C)
Method TCC
Flammeble limits in Air, by Volume
LEL 0.4

UEL 6

Autoignition 494 F (267 C)

Vapor forms explosive mixture with air. Vapors or gases may travel considerable distances to ignition source and flash back.

NFPA Classification

Class II Combustible Liquid.

Extinguishing Modia
Water Spray, Foam, Dry Chemical, CO2.

Fire Fighting Instructions
Special Fire Fighting Procedures: Use water to keep
fire-exposed containers cool. If leak or spill has not
ignited, use water spray to disperse the vapors and to
provide protection for personnel attempting to stop a leak.
Nater spray may be used to flush spills away from exposures.

Unusual Fire and Explosion Hazards: Products of combustion may contain carbon monoxide, carbon dioxide and other toxic materials. Do not enter enclosed or confined space without proper protective equipment including respiratory protection.

ACCIDENTAL RELEASE MEASURES

Sefeguerde (Personnel)
NOTE: Review FIRE FIGHTING MEASURES and HANDLING (PERSONNEL)
sections before proceeding with clean-up. Use appropriate
PERSONAL PROTECTIVE EQUIPMENT during clean-up.

Remove source of heat, sparks, flame, impact, friction and electricity including internal combustion engines and power tools. If equipment is used for spill cleanup, it must be explosion proof and suitable for flammable liquid and vapor.

(Continued)

<u>. برين بني</u>

PHYSICAL AND CHEMICAL PROPERTIES

Physical Data

Boiling Point Vapor Pressure Vapor Density

350-690 F (177-366 C) 1 mm/Hg @ 68 F (20 C) >1 (Air = 1) (by volume) Nil

Property of the state of

% Volatiles Solubility in Water insoluble

Odor Form

Arometic Liquid

"大大"的"新"。 网络海绵 说,

Color Specific Gravity

0.84-0.88 @ 60 F (16 C) }

*Color: High Sulfur Diesel - Green

Others - Clear or Light Yellow

STABILITY AND PRACTIVITY

Chemical Stability Stable at normal temperatures and storage conditions.

Conditions to Avoid Avoid heat, sperks, and flame.

Incommetability with Other Materials Incompatible or can react with strong oxidizers.

Decamenition Incomplete combustion may produce carbon monoxide.

Polymerization Põlymerization Will not occur.

TORICOLOGICAL INFORMATION

Animal Data

Animal studies have shown that prolonged or repeated inhelation Animal studies have shown that prolonged or repeated inhelation exposures to high concentrations of some petroleum distillates have caused liver tumors in mice and kidney damage and tumors in male rats. However, kidney effects were not seen in similar studies involving female rats, guines pigs, dogs, or monkeys. Present studies indicate the kidney effects will only occur in male rats. Also, human studies do not indicate this peculiar sensitivity for kidney damage and studies reported in 1992 showed that this particular type of rat kidney damage is not useful in predicting a human health hazard. The significance of liver tumors in mice exposed to high doses of chemicals is highly speculative and probably not a good indicator for predicting a potential human carcinogenic hazard.

Mouse skin painting studies have shown that petroleum middle distillates (boiling range 100-700 F; naphtha, jet fuel, diesel fuel, kerosene, etc.) can cause skin cancer when repeatedly applied and never washed from the animal's skin. The relative

. ...

. ..

TOXICOLOGICAL INFORMATION (Condition)

significance of this to human health is uncertain since the petroleum distillates were not washed from the skin and resulting skin effects (irritation, cell damage, etc.) may play a role in the tumorigenic response. A few studies have shown that washing the animal's skin with soap and water between treatements greatly reduces the carcinogenic effect of some petroleum oils.

Diesel Fuel -

Skin

: Extremely irritating; no mortality at 5 ml/kg in rabbits

Oral

: LD50 of 9 ml/kg in rats

· DESPOSAL CONSIDERATIONS

Waste Disposal

Trestment, storage, transportation, and disposal must be in accordance with applicable Federal, State/Provincial, and Local regulations. Do not flush to surface water or sanitary sewer. syštem.

By itself, the liquid is expected to be a RCRA ignitable hazardous wasto.

TRANSPORTATION INFORMATION

Shinging Information INTERNATIONAL HM-181

Proper Shipping Name Hazard Class UN/NA Number

Packing Group

Label Placard Ges Oil

UN 1202 III

Flammable liquid

Flammable

DOMESTIC HM-181

Proper Shipping Name Hazard Class

UN/NA Number Packing Group

Label Placard

Special Information

Diesel.fuel

Combustible liquid

NA 1993 III

None

Combustible

If shipped by vessel or air, use international description.

REGULATORY INFORMATION

U.S. Federal Regulations OSHA HAZARD DETERMINATION

This material is hazardous as defined by OSHA's Hazard Communication Standard, 29 CFR 1910.1200.

Commence of the contraction

March + property

CERCLA/SUPERFUND Not applicable; this material is covered by the CERCLA petroleum exclusion. Releases are not reportable.

SARA, TITLE III, 302/304
This material is not known to contain extremely hazardous substances.

TITLE III HAZARD CLASSIFICATIONS SECTIONS 311, 312

Acute : Yes Chronic : Yes Fire : Yes Reactivity : No Pressure : No

SARA, TITLE III, 313
This material is not known to contain any chemical(s) at a level of 1.0% or greater (0.1% for caroinogens) on the list of Toxic Chemicals and Subject to release reporting requirements.

TBCA
This saterial is in the TBCA Inventory of Chemical Substances (40 CFR 710) and/or is otherwise in compliance with TBCA.

This material, when discarded or disposed of, is not specifically listed as a hazardous waste in Federal regulations. It could become a hazardous waste if it is mixed with, or comes in contact with, a listed hazardous waste. If it is a hazardous waste, regulations at 40 CFR 262-266 and 288 may apply.

CLEAN WATER ACT
The material contains the following ingredient(s) which is considered hazardous if spilled into navigable waters and therefore reportable to the National Response Center (1-800-424-8802).

Ingredient(s) Reportable Quantity Petroleum Hydrocarbons Film or sheen upon, or discoloration of, any water surface.

State Regulations (8.8.) CALIFORNIA "PROP 65"

This material is not known to contain any ingredient(s) subject to the Act.

PENNSYLVANIA WORKER & COMMUNITY RIGHT TO KNOW ACT
This material contains the following ingredient(s) subject to the

Cordinad

REGULATORY INFORMATION (Construed)

Pennsylvania Worker and Community Right to Know Hazardous Substances List.

Ingredient Category

Diesel Fuel Oil Hazardoua Substance

Canadian Regulations
CLASS B Division 3 - Combustible Liquid.

CLASS D Division 2 Subdivision B - Toxic Naterial. Chronic Toxic Effects.

Transport/Medical Emergency Phone Number: 1-613-348-3616

OTHER INFORMATION

MFPA, MPCA-MMIS MFPA Rating Health Flemmability Reactivity NPCA-HMIS Reting Health Planesbility Reactivity

Personal Protection rating to be supplied by user depending on use

.

The data in this Material Safety Data Sheet relates only to the specific material designated herein and does not relate to use in combination with any other material or in any process.

Responsibility for MSDS

Address .

MSDS Administrator

Conoco Inc. PO Box 2197

Telephone

Houston, TX 77252 713/293-5550

Indicates updated section.

End of MSDS

ATTACHMENT 3:

 $(x_{i_1})^2 \int_{\mathbb{R}^3} x_i (x_i^{i_1}, x_i^{i_2}, \dots, x_{i_n}) = y_{i_1}$

Emergency Response Inventory and Location Map

SERVICE WELDING AND SHIP BUILDING NE Canal Bank Road, Lemont, Illinois

SPCC PLAN (12/2000) -- ATTACHMENT 3:

Emergency/Spill Response Equipment Inventory

Containment Boom - 450' (min.) -- Maintained under EMC's Coast Guard Emergency Response Plan

Absorbent Boom - 200' (min.)

Absorbent Pads - 20-30 bundles of 144 (min.)

Spill recovery pumps - 100 pumps from 2" - 18" in size with sufficient hoses/couplings etc.

Fire Extinguisher - (1 doz. min.)

Heavy Equipment:


- (2) End Loaders
- (1) Bobcat
- (1) Backhoe
- (1) Bull-Dozer

Misc. Equipment - Shovels, Tools

Containment Booms, Pumps

First Aid Kit/Portable Eyewash

Refer to Attached Site Plan Map for location of above referenced equipment.

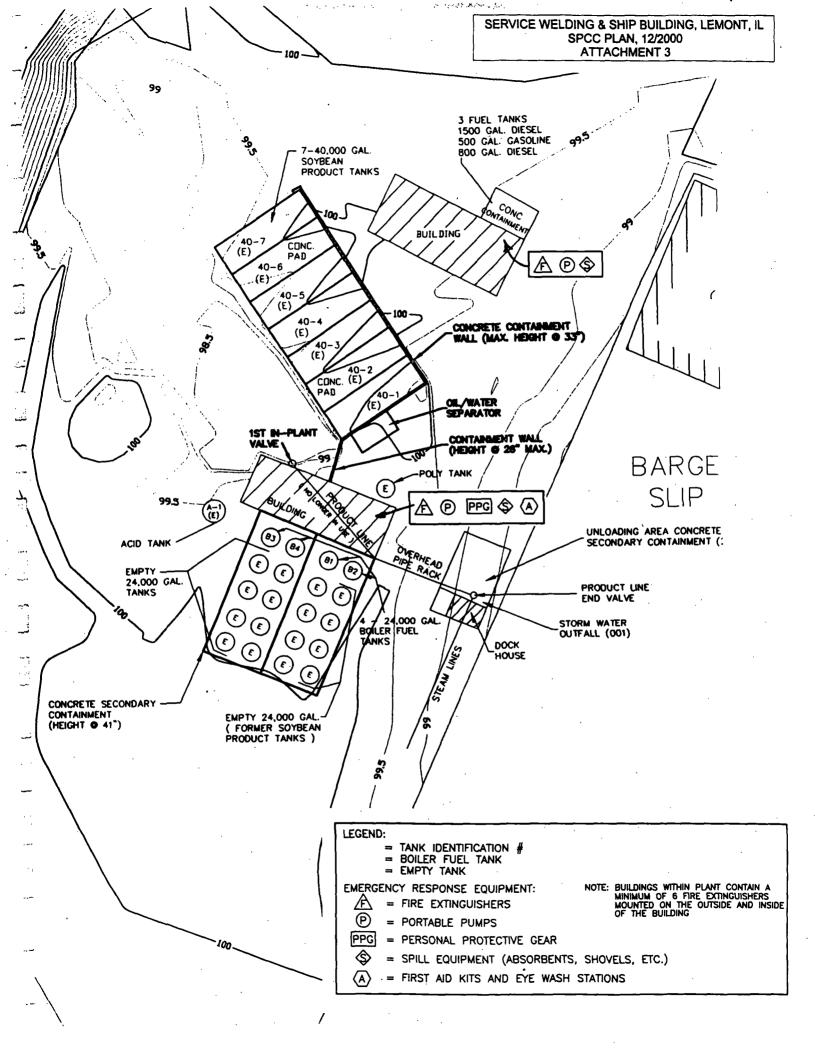

ATTACHMENT 4:

EMC Onshore Facility Emergency Response Plan

EGAN MARINE CORPORATION

FACILITY RESPONSE PLAN Captain of the Port U. S. Coast Guard 215 West 83rd Street, Suite D Burr Bidge, IL 60521-7059 Phone: (708) 789-5830

16471 February 2, 1995

Egan Marine Corporation Attn: Mr. Dennis Egan P.O. Box 669 Lemont, IL 60439

Dear Mr. Egan,

Your facility response plan, Control Number FRP-54a, submitted to meet the requirements of the Oil Pollution Act of 1990 is approved.

I commend your efforts in developing a response plan that reflects your company's operating procedures and organizational structure. I remind you that your plan is a vital working document and that implementing the plan will help ensure effective oil spill response and mitigation. Please be sure that all parties with responsibilities under the plan are familiar with the plan's procedures and requirements.

You are reminded that your terminal is prohibited from handling, storing, transporting, transferring, or lightering oil unless it is operating in full compliance with this plan. Compliance includes ensuring that the required resources are in place and available through contract or other approved means. In addition, the facility must have a copy of the plan at the marine-transportation related portion of your facility. It is recommended that this copy be placed with your facility's operations manual.

Your plan's approval will remain valid until 5 years from the date of this letter. You must review your plan annually and resubmit the plan to the Coast Guard for reapproval 6 months before the end of the approval period as required by 33 CFR 154.1065.

A copy of this letter shall be with the plan.

Sincerely,

K. K. Kleckner Lieutenant, U.S Coast Guard By direction of the Captain of the Port

Section 1 Purpose

The purpose of this Response Plan for a Marine Transportation Related Facility is to document procedures and policies implemented by Egan Marine Corporation to comply with the requirements of the Oil Pollution Act of 1990 (OPA 90). This plan identifies response sources and procedures, which will be implemented by the facility owner and operator to respond to an oil spill event.

Navigation and Vessel Inspection Circular No. 7-92 (NVIC 7-92) has been used as a guidance document for the preparation of this plan.

Section 2 Applicability

The Egan Marine Corporation Loading/Unloading Facility meets the definition of a marine transportation-related (MTR) facility because it is an on-shore facility, containing piping and structures, used for the transfer of oil to and from a vessel, and is subject to regulation under 33 CFR Part 154.

This facility handles and transfers oil in bulk to and from vessels which have capacities greater than 250 barrels. It meets the definition of a "facility that could reasonable be expected to cause significant and substantial harm", within the definition of that term contained in NVIC 7-92. Therefore, Section 8 of NVIC 7-92 is applicable, whereas Section 9 is not.

Section 3 Upgrading Facility Classification

The Captain of the Port (COTP) has the authority to upgrade the classification of this MTR facility, based on a consideration of all relevant factors including, but not limited to: type and quantity of oils handled in bulk; facility spill history; age of facility; proximity to public and commercial water supply intakes; and proximity to areas of economic importance or environmental sensitivity. According to NVIC 7-92, such a determination would be advisory only.

Section 4 Response Plan Submission Requirements

The Egan Marine Corporation Loading/Unloading Facility has been identified as a facility that may cause significant and substantial harm to the environment. Therefore, this response plan incorporates Section 7, 8, and 11.2 of NVIC 7-92.

Section 5 Definitions

All definitions used in this Plan are consistent with those definitions contained in NVIC 7-92, which are hereby incorporated by reference.

Section 6 Operating Restrictions and Interim Operating Authorization

The Egan Marine Corporation Loading/Unloading Facility recognizes that OPA 90 requires that a MTR facility must submit this response plan by February 18, 1993, in order to continue handling, storing, or transporting oil.

Additionally, this facility recognizes that it may not continue to operate after August 18,1993, unless it is in full compliance with the submitted response plan.

This plan need not be resubmitted if the final rules promulgated under OPA 90 are not significantly different than NVIC 7-92.

Section 7 General Response Plan Contents

The specific plan presented in Section 8, has been prepared in compliance with the requirements of Section 7 of NVIC 7-92, in that it:

- (a) Has been written in plain English
- (b) The response plan presented in Section 8 has been divided into the following sections:

(1) Introduction and plan content	8	
(2) Emergency response action plan	11	
(i) Notification procedures	11	
(ii) Facility's spill mitigation procedures	14	
(iii) Facility's response activities	16	
(iv) Sensitive areas	18	
(v) Disposal activities	20	
(3) Hazard evaluation [Reserved]	20	
(4) Spill scenarios [Reserved]	20	
(5) Training and drills	20	
(i) Training and drills	20	
(ii) Drill procedures	21	
(6) Plan review and update procedures	21	
(7) Appendices	•-	
(i) Facility-specific information	46	
(ii) List of contacts	45	
(iii) Equipment lists and records	36	
(iv) Communications plan	54	
(v) Site-specific safety and health plan	49	
(vi) List of acronyms and definitions	5 .	
(vii) Geographical-specific appendix for mobile facilities (not applicable)		
(8) Attachments - MSDS		

- •
- (c) The plan contains the suggested contents of Section 8 of NVIC 7-92.
- (d) Because this plan does follow the recommended guidelines, no cross-reference table has been submitted.
- (e) It is the belief of this facility that the information contained in this response plan is consistent with the National Oil and Hazardous Substances Pollution Contingency Plan (NCP) (40 CFR Part 300)

Section 8 Specific Guidelines for Facilities That May Cause Significant and Substantial Harm to the Environment

The outlining system presented in this section is the same as presented in NVIC 7-92.

- (a) Introduction and plan content
- (1) The emergency response plan has been prepared for the Egan Marine Corporation Barge Loading/Unloading dock facility, located at mile 302.1, Chicago Sanitary and Ship Canal, approximately 1/4 mile upstream of Lemont (Will County), Illinois in "B-Slip".

Egan Marine Corporation's office address is Old Canal Road, Lemont, IL. The mailing address is PO Box 669, Lemont, IL 60439.

Egan Marine's phone numbers are as follows:

708-739-0947 708-739-4455 (FAX)

Egan Marine's President is Dennis Egan, phone 708-972-0948.

- (2) The dock facility is located at mile 302.1 on the Chicago Sanitary and Ship Canal, 1/4 mile north of the Lemont Bridge crossing the canal.
- (3) Egan Marine's designated responsible and qualified person is Dennis Egan, address Bluff Road, Lemont, IL 60439, phone 708-972-0948. Mobile telephone number: 708-975-6900.

The procedure for contacting the owner or operator is as follows:

During all times that transfers are in progress, an Egan Marine employee will be present as operator. Therefore, notification of any spill will be nearly instantaneous. Additionally, the operator is in constant radio communication with the barge. In the event of a spill, the operator will immediately contact Egan Marine's designated qualified person, or his replacement by telephone.

(4) A Table of Contents is presented at the beginning of this document.

- 75) This plan conforms to the format specified in NVIC 7-92. Therefore, no cross reference is provided.
- (6) A record of change(s) to record plan updates is provided following this page.

Record of Changes

Date of Change	Changes Made to Page	Nature of Change	Change Authorized by
1			
2			
3		<i>i</i>	
4	·		
5			
6			
7			
8			
ə			1
12			
13			
14			
15			
. 16			
17			
18			
19			
			•

b) Emergency response action plan

(1) Notification procedures

(i) Prioritized identification of person(s) to be notified in the event of a discharge or substantial threat of a discharge of oil.

(A) Facility Response Personnel

In the event of any spill emergency, the Egan Marine Corporation operator on duty shall do the following:

Immediately notify the barge operator to shut the barge's pumps off, and close the pump discharge valving (unloading operations).

Immediately shut off his transfer pump and close the pump discharge valving (loading operations).

The operator will place the following call after closing the shut off valve. Contact Dennis Egan, (708) 972-0948 (home), as primary qualified individual. If he is not available, Daniel Egan (708) 972-1116 (home) will be contacted as secondary qualified individual.

The primary, or secondary, qualified individual will make the following contacts:

Heritage Environmental, the designated oil spill response organization (OSRO). Emergency number 708-378-1600

(B) Federal, state and local agencies

National Spill Response Center:	800-424-8800
Coast Guard MSO (7:30 AM to 4:00 PM):	708-789- <u>5</u> 830
Coast Guard Milwaukee (4:00 AM- 7:30 AM):	414-747-7190
Illinois EPA:	708-345-9780
Will County Police:	815-727-6191
Lemont Fire Department (7:30 AM- 4:00 PM): Lemont Fire Department (4:00 PM- 7:30 AM):	708-257-2376 708-257-2221

-(ii) The following "Information on Discharge" form would be completed.

Information on Discharge

	-Invo	lved Parties-	•
(A) Reporting Party	(B)	Suspected Response	ible Party
Name		Name .	
Phones () -	•	Phones () -	
Company		Company	
Position		Organization Type	:
Address		Private cit	izen
Address		Private ent	
		Public util	
		Local gover	
		State gover	
		Federal gov	ernment
City	City		
State	State		
Zip	Zip		
Were Materials Released (Y			•
Calling for Responsible Pa			
		: Description-	
Source and/or Cause of Inc	ident:		
Date Time : Cause		•	
Incident Address/Location		Nearest City	
Distance from City		•	
Storage Tank Type-Above ground(Y/N)? Unknown			
Tank Capacity		ty Capacity	
Latitude Degrees		-1 orbranel	•
Longitude Degrees			
Mile Post or River Mile			
	-Ma	terials-	•
Released Quantity	Releas	ed Material	Quantity
Unit of Measure		•	in Water
	-Remed	lial Action-	
Actions taken to Correct of		.dent pact-	•
Number of Injuries		er of Fatalities	
Were there Evacuations (Y,	/N)? Numb	er Evacuated	•
Was there any Damage (Y/N))? Dama	ge in Dollars	•
.		al Information-	
Any information about the Incident not recorded elsewhere in the report			
-Caller Notifications: (Name/Time)-			
EPA State	USCG	Other	DESC
·		-	

^{*} IT IS NOT NECESSARY TO WAIT FOR ALL INFORMATION BEFORE CALLING NRC

- (2) Facility's spill mitigation procedures
 - (i) Volume of persistent and non-persistent oils which could be involved in the:
 - (A) Average most probable discharge:

Equal to the lesser of 50 bbl or 1% of worst case spill

1% of worst case spill = 1.26 bbl

(B) Maximum most probable discharge:

Equal to the lesser of 1200 bbl or 105 of worst case spill

10% of worst case spill = 12.6 bbl

(C) Worst case discharge:

A worst case discharge is equal to the total of (1) line volume, (2) volume discharged during the time necessary to shut off the pump(s).

Worst case discharge = 53.1 bbl + 40 bbl + 33.3 bbl

= 126.4 bbl

(ii) Prioritized procedures for mitigating or preventing the consequences of a spill: In the event of any spill emergency, the Egan Marine Corporation operator on duty shall do the following:

Specific emergency/spill scenarios:

(A) Failure of manifold or other transfer equipment, or hoses, as appropriate:

Immediately notify the barge operator to shut the barge's pumps off, and close the pump discharge valving (during unloading operations).

Immediately shut off his transfer pump and close the pump discharge valving (during loading operations).

I the spill occurs during barge unloading operation, the operator will initiate calling procedures after closing the shut off valve.

If the spill occurred due to a break or leak in a line over the surface of the water, the operator will reposition the line, if possible, so that any spillage or drippage will be over the surface of the barge, the shore, or the secondary containment area.

- (B) Tank overfill:

 Not applicable
- (C) Tank failure:
 Not applicable
- (D) Piping Rupture See (A) above
- (E) Piping leak, both under pressure and not under pressure, if applicable. See (A) above
- (F) Explosion and/or fire: See (A) above
- (G) Equipment failure: See (A) above
- (iii) Listing of Equipment and responsibilities of facility personnel to mitigate an average most probable discharge.

Listing of equipment:

Absorbent material will be stored on site for small spills on dock or barge. This includes individual 200 count 16.5 x 20" absorbent pads, each capable of 32 oz. of absorption, or 25 gallons per bale, and four (4) 8" x 10' sections of absorbent boom, for immediate containment of any spillage into canal. In the event of a possible release of product into waterway, one section of the boom would be placed at the front and rear of barge, extending from the barge to the dock face wall. This would prevent product from moving up or down stream. Absorbent pads would then be used to absorb product, until professional remediators are on site. Boom and absorbent pads are on site, located inside the operations shed. These materials are immediately available to Egan Marine personnel, and could be positioned in minutes. Egan Marine's OSRO would then be contacted to provide additional assistance as necessary.

_esponsibilities of facility personnel to mitigate an average most probable spill:

It is the responsibility of all Egan Marine employees associated with the dock facility to implement the procedures specified in this plan in order to mitigate all spills.

- (3) Facility's response activities
- (i) This section covers facility personnel's responsibility to initiate a response and supervise response resources pending the arrival of the qualified individual.

It is the responsibility of all Egan Marine employees associated with the dock facility to implement the procedures specified in this plan in order to mitigate all spills, while waiting for the arrival of the qualified individual.

(ii) This section contains the qualified individual's responsibility, authority, and response time.

Egan Marine Corporation has delegated the responsibility and the authority to fully implement this plan to the qualified individual. The qualified individual can generally respond to the scene within 20 minutes of being notified of an incident. The designated alternate can generally respond to the scene within 20 minutes of being notified of an incident. Each individual has been delegated the full authority to:

- (A) Activate and contract with necessary oil spill removal organization(s);
- (B) Act as liaison with the predesignated Federal On-Scene Coordinator, and
- (C) Obligate, either directly or through prearranged contracts, any funds required to carry out all necessary or directed oil response activities.
- (iii) This plans contains the facility and/or corporate organizational structure that will be used to manage the following response actions:
 - (A) Command and Control: The Egan Marine Corporation operator on duty will assume command and control of the incident until relieved by the qualified individual, who will then assume this responsibility.
 - (B) Public information: The operator on duty will not be authorized to release information to the public (other than to duly authorized emergency response personnel). That function shall fall to the qualified individual, his alternate, or a Egan Marine Corporation officer, upon their arrival.

- (C) Safety: The Egan Marine Corporation operator on duty will assume responsibility for safety until relieved by the qualified individual, who will then assume this responsibility.
- (D) Liaison with government agencies: The Egan Marine Corporation operator on duty will assume responsibility for liaison with government agencies until relieved by the qualified individual, who will then assume this responsibility.
- (E) Spill Operations: The Egan Marine Corporation operator on duty will assume responsibility for spill operations until relieved by the qualified individual, who will then assume this responsibility.
- (F) Planning: The Egan Marine Corporation operator on duty will assume responsibility for planning until relieved by the qualified individual, who will then assume this responsibility.
- (G) Logistics support: The Egan Marine Corporation operator on duty will assume responsibility for logistics support until relieved by the qualified individual, who will then assume this responsibility.
- (H) Finance: The operator on duty will not be authorized to make financial arrangements, other than the contracting of spill response personnel as outlined above. That function shall fall to the qualified individual, his alternate, or a Egan Marine Corporation officer, upon their arrival.
- iv) Identification of the oil spill removal organization:

The following is the oil spill contractor identified to assist in implementing the provisions of this emergency response plan:

Heritage Remediation/Engineering

This contractor has the following capabilities:

- (A) To respond to the following spill scenarios:
 - (1) Maximum most probable discharge: and
 - (2) Worst case discharge to the maximum extent practicable: and
- (B) Is capable of providing the following response resources:
 - (1) Equipment and supplies needed to meet the guidelines of Section 11. 2 of this plan, and

- (2) Trained personnel necessary to continue operation of the equipment and staff the oil spill removal organization and spill management team for the first 7 days of the response.
- (v) This provision for mobile facilities is not applicable.
- (vi) This plan lists the information on specific equipment in Appendix A of this plan. The oil spill removal organization identified above has stated that removal ratings given for his equipment have been determined in compliance with Appendix C of NVIC 7-92.
- (4) Sensitive areas.

Egan Marine Corporation has sought to identify areas that are economically or environmentally sensitive. Based on the lack of commercial shelling or fishing in the area, it has been determined that there are not any areas which are "economically important" which might be affected by a worst case spill from the Egan Marine dock.

Egan Marine has also contacted numerous governmental agencies to determine if any "environmentally sensitive" areas are present. The Illinois Department of Energy and Natural Resources' Illinois Natural Historical Survey: Aquatic Biology Section was able to identify several areas of environmental sensitivity within approximately 22 miles of this facility.

(i) These areas which may be impacted by this facility are:

Area	Mile Location	Miles from Egan Marine Dock
Treat's Island	279.9	22.2
Confluence, DuPage River	277	25.1
Will County Forest Preserve	276	26.1

- (ii) A map showing the sensitive areas, and the anticipated response action is presented in Appendix G.
- (iii) Response activities anticipated to be utilized to protect the areas identified in (ii) above include placement of boom in order to protect the environmentally sensitive areas in such a manner as to protect these areas from direct contact with any floating oil, as well as to contain any floating oil which reaches these locations. Also, booms would be placed across the width of the slip, as close to the source of an oil sheen as possible, in order to contain the sheen.

- (iv) Identification of equipment and described personnel available to protect areas of environmental sensitivity and economic importance as follows:
- (A) For persistent oils, distance reached from the facility in 48 hours at maximum current:

Based on Corp. of Engineer's figures, the maximum daily flow rate experienced during the last seven years was 15,838 cfs. At Egan Marine's dock, the depth during such a peak flow should be expected to be 20 feet.

Therefore total cross-sectional area is 3300 sq. ft.

15,838 cfs divided by 3300 sq. ft. = 4.80 feet per second velocity. which equals 3.27 mph.

3.27 mph multiplied by 48 hours = 157 miles.

. ::2

Mile 302.1 (Egan Marine's location) - 157 miles travel = Mile 145.1, which is approximately Coon Island, near Kingston Mines.

Notice: The actual distance traveled would not be further than Mile 291 since the Lockport Locks are at that location and flow would not be able to proceed beyond that location.

'ersonnel to be utilized in responding to spills in order to protect environmentally sensitive areas are employees of Egan Marine's spill response contractor. Equipment available to provide this protection is listed in Appendix A.

NOTICE: Egan Marine Corporation's primary strategy for protecting sensitive areas is to quickly place a boom across the width of B-Slip where the dock will be located. Egan Marine's spill response contractor has the capability to deploy boom across the entire width of the canal, downstream of a spill within 2 hours of the spill. At the maximum current of 3.27 mph, the theoretical spill could cover a distance of 6.5 miles, or Mile 295.6. Although the requirements of NVIC state that sensitive areas within the travel hours of 48 hours must be identified, the likelihood of needing to protect sensitive areas along 157 miles of the canal and river is extremely unlikely. Also, see Notice above.

- (B) For persistent oils discharged into tidal waters: Not applicable.
- (C) For non-persistent oils discharged into non-tidal waters: Not applicable.
- (D) For non-persistent oils discharged into tidal waters: Not applicable.
- (E) Substitution of spill trajectory or model: Not submitted.

- (F) COTP determination that additional areas would need to be protected.
- (v) Identification of equipment necessary to protect all areas of economic importance and environmental sensitivity identified in the ACP for the distance the oil is likely to travel for the geographical areas(s) and number of days listed in Table 2. This section is not applicable since the ACP has not yet been developed.
- (5) Disposal activities: All oily and waste materials recovered during the response to the spill will be placed in suitable containers for temporary storage until disposal arrangements will be made. When necessary these arrangements will include obtaining disposal/treatment permits which comply with the requirements of all federal, state and local guidelines. Commercial waste disposal companies will be contacted to assist in this effort. All appropriate manifests will be completed. Products which are relatively uncontaminated will be returned to our processing stream as mandated by RCRA.
- (c) Hazard evaluation [Reserved]
- (d) Spill scenarios [Reserved]
- (e) Training and drills
 - (1) Training procedures

All Egan Marine employees who are assigned as operators at the dock, the qualified individual and his alternate, and key corporate employees will be trained to meet the requirements of this plan. This training shall include:

A thorough study of the details of this plan.

Discussion and resolution of all questions raised by trainees.

Signing of a training log to indicate that the trainee understands the requirements of this plan.

Sufficient on-the-job training to assure that trainee can:
Shut off all appropriate pumps
Manipulate all necessary valves
Deploy on-site spill response equipment
Utilize on-site emergency communication equipment

Additional training details are provided in Section 12.0 of this plan.

(2) Drill procedures

Drill procedures are presented in Section 13.0 of this plan.

Plan review and update procedures

This plan shall be reviewed by Egan Marine's qualified individual every three months. If any changes are deemed to be warranted, they will be implemented and recorded on the appropriate form.

Additionally, when final regulations promulgated under the authority of OPA 90 are available, an additional review will be conducted.

Reviews of the plan will also be conducted any time that revised NVIC's are available, or when formally requested by the USCG or US EPA.

- (f) Appendices
- (1) Facility-specific information

escription of facility's principal characteristics

(i) Physical description of the facility, including a plan of the facility.

See Appendix H "Description and Plan View of Facility"

- (ii) Identification of sizes, types and number of vessels that facility can transfer oil to, are presented in Appendix I "Types and Number of Vessels Serviced"
- (iii) Identification of first valve separating MTR and non-MTR facility. See appendix H.
- (iv) Description of material stored. See Appendix B "Product MSDS Sheets"
 - (A) Inclusion of generic or chemical name. See MSDS sheets.
 - (B) Description of appearance and odor. See MSDS sheets.
 - (C) Physical and Chemical characteristics. See MSDS sheets.

- (D) Hazards involved in handling the oils. See MSDS sheets.
- (E) List of fire fighting procedures. See MSDS sheets.
- (v) Additional information provided. See MSDS sheets.
- (2) List of contacts. See Appendix D facility Contact List.
 - (i) Primary and alternate qualified individuals. See Appendix D facility Contact List.
 - (ii) See Appendix A "Spill Response Contractor Information".
 - (iii) See Appendix C "Agency Contact List".
- (3) Equipment lists and records
 - (i) See Appendix D Facility Contact List, and Appendix E Facility Equipment List.
 - (ii) List of major equipment provided by spill response organization
 - (iii) Description of equipment
 - (A) Type, make and model: See Appendix A, Spill Response Contractor Information.
 - (B) Effective daily recovery rate: See Appendix A, Spill Response Contractor Information.
 - (C) Containment boom, overall height, and type of end connectors. See Appendix A, Spill Response Contractor Information.
 - (D) The spill scenario in which the equipment will be used or for which it is contracted: All spill response contractor information is intended to be used for response to a worst case scenario.
 - (E) Total daily capacity for storage and disposal of recovered oil. In the event of a spill requiring the services of a spill response contractor, portable tankage of sufficient volume to hold the contents of a worst case spill, 126 barrels (5292 gallons) will be obtained. Depending on the location from which material is recovered, storage containers may be provided in the form of drums, frac tanks, tank trucks or vacuum trucks.

(4) Communications plan

See Appendix J, Communications Plan.

- (5) Site-specific safety and health plan. See Appendix K, Site-Specific Safety and Health Plan.
- (6) List of acronyms and definitions

See Appendix K, List of Acronyms and Definitions

Geographical-specific appendix for mobile facilities (not applicable)

Section 9 Specific Guidelines for Facilities That May Cause Substantial Harm to the Environment

This Section is not applicable to this facility.

Section 10 Specific Response Information to be Maintained on Mobile MTR Facilities

2

The Egan Marine Corporation Loading Facility is not a mobile MTR facility. Therefore, this section is not applicable.

Section 11 Response Plan Development and Evaluation Criteria for Facilities That Handle, Store, or Transport Group I through Group IV Petroleum Oils

The Egan Marine Corporation Loading Facility handles Group V petroleum oils and non-petroleum oils only. Therefore, this section is not applicable.

Section 11.2 Response Plan Development and Evaluation Criteria for Facilities That Handle, Store, or Transport Group V Petroleum Oils

(a) Owner/operator should provide:

. .

(1) Procedures and strategies for responding to discharges of group V petroleum oils

Oil Sheen or floating oil: See Section 8 of this plan.

Heavier-than-water material: Bulk shipments loaded and unloaded by this facility are typically heated asphaltic materials at temperatures in excess of 250 degrees F, with a specific gravity greater than 1.0. In the event of a spill into the canal, the material would be expected to cool rapidly, sink to the bottom, and solidify. Spreading of the material over a large area on the bottom of the canal, and away from the immediate area of the dock would not be expected, due to the rapid cooling, and increase in viscosity of the spilled asphaltic materials.

Location of the sub-surface material, and its perimeter, would utilize vessel-mounted sonar equipment. This equipment would be used throughout the removal process to verify complete removal.

The US Army Corp. of Engineers would be contacted to obtain an emergency dredging permit. The Corp. has been contacted regarding appropriate procedures to be followed in the event of a spill which would require dredging. Their permit department has stated that a permit would be required before any dredging could begin, including an emergency spill response. They did state that a permit application for dredging the residue of a spill would be expedited.

Removal from the bottom of the canal would be accomplished by a dredge.

The material would then be removed and placed in portable containers, such as roll-off boxes on shore. The recovered material will then be analyzed to determine if recycling was possible, or if disposal was required.

Appropriate disposal permits would be applied for.

(2) Sources of the equipment and supplies

Mobile dredging equipment is available onsite at Egan Marine.

Roll-off boxes will be obtained from Waste Management.

- (b) Owner should evaluate the limitations of equipment from;
- (1) Ice conditions: Based on historical experience, it is not expected that ice would form in sufficient quantity or thickness to have an impact on removal operations. In the event that surface ice were to form in the immediate area of the spill in sufficient quantities or thickness so as to interfere with recovery operations, it would be broken up by one of the Egan Marine vessels.
- (2) Debris: no debris would be anticipated to be present in the event of a sub-surface asphalt spill at the Egan Marine dock. Should any be encountered it would be easily removed via the dredge, and would not present an obstacle to the removal operation.
- (3) Temperature ranges: Variation in surface or water temperatures would not be expected to materially effect the recovery operation.
- (4) Weather-related visibility: Local visibility could be decreased due to the presence of fog. However, due to the expected close proximity of the dredge to the location of the spill, and the nearness to shore, adverse visibility would not be expected to materially effect the recovery operation.
- (c) Identified equipment should include:
- (1) Sonar, sampling equipment etc. for locating oil: Sonar will be used for locating the submerged material. This sonar is onsite at Egan Marine. If necessary, portable sonar ("fish-finder") units will be obtained and used from smaller vessel (John-boats), in order to locate the material. Because of the fact that the asphaltic material would quickly solidify after entering the water, typical sampling equipment would not be effective in determining the area of spread.
- (2) Containment boom, methods for containing asphaltic oil: Containment boom would not be effective in containing the subsurface material. Because of the fact that the asphaltic material would quickly solidify after entering the water, additional containment would not be necessary or useful.
- (3) Dredges, pumps for recovering oil: Because of the fact that the materials would quickly solidify after entering the water, pumps would not be effective in removing the material. Dredging equipment is identified in Appendix L Dredging Equipment.
- (4) Equipment necessary to assess impact of discharges: No additional equipment is expected to be necessary to assess the impact of the discharge.
- (5) Other appropriate equipment: No additional equipment is expected to be necessary to assess the impact of the discharge.

__J) Responses must be deployable within 24 hours

The response sources identified in this plan are capable of responding within 24 hours of the discovery of a spill.

Identification of sources of firefighting capabilities:

Will County Police: 815-727-6191
Lemont Fire Department (7:30am-4:00pm) 708-257-2376
Lemont Fire Department (4:00pm-7:30am): 708-257-2221

Section 11.4 Response Plan Development and Evaluation Criteria for Facilities That Handle, Store, Transport non-Petroleum Oils

- (a) Owner/operator should provide:
- (1) Procedures and strategies for responding to discharges of nonpetroleum oils

Oil Sheen or floating oil: See Section 8 of this plan.

Bulk shipments loaded and unloaded by this facility are typically heated soybean/soapstock oil. In the event of a spill into the canal, the material would be expected to cool rapidly, and solidify. Spreading away from the immediate area of the dock would not be expected, due to the rapid cooling, and increase in viscosity of the spilled materials.

Removal from the canal would be accomplished by a hand scoops and dredge-type equipment. The material would then be removed and placed in portable containers, such as roll-off boxes or barrels on shore. The recovered material will then be recycled.

(2) Sources of the equipment and supplies

Equipment is available onsite at Egan Marine.

Roll-off boxes will be obtained from Waste Management.

- (b) Owner should evaluate the limitations of equipment from;
- (1) Ice conditions: Based on historical experience, it is not expected that ice would form in sufficient quantity or thickness to have an impact on removal operations. In the event that surface ice were to form in the immediate area of the spill in sufficient quantities or thickness so as to interfere with recovery operations, it would be broken up by one of the Egan Marine vessels.
- (2) Debris: no debris would be anticipated to be present in the event of a sub-surface spill at the Egan Marine dock. Should any be encountered it would be easily removed via the dredge, and would not present an obstacle to the removal operation.
- (3) Temperature ranges: Variation in surface or water temperatures would not be expected to materially effect the recovery operation.

- __4) Weather-related visibility: Local visibility could be decreased due to the presence of fog. However, due to the expected close proximity of the dredge to the location of the spill, and the nearness to shore, adverse visibility would not be expected to materially effect the recovery operation.
 - (c) Identified equipment should include:

ندر

- (1) Containment boom, methods for containing soybean/soapstock oil: When dealing with soybean oil/soapstock, booms would be initially effective for containment. As the product cooled, it would solidify and would be scooped up effectively.
- (2) Dredges, pumps for recovering oil: Because of the fact that the materials would quickly solidify after entering the water, pumps would not be effective in removing the material. Dredging equipment is identified in Appendix L Dredging Equipment.
- (4) Equipment necessary to assess impact of discharges: No additional equipment is expected to be necessary to assess the impact of the discharge.
- (5) Other appropriate equipment: No additional equipment is expected to be necessary to assess the impact of the discharge.
- (d) Responses must be deployable within 24 hours

The response sources identified in this plan are capable of responding within 24 hours of the discovery of a spill.

Identification of sources of firefighting capabilities:

Will County Police: 815-727-6191
Lemont Fire Department (7:30 AM-4:00 PM) 708-257-2376
Lemont Fire Department (4:00 PM-7:30 PM): 708-257-2221

Section 12 Training

- (a) Training must be identified: In addition to the on-the-job training of facility procedure and operations mentioned in section 8(e) of this plan, each person involved in the response structure will receive training as required by 29CFR1910.120, Hazardous Waste Operations and Emergency Response. Egan Marine Corp. will provide employee training consisting of 8 hr. of classroom training using a lecture format and visual aids plus a simulated emergency drill with active participation of all trainees at a minimum of one time per year. This training will be conducted at a pre-determined location by an individual trained and qualified to administer such training.
- (b) Training records will be maintained for 3 years.
- (c) This facility is not an oil spill response organization. Therefore, this section is not applicable.
- (d) The facility owner will instruct their oil spill response organization to maintain adequate records.

Section 13 Drills

(a) Details of type and frequency of drills

- (1) Facility and Qualified Individual notification drills will be conducted monthly.
- (2) Facility equipment deployment drills will be conducted semi-annually.
- (3) Spill management team tabletop drills will be conducted yearly.
- (4) Egan Marine Corporation will conduct an annual unannounced drill. During this drill, the oil spill removal organization and spill management team will be activated. This drill will count as one of the semi-annual drills identified in (a)(2) above.
- (5) Egan Marine Corporation will participate in any announced drill conducted by the cognizant COTP.
- (6) Egan Marine Corporation will assure that the response resources identified in the plan participate in the annual deployment drill.
- (b) Drills will be designated by the facility owner to either exercise a component or the plan or the entire spill plan. Once every three years, a drill will be conducted which exercises the entire plan.
- (c) The facility owner will assure that drill records are maintained for three years.
- (d) The facility owner will assure that drill records for the spill response contractor are maintained for three years.
- (e) If the spill response contractor is drilled within the time periods specified, the owner will submit these records to the USCG as evidence of compliance with (a)(3) and (a)(5).

insert activation letter here

Appendix A

Spill Response Contractor Information

COMPANY NAME: National Industrial Maintenance, Inc.

COMPANY ADDRESS: 4530 Baring, East Chicago, 1N 46312

PHONE NUMBERS: MAIN OFFICE: (219) 398-6660

Booms (type/size/skirt size/length!: 500 ft. 6' skirt.

Number of Skimmers (type/capacity in gallons per minute): Portable skimmer, 3 Floating 36' Saucer Skimmers, 5 Manta Ray Skimmers.

Number of Vacuum Trucks (capacity): 2 - 6500 gal; 3 - 3800 gal; 1 - 2500 gal; 1 - 1600 gal. Also 8 - 9000 gal Heavy oil vacuum loaders.

Boats (number, sizes, engine/horsepower); 2 - 16' boats 25 hp

Trailers (number/length/load capacity): 4 - 8000 gal tank trailers with pumps.

COMPANY NAME: Clean Harbors.

COMPANY ADDRESS: 11800 S. Stony Island Avenue, Chicago, IL 60617

PHONE NUMBERS:

MAIN OFFICE:

(312) 646-6202

24 HOUR:

Same

Number of Vacuum Trucks (capacity): 1 - 5000 gal; 1 - 3000 gal

<u>COMPANY NAME:</u> Heritage Remediation/ Engineering

COMPANY ADDRESS: PO Box 337, Lemont, IL 60439

PHONE NUMBERS:

MAIN OFFICE: (708) 739-1150

24 HOUR:

Same

Booms type/size/skirt size/length): 1000 ft - 6' skirt, also 400 ft - 6" skirt in Indianapolis, IN.

Sorbent Boom; 800 ft of 8" boom (20 bales @ 40 ft/bale)

Sorbent (type); 3M absorbents - asorball, pads, snare, \$5000 value in stock

Number of Skimmers (type/capacity in gallons per minute) 1 - Oil Mop 1000'

Number of Vacuum Trucks (capacity): 1 - 5000 gai, 1 - 5450 gai, 1 - 3500 gai, Also 1 - 3500 gai vac truck in Indianapolis, IN.

Communication Equipment (type and number; i.e. cellular phone, radio, etc.):
Radio Motorola-9, G.E. Walkie Talkies - 5 with earphones. Cellular phones G.E. - 8

<u>'hemical Suits (number/type):</u> Teflon fully encapsulated - 2, Saranes - 50, Responder - 4, Onemrel fully encapsulated - 50.

<u>Self-Contained Breathing Apparatus (number/type):</u> Scott - 4, SBA Scott - 12 w/egress, APR North/MSA Respirators - 25, 12 in other divisions.

Boats (number, sizes, engine/horsepower): 18' John Boat, 35 hp. Work barges (number and size): None - Contractually available.

Aircraft (number and type): 1 - King Air prop. 8 passenger (based at Indianapolis)

<u>Portable Generators (number/type/power output)</u>: 3-7 500 watt generator Koehler & Ingersoll Rand, 3 in other divisions.

Portable Pumps (number, type/capacity): 10 - 3" & 2" Double diaphragm air pumps, 200 to 300 gal/minute, 3 -3" trash pumps, 200 gal/minute, 15 in other divisions.

<u>Trucks (number/horsepower/load capacity):</u> 7 - 1 ton pickup utility trucks, 20 in other divisions, 7 - tractors Mack 300 hp, 500 pound capacity, 1 - lowboy, 50 ton.

<u>Frailers (number/length/load capacity):</u> 4 - Trailers tankers with Roper pumps, 6500 gal, 1 - box van 40', 1 - box van 22'

Other Equipment: Contact company for a list of other available equipment.

COMPANY NAME: Torvac, Inc.

COMPANY ADDRESS: 3000 W. Wireton Road, Blue Island, IL 60406

PHONE NUMBERS:

MAIN OFFICE:

(708) 388-3223

24 HOUR:

Same

Number of Vacuum Trucks (capacity): 3 - 3000 gallon with small water jet. Also 1 -Heavy oil vacuum loader (Vactor) with 3000 gallon capacity.

Trucks (number/horsepower/load capacity): 2 - 5000 gallon tankers.

Trailers (number/length/load capacity): 1 - semi trailer.

Other Equipment: 1 Vactor 1200 with 2000 psi water jet.

COMPANY NAME: Marine Pollution Control

COMPANY ADDRESS: 8631 W. Jefferson, Detroit, MI 48209

PHONE NUMBERS:

MAIN OFFICE:

(313) 849-2333

24 HOUR:

Same

Booms (type/size/skirt size/length): 1000 ft - 6" skirt flotation diameter 6". ACME "O.K Corral" boom. Boom distributor (truck load quantities are readily available).

Sorbent Boom: 3M or SPC 6000 ft of 8" boom (150 bales @ 40 ft/bale) and 5" boom (50 bales).

Sorbent (type): Rolls - 100, Pads - 200 bales, Pillows - 50 bales, Sweeps - 20 bales.

Number of Skimmers (type/capacity in gallons per minute): ACME Model SK-39T 300 gpm. Manta Ray Skimmer, 159 gpm. OSR Scavenger - for gasoline and #2 oil, 50 gpm.

Number of Vacuum Trucks (capacity): 1 - 6000 gal; 1 - 5000 gal; 1 - 3300 gal; 1 - 3000 gal; 1 - 2500 gal; 2 - 2000 gal; 1 - 1800- gal. Also 1 vacuum barge - 4000 gal.

Communication Equipment (type and number: i.e. cellular phone, radio, etc.): 5 Cellular phones, 1 - 2 way business band base station. 21 mobile 2 way business band radios. 8 portable 2 way radios. 5 marine radios. 6 mobile marine radios. 8 walkie-talkies.

<u>Chemical Suits (number/type)</u>: 10 full air suits, protective clothing for level B & C. 4 MSA air packs. 2 MSA air cubs. 6 MSA cascade breathing systems. 35 MSA canister masks. 1 Wilson ambient air breathing systems.

Boats (number, sizes, engine/horsepower): 2 - 17 boom boats with marine radios and outboard motors. 6 - 12 john boats with outboard motors. 2 - 15 equipment rafts with outboard motors.

Work barges (number and size): BUDA I-36' x 12', capable of transport by air, rail or trailer, 200 hp outboard powered debris catcher, 12' x 20' debris or boom hauling space, marine radio.

Portable Pumps (number/type/capacity): 7 submersible hydraulically powered pumps. 8 complete systems containing a 6 cylinder air or water cooled diesel power pack. 200' cargo hoses. 300' hydraulic hoses and fuel bladder.

Other Equipment: Ground water decontamination equipment. 43 varieties of trucks and trailers.

COMPANY NAME: Riedel Environmental Services, Inc.

COMPANY ADDRESS: Chicago Branch-65 E. Palatine Rd., Suite 109, Prospect Heights, IL 60070. St. Louis Regional Office-18207 Edison Ave., Chesterfield, MO 63005

PHONE NUMBERS:

CHICAGO OFFICE: (708) 215-0300

24 HOUR:

(800) 334-0004

Sorbent Boom: 400 ft 8" boom (10 bales @ 40 ft/bale).

Sorbent (type): Grade 100 pads - 18" x 18" x 3/8" (100 pads/bale) SPC 100, 19#, 23 bales.

Number of Vacuum Trucks (capacity): Available from subcontractors.

Communication Equipment (type and number: i.e. cellular phone, radio, etc.): Motorola hand held radios and base stations (30) pickup truck mounted cellular telephones and response trailer mounted telephones (10).

Chemical Suits (number/type): PVC Acid suits (30) Acid King Level A Suits (8).

Self-Contained Breathing Apparatus (number/type): MSA Model 401 and Ultra-Lite (16).

Boats (number, sizes, engine/horsepower): 16' to 18' boats with 75/200 hp outboards, small boats with or without outboards.

Work barges (number and size): Available from subcontractor on short notice.

Portable Generators (number/type/power output): 3 kW (4), 5 kW (10), and 50 kW (1).

<u>Trucks (number/horsepower/load capacity):</u> Vans, Pickups, 1/2 & 3/4 ton. Four-wheel drive vehicles, 1 to 2-1/2 ton trucks, Crane truck.

Trailers (number/length/load capacity); Boom & Equipment, Office and Boom trailers.

Other Equipment: Contact company for other information.

POLLUTION CLEAN UP CONTRACTOR RESOURCES LIST

COMPANY NAME: O.H. Materials Corp.

COMPANY ADDRESS: 1334Enterprise Drive, Romeoville, IL 60441

PHONE NUMBERS:

MAIN OFFICE:

(800) 536-9540

24 HOUR:

(708) 759-9493

Number of Vacuum Trucks (capacity): 1 - 1500 gal.

Communication Equipment (type and number: i.e. cellular phone. radio. etc.): 1 mobile radio.

Boats (number, sizes, engine/horsepower): 2 motors, 2 john boats, 1 robalo boat.

Portable Pumps (number/type/capacity): 1 electric chemical transfer pump, 6 - 1 1/2" high pressure pumps, 3" electric submersible pump.

Trucks (number/horsepower/load capacity): 1 - 2 ton PCT truck.

Trailers (number/length/load capacity): 1 decon/office trailer (28')

Other Equipment: 3 chain saws, 1 dissolved oxygen meter, 2 explosion meters, 1 flow meter, 1 fork lift, misc. lab equipment, 1 partner saw, 1 pH meter, 1 - 535,000 BTUs burner.

_Appendix C

Agency Contact List

Federal, State and Local Agencies

National Spill Response Center:	800-424-8800
Coast Guard MSO (7:30 AM to 4:00 PM):	708-789-5830
Coast Guard Milwaukee (4:00 PM-7:30 AM):	414-747-7190
Illinois EPA:	708-345-9780
Will County Police:	815-727-6191
Lemont Fire Department (7:30 AM-4:00 PM):	708-257-2376
Lemont Fire Department (4:00 PM-7:30 AM):	708-257-2221

Appendix D

Facility Contact List

EGAN MARINE CORPORATION: •

708-739-0947

EGAN MARINE CORPORATION FAX:

708-739-4455

Egan Marine's President is Dennis Egan, address Bluff Road, Lemont, IL 60439, phone 708-972-0948.

Egan Marine's vice-president is Robin Chanda, address 1446 Star Lane, Lemont, IL 60439, phone 815-838-6660.

Egan Marine's designated responsible and qualified person is Dennis Egan. Information above.

Facility Equipment List

Absorbent material will be stored on site for small spills on dock or barge. This includes individual 200 count 16.5×20 " absorbent pads, each capable of 32 oz. of absorption, or 25 gallons per bale, and four (4) 8" x 10' sections of absorbent boom, for immediate containment of any spillage into canal.

Site Specific Health and Safety Plan

I Protective Equipment

Gloves will be used to handle hot material. Additional protective clothing, such as coveralls will be provided if a safety related situation warrants. Hard-hats and safety glasses will be issued to personnel.

II Communication Procedure

Communications will be handled as described elsewhere in this document.

III Location of Safety Equipment

Safety equipment is located inside the dock shed. This equipment includes 2 ABC fire extinguishers, a first-aid kit and life rings.

IV First Aid Treatment

Decisions involving the application of first aid treatment to any injured employee or visitor to the facility will be made by the ranking Egan Marine Corporation employee on site, or by any public safety/security official who has formally assumed the responsibility for safety related activities at this site in the event of a spill or public safety emergency.

The person identified above shall determine if first aid is sufficient, or if more advanced professional care is required. If more advanced medical care is required, the injured person will be transported to Silver Cross Hospital in Joliet, (815) 740-1100, for additional medical treatment.

V Safety Training

All employees will be required to read the Material Safety Data Sheets for the materials handled at this facility. Visitors will be instructed as to safety procedures they must follow while on site.


VI Fire Fighting


Fire emergencies will be addressed by using on-site fire extinguishers, if the fire is relatively small. The Lemont Fire Department will be called, as described elsewhere in this plan, if there is any doubt as to the ability of facility personnel to contain and extinguish any fire.

This plan will be in effect for any location involved in a response to a spill from this location.

-Appendix G

Map Identifying Environmentally Sensitive Areas

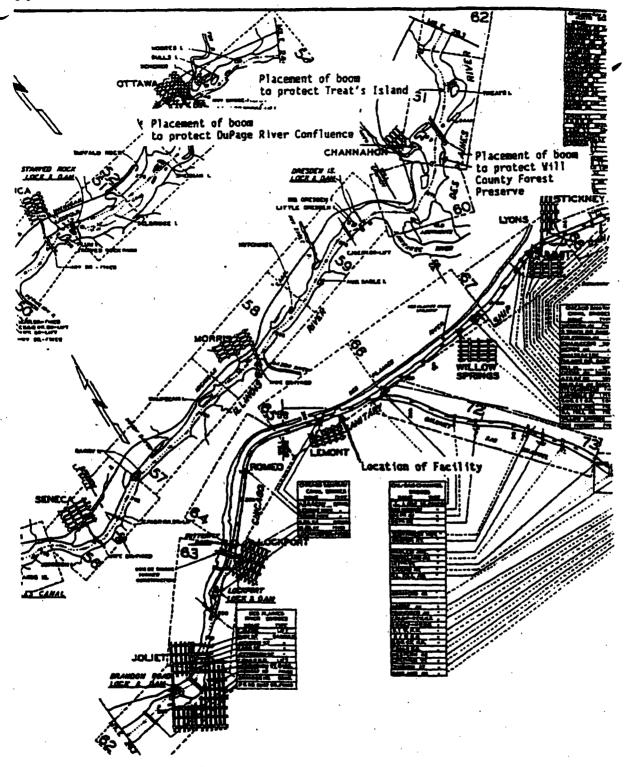

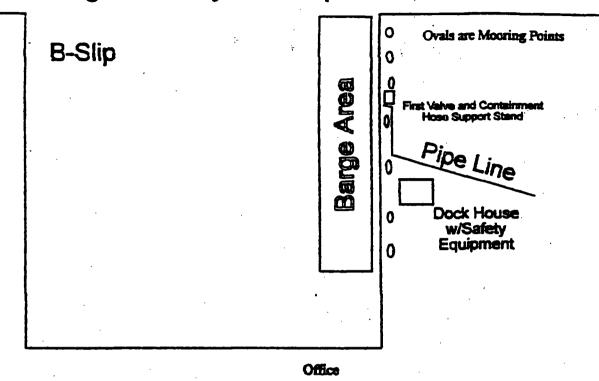

建筑的中央中部设置

_Appendix I Types and Number of Vessels Serviced

Sizes; Types; and Numbers of Vessels:

Individual tank barges will range in size from 7,500 barrels to 15,000 barrels. Individual shipments would involve a minimum volume of 7,500 barrels (one barge), and a maximum volume of 45,000 barrels (3 barges). 90% of Egan Marine's incoming shipments are either a 7,500 or 15,000 barrel barge. This facility can load or unload 2 barges at one time.

-Appendix J Communication Plan

The primary method of communication between the dock and barge will be Motorola 2-way radios. In the event of a spill, the same radios can be used to contact the rest of the facility and office. Egan Marine's designated qualified person, and alternate qualified person, carry this type of radio during the normal course of work.

3(a) Introduction and plan content

- (3) Egan Marine's designated responsible and qualified person is Dennis Egan, address Bluff Road, Lemont, IL. 60439, phone 708-972-0948. Mobile telephone number: 708-975-6900.
- The procedure for contacting the owner or operator is as follows:

During all times that transfers are in progress, an Egan Marine employee will be present as operator. Therefore, notification of any spill will be nearly instantaneous. Additionally, the operator is in constant radio communication with the barge. In the event of a spill, the operator will immediately contact Egan Marine's designated qualified person, or his replacement by telephone.

8(b) Emergency response action plan

- (1) Notification procedures
- (I) Prioritized identification of person(s) to be notified in the event of a discharge or substantial threat of a discharge of oil.

(A) Facility Response Personnel

In the event of any spill emergency, the Egan Marine Corporation operator on duty shall do the following:

Immediately notify the barge operator to shut the barge's pumps off, and close the pump discharge valving (unloading operations).

Immediately shut off his transfer pump and close the pump discharge valving (loading operations).

If the spill occurs during barge unloading operation, the operator will place the following call after closing the shut off valve:

Contact Dennis Egan, (708) 972-0948 (home), as primary qualified person. If he is not available contact Daniel Egan (708) 972-1116 (home).

Dennis Egan, or Daniel Egan, if Dennis Egan is unavailable, will make the following contacts:

Heritage Environmental, the designated oil spill response organization (OSRO). Emergency number 708-378-1600

(B) Federal, state and local agencies

National Spill Response Center:	800-424-8800
Coast Guard MSO (7:00 AM to 3:30 PM):	708-789-5830
Coast Guard Milwaukee (3:30 PM-7:00 AM):	414-747-7181
Illinois EPA:	708-345-9780
Will County Police:	815-727-6191
Lemont Fire Department (7:30 AM-4:00 PM)	708-257-2376
Lemont Fire Department (4:00 PM-7:30 AM):	708-257-2221

The communications plan for this facility is presented in Sections 8(a)(3) and 8(b)(1).

Except as otherwise defined in this section, the definitions in 33 CFR 154.105 are also relevant to this Appendix.

Adverse weather means the weather conditions that will be considered when identifying response systems and equipment is a response plan for the applicable operating environment. Factors to consider include significant wave height, ice, temperature, weather-related visibility, and currents within the Captain of the Port (COTP) zone in which the systems or equipment are intended to function.

Average most probable discharge means a discharge of the lesser of 50 barrels or 1 percent of the volume of the worst case discharge.

<u>Captain of the Port Zone (COTP)</u> means a zone specified in 33 CFR part 3 and the seaward extension of that zone to the outer boundary of the exclusive economic zone (EEZ).

Contract or other approved means includes—

- (1) A written contractual agreement with a response contractor. The agreement should identify and ensure the availability of the specified personnel and equipment described under this NVIC within stipulated response times in the specified geographic areas;
- (2) Certification by the facility owner or operator that the specified personnel and equipment described under this NVIC are owned, operated, or under the direct control of the facility owner or operator, and are available within stipulated times in the specified geographic areas;
- (3) Active membership in a local or regional oil spill removal organization that has identified specified personnel and equipment described under this NVIC that are available to respond to a discharge within stipulated times in the specified geographic areas;
 - (4) A document which-
- (i) Identifies the personnel, equipment, services, capable of being provided by the response contractor within stipulated response times in specified geographic areas;
- (ii) Sets out the parties' acknowledgment that the response contractor intends to commit the resources in the event of a response;
- (iii) Permits the Coast Guard to verify the availability of the response resources identified through tests, /inspections, and drills; and
 - (iv) Is incorporated by reference in the response plan; or

(5) For a facility that could reasonably be expected to cause substantial harm to the environment, with the consent of the response contractor or oil spill removal organization, the identification of a response contractor or oil spill removal organization with specified equipment and personnel which are available within stipulated response times in specific geographic areas.

化二氯基甲烷甲烷 化二氯烷烷

Exclusive economic zone means the zone contiguous to the territorial sea of the United States extending to a distance up to 200 nautical miles from the baseline from which the breadth of the territorial sea is measured.

Facility that could reasonably be expected to cause significant and substantial harm means any fixed MTR onshore facility (including piping and any structures that are used for the transfer of oil between a vessel and a facility) that is capable of transferring oil, in bulk, to or from a vessel of 250 barrels or more, and a deepwater port. This also includes any facility specifically identified by the COTP under Section 3.

Facility that could reasonably be expected to cause substantial harm means any mobile MTR facility that is capable of transferring oil to or from a vessel with a capacity of 250 barrels or more. This also includes any facility specifically identified by the COTP under Section 3 of this Appendix.

Great Lakes means Lakes Superior, Michigan, Huron, Erie, and Ontario, their connecting and tributary waters, the Saint Lawrence River as far as Saint Regis, and adjacent port areas.

Higher volume port area means the ports of.

- (1) Boston, MA.
- (2) New York, NY.
- (3) Delaware Bay and River to Philadelphia, PA.
- (4) St. Croix, VI.
- (5) Pascagoula, MS.
- (6) Mississippi River from Southwest Pass, LA. to Baton Rouge, LA.
- (7) Louisiana Offshore Oil Port (LOOP), LA
- (8) Lake Charles, LA.
- (9) Sabine-Neches River, TX.

- (10) Galveston Bay and Houston Ship Channel, TX.
- (11) Corpus Christi, TX.
- (12) Los Angeles/Long Beach Harbor, CA.
- (13) San Francisco Bay, San Pablo Bay, Carquinez Strait, and Suisun Bay to Antioch, CA.
- (14) Straits of Juan De Fuca and Puget Sound, WA.
- (15) Prince William Sound, AK.

<u>Inland area</u> means the area shoreward of the boundary lines defined in 46 CFR part 7, except in the Gulf of Mexico. In the Gulf of Mexico, it means the area shoreward of the lines of demarcation (COLREG lines) defined in §§ 80.740 - 80.850 of title 33 of the CFR. The inland area does not include the Great Lakes.

Marine transportation-related facility (MTR facility) means an onshore facility, including piping and any structure used to transfer oil to or from a vessel, subject to regulation under 33 CFR Part 154 and any deepwater port subject to regulation under 33 CFR part 150.

<u>Maximum extent practicable</u> means the planning values derived from the planning criteria used to evaluated the response resources described in the response plan to provide the on-water recovery capability and the shoreline protection and cleanup capability to conduct response activities for a worst case discharge from a facility in adverse weather.

Maximum most probable discharge means a discharge of the lesser of 1,200 barrels or 10 percent of the volume of a worst case discharge.

Nearshore area means the area extending seaward 12 miles from the boundary lines defined in 46 CFR part 7, except in the Gulf of Mexico. In the Gulf of Mexico, it means the area extending seaward 12 miles from the line of demarcation (COLREG lines) defined in §§ 80.740 - 80.850 of title 33 of the CFR.

Non-persistent or Group I oil means a petroleum-based oil that, at the time of shipment, consists of hydrocarbon fractions—

- (1) At least 50% of which by volume, distill at a temperature of 340 degrees C (645 degrees F); and
- (2) At least 95% of which by volume, distill et a temperature of 370 degrees C (700 degrees F).

Non-petroleum oil means oil of any kind that is not petroleum-based. It includes, but is not limited to, animal and vegetable oils.

Ocean means the offshore area and nearshore area as defined in this Appendix.

Offshore area means the area beyond 12 nautical miles measured from the boundary lines defined in 46 CFR part 7 extending seaward to 50 nautical miles, except in the Gulf of Mexico. In the Gulf of Mexico it is the area beyond 12 nautical miles of the line of demarcation (COLREG lines) defined in §§ 80.740 - 80.850 of title 33 of the CFR extending seaward to 50 nautical miles.

Oil spill removal organization means an entity that provides response resources.

Operating area refers to the Rivers and canals, Inland, Nearshore, Great Lakes, or Offshore geographic location(s) in which a facility is handling, storing, or transporting oil.

Operating environment refers to Rivers and canals, Inland, Great Lakes, or Ocean. These terms are used to define the conditions in which response equipment is designed to function.

<u>Persistent oil</u> means a petroleum-based oil that does not meet the distillation criteria for a non-persistent oil. For the purposes of this Appendix, persistent oils are further classified based on specific gravity as follows:

- (1) Group II specific gravity less than .85.
- (2) Group III specific gravity between .85 and less than .95.
- (3) Group IV specific gravity .95 to and including 1.0
- (4) Group V specific gravity greater than 1.0.

<u>Oualified individual(s)</u> means an English-speaking representative(s) of the facility identified in the plan, located in the United States, available on a 24-hour basis, familiar with implementation of the facility response plan, and trained in his or her responsibilities under the plan.

This person must have full written authority to implement the facility's response plan. This includes-

- (1) Activating and engaging in contracting with identified oil spill removal organization(s);
- (2) Acting as a liaison with the predesignated Federal On-Scene Coordinator (OSC); and

(3) Obligating, either directly or through prearranged contracts, funds required to carry out all necessary or directed response activities.

Response activities means the containment and removal of oil from the water and shorelines, the temporary storage and disposal of recovered oil, or the taking of other actions as necessary to minimize or mitigate damage to the environment.

Response resources means the personnel, equipment, supplies, and other capability necessary to perform the response activities identified in a response plan.

Rivers and canals means a body of water confined within the inland area that has a project depth of 12 feet or less, including the Intracoastal Waterway and other waterways artificially created for navigation.

<u>Spill management team</u> means the personnel identified to staff the organizational structure identified in a response plan to manage response plan implementation.

Substantial threat of a discharge means any incident or condition involving a facility that may create a risk of discharge of fuel or cargo oil. Such incidents include, but are not limited to storage tank or piping failures, above ground or underground leaks, fires, explosions, flooding, spills contained within the facility, or other similar occurrences.

Worst case discharge means

. ...:4

- (a) For facilities with above ground storage, not less than-
- (1) loss of the entire capacity of all tank(s)at the facility not having secondary containment; plus
- (2) loss of the entire capacity of any single tank within a secondary containment system or the combined capacity of the largest group of tanks within the same secondary containment system, whichever is greater; and
- (b) For facilities with below ground storage supplying oil to or receiving oil from the MTR portion, means the cumulative volume of all piping carrying oil between the marine transfer manifold and the non-transportation related portion of the facility. The discharge of each pipe is calculated as follows: the maximum time to discover the release from the pipe in hours, plus the maximum time to shut down flow from the pipe in hours (based on historic discharge data or the best estimate in the absence of historic discharge data for the facility) multiplied by the maximum flow rate expressed in barrels per hour (based on the maximum daily capacity of the pipe) plus the total line drainage volume expressed in barrels for the pipes between the marine manifold and the non-transportation-related portion of the facility.

(c) For a mobile facility it means the loss of the entire contents of the container in which the oil is stored or transported.

Section 6 Operating restrictions and interim operating authorization.

- (a) The owner or operator of each MTR facility to which this Appendix may be applied should submit a response plan meeting the guidelines of Sections 7, 8, 9, or 10 as appropriate, and Sections 11, 11.2, or 11.4, as appropriate of this Appendix. An MTR facility that is required to prepare a response plan under section 311(J)(5) of the FWPCA may not handle, store, or transport oil after February 18, 1993 unless a response plan has been submitted to the COTP.
- (b) After August 18, 1993, no MTR facility subject to section 311(j)(5) of the FWPCA may handle, store, or transport oil unless operating in full compliance with a submitted response plan.
- (c) In the absence of a significant difference between this NVIC and the final rule, each facility response plan determined by the COTP to meet the guidelines of this NVIC need not be resubmitted to the COTP when the final rule becomes effective. A response plan determined by the COTP to meet the guidelines of this NVIC will be accepted for 5 years or until a significant change occurs at the facility, as defined in the final rule.

Appendix L

Dredging Equipment

The following equipment is available at Egan Marine, Lemont, IL, in the event of a Group V oil spill at the Egan Marine Corporation facility:

30' x 120' Deck Barge, #101

195' x 35' Open Hopper Barge, MEM #394

Link Belt Crane, Lima 7035C with 2 buckets (1 or 2 cubic yards)

ATTACHMENT 5:

EMC Mobile Facility Emergency Response Plan

Egan Marine Corporation

Mobile
Facility
Emergency
Response
Plan

July 25, 1994

Table of Contents

Chapter	Subject	rage
	GENERAL INFORMATION AND INTRODUCT	ION
1	Table of Contents	2-3
1	Record of Changes	4
1	Owner Certification.	5
l	Areas of Operation (COTP Zones)	6
	NOTIFICATION AND PROCEDURES	
2	Notification Checklist	
2	Procedures for Notifying the Qualified Individual	8-9
2	Notification Procedures	
2	Notification Requirements	
2	Reporting Format (IMO A648 (16))	12-13
	SHIPBOARD SPILL MITIGATION	
3	Definitions of Spill Volumes	14-19
3	Operational Spill Prevention	20-21
3	Collision	22
3	Fire and Explosion.	23-24
3	Excessive List	25
3	Record Keeping and Sampling.	26
	SHORE-BASED RESPONSE ACTIVITIES	·
4	Qualified Individual's Responsibilities	
4	Transfer of Responsibility	28
4	Coordination with Federal OSC	29
4	Spill Management Team.	30-31
	LIST OF CONTACTS	
5	Owner and Operator	
5	Qualified Individuals	33
5	P&I Insurance Representative	34
5	H&M Insurance Representative	35
- 5	Surveyors	36
5	General Contractors/Identified Resources	37-39

TRAINING PROCEDURES

6	Training Program.	40
6	Records of Training	41
	\$44	·
	DRILL PROCEDURES	
7	Drills	42
7	Record of Drills.	43
	PLAN REVIEW AND UPDATE PROCEDURES	
8	Update Procedures	44.
8.	Post-Incidence Review	
	GEOGRAPHIC INFORMATION	
9	Listing of all COTP Zones	46
9	Local NRC Offices.	47
	VESSEL-SPECIFIC INFORMATION	
10	List of Cross Referenced Information.	48
10	Safety/Hazards for Cargo/Fuel	

RECORD OF CHANGES

Revision No.

Date:

Date:		Approved by:				
				·		
						·
	,					· · · · · ·
					· · · · · · · · · · · · · · · · · · ·	
				,		

I, Dennis Egan, hereby certify that this plan meets the applicable guidelines.

Dennis Egan President Egan Marine Corporation

AREAS OF OPERATION

COTP ZONES:

Chicago
Detroit
Duluth
Milwaukee
Sault Ste. Marie
Toledo
Grand Haven

NOTIFICATION CHECKLIST

This checklist and all emergency procedures are to be kept at the transfer site.

The following notifications must be made, if the vessel has an oil spill, substantial threat of an oil spill, fire, explosion, grounding, collision, or any other incidence which threatens the safety of the vessel, its compliment and surroundings:

U.S. Coast Guard National Response Center	T	1-800-424-8802
Egan Marine Corporation		708-739-0947
Qualified Person Dennis Egan		708-972-0948
Heritage Remediation - Chicago D		708-378-1600 1-800-487-7466

Procedures for Notifying the Qualified Individual

Qualified Individual Dennis Egan can be notified by one of the following methods on a 24 hour on-call basis:

Home708-972-0948Car708-975-6900Pager708-659-6900

Also, contact with EMC office 708-739-0947 is required to facilitate communications to Dennis Egan.

The following notifications must be made, if the vessel has an oil spill, substantial threat of an oil spill, fire, explosion, grounding, collision, or any other incidence which threatens the safety of the vessel, its compliment and surroundings:

Whom To Notify:

Made By:

U.S. Coast Guard

Master {Within 30 Minutes}

National Response Center Phone: 1-800-424-8802 Or: 1-202-267-2675

Egan Marine Corporation

Master

PO Box 669

Lemont, Illinois 60441 Bus Phone: 708-739-0947 Home Phone: 708-972-0948 Home Phone: 708-972-1116

Dennis H. Egan

Master

Home: {708} 972-0947 Page: {708} 659-6900 Car: {708} 975-6900

Daniel T. Egan {Alternate #1}

Master

Home: {708} 972-1116 Page: {708} 659-6907 Car: {708} 975-6917

Barre Nall {Alternate #2}

Master

Home: {815} 722-8516 Page: {708} 659-6908 Car: {708} 975-6908

Robin K. Chanda {Alternate #3}

Master

Home: {815} 838-6660 Page: {708} 659-6904 Car: {708} 975-6904

Local Requirements

Master or Qualified Individual

Oil Spill Resources

Master or Qualified Individual

{Within 30 Minutes}

Response Management Team

Qualified Individual

NOTIFICATION PROCEDURES {Spill or Potential Spill}

- 1. Personnel checklist in order of contact priority:
 - A. Dennis H. Egan
 - B. Daniel T. Egan
 - C. Barre Nail
 - D. Robin K. Chanda
- 2. Shore personnel shall:
- · A. Notify EMC Office
 - B. Notify qualified individual
- 3. EMC Office or qualified individual shall notify:
 - A. U.S. Coast Guard Emergency Response Center
 - B. OSRO if deemed necessary
- 4. Notification shall be made by:
 - A. Cellular phone.
 - B. Land line phone if available.
 - C. Marine radio.
- 5. The following information should be included in all notifications:
 - A. Vessei name.
 - B. Tank barge name, country of register, and official number.
 - C. Time of incident.
 - D. Location of incident.
 - E. Type of hazardous material involved.
 - F. Nature of incident {e.g., grounding, collision, etc...}
 - G. Estimate of hazardous material discharged or threat of discharge.
 - H. Weather conditions on scene.
 - L. Action taken and action to be taken by persons on the scene.
 - J. Injuries and/or fatalities.

NOTIFICATION REQUIREMENTS

Accident Reports

The initial report must reach the following within 30 minutes of the discovery of any discharge:

- 1. U.S. Coast Guard National Response Center
- 2. Qualified Individual
- 3. Contracted Clean-Up Resources
- 4. Owner
- 5. Any local state requirements as per Chapter

It is extremely important for the initial report to contain an estimate of spilt volume, to determine call-out of resources, i.e.:

- a. less than 50 barrels {average most probable spill};
- b. more than 50 barrels but less than 1,000 barrels {maximum most probable spill}; or
- c. more than 1,000 barrels, with an indication of actual or potential size of spill.

REPORTING FORMAT

All reporting shall follow IMO's reporting format as outlined below. The report shall be made in writing, if possible. If a verbal report is made, make sure that the name {and rank} of person receiving report is logged.

Reporting Format:

Label	Function	Explanation
Name	Addressee	To whom the message should be delivered.
MP	Type of Report	Marine Pollution Report.
Other	•	Any Other Report.
A	Vessel	Name and nationality.
В	Date and Time	A 6-digit group giving day of month {first two of Event digits}, hours and minutes {last four digits}, plus time zone used.
c	Position	River mile point or a 4-digit group giving latitude in degrees and minutes suffixed with N or S, and a 5-digit group giving longitude in degrees and minutes suffixed with E or W.
D	Position	True bearing {first 3 digits} and distance {state distance} in nautical miles from clearly identified landmark {state land-mark}.
M	Radio Communications	State in full names of stations and frequencies guarded.
N	Time of Next Report	Date/time group expressed as in {B}.
0	Maximum Present Draft in Feet	Draft of vessel in feet and inches.
P	Cargo On Board	Correct technical name of goods. UN number. IMO hazard class. Name of consignee or consignor. Quantity and condition of cargo. Note: can be included in {r} as relevant.

REPORTING FORMAT (Continued...)

Label	Function	Explanation
Q	Defects, Damage Deficiencies Other Limitations	Condition of vessel as relevant. Ability to transfer cargo, ballast, and fuel.
R	Description of Pollution or Possible Overboard Discharge	Correct technical name of cargo. UN number. IMO hazard class. Name of consignee or consignor. Total quantity on board, and quantity lost. Whether loss is continuing. Movement information of lost cargo. Cause of loss.
S	Weather Conditions	Brief details of weather and sea conditions prevailing.
т	Ship's Representative and/or Owner	Name and number for vessel's Qualified Individual and full name, address, and number for owner, operator, manager or charterer.
x	Miscellaneous	Action being taken with regards to the discharge and movement of the ship. Assistance or response which have been requested or which have been provided by others. Any other vessels involved. If the report is made from an assisting vessel, state action planned.

DEFINITION OF SPILL VOLUMES

For planning purposes, the following volumes are used based on OPA 90 regulations:

Average Most Probable:

50 Barrels

Maximum Most Probable:

1,000 Barrels

Worst Case Discharge:

Group 1 Oil: 10,000 Barrels

Group 2 Oil: 10,000 Barrels

Group 3 Oil: 10,000 Barrels Group 4 Oil: 10,000 Barrels

Group 5 Oil: 10,000 Barrels

WORST CASE DISCHARGE NON-PERSISTENT OIL {OPA GROUP 1}

Definition:

Non-persistent or Group 1 oil means a petroleum-based oil that, at the time of shipment, consists of hydrocarbon fractions:

- { i} At least 50% of which by volume, distills at a temperature of 340 degrees Celsius; and
- (ii) At least 95% of which by volume, distills at a temperature of 370 degrees Celsius.

WORST CASE DISCHARGE PERSISTENT OIL {OPA GROUP 2}

Definition:

Persisten oil Group 2 means:

A petroleum-based oil that does not meet the distillation criteria for non-persistent oil {Group 1}, and has a specific gravity less than 0.85.

WORST CASE DISCHARGE PERSISTENT OIL {OPA GROUP 3}

Definition:

Persistent oil Group 3 means a petroleum-based oil that does not meet the distillation criteria for non-persistent oil {Group 1}, and has a specific gravity between 0.85 and less than 0.95.

WORST CASE DISCHARGE PERSISTENT OIL {OPA GROUP 4}

Definition:

Persistent oil Group 4 means a petroleum-based oil that does not meet the distillation criteria for non-persistent oil {Group 1}, and has a specific gravity between 0.95 and 1.0.

WORST CASE DISCHARGE PERSISTENT OIL {OPA GROUP 5}

Definition:

Persistent oil Group 5 means a petroleum-based oil that does not meet the distillation criteria for non-persisten oil {Group I} and has a specific gravity greater than 1.0.

Group 5 spills would be identified and cleaned up by dredging.

Dredging contractors are listed below:

Evansville Materials, Inc. PO Box 3596 900 N.W. Riverside Drive Evansville, IN 47734 {812} 424-5583

M.T. Epling Company 1725 Eastern Avenue Galipolis, OH 45631 {614} 446-2742

Diamond Services Corporation 503 So. DeGravelle Road Amelia, LA 70340 {504} 631-2187

OPERATIONAL SPILL PREVENTION

- L List of products to be transferred to or from the vessel.
 - A. For unloading operations, consult the barge manifest for the name or names of the chemicals to be unloaded. See the Cargo Information Cards on board the vessel to obtain health, fire, and personnel safety information. Assume all chemicals are oils or hazardous materials and follow the transfer procedures outlined below unless specifically instructed that the chemical is a non-oil and non-hazardous.
 - B. For loading operations, consult loading plans or other instructions issued by the shore facility operator to determine the name or names of the chemicals to be loaded. Obtain information on safety, fire, and personnel safety from Cargo Information Cards or shore facility personnel before beginning transfer operations. As in Part A, assume all chemicals are oils or hazardous materials unless instructed otherwise.
- II. Each operator and/or tankerman must be thoroughly familiar with the location of each valve, pump, control device, vent, and overflow.
- III At no time during the transfer operations will there be less than one responsible person on duty unless authorized in writing by the COTP.
- IV The certified tankerman assigned shall be in charge and responsible for the safe transfer of the cargo. His duties include, but are not limited to, the following:
 - 1. Check and sign the DECLARATION OF INSPECTION prior to transfer.
 - 2. Proper connection of the grounding cable.
 - 3. Proper and tight connection of the header line hoses.
 - 4. Checking the bow and stern rakes and all void spaces, making sure that they are dry and free of product and water.
 - 5. Maintaining proper security of the barge while it is under his cognizance.
 - 6. Taking all precautions to guard against the accidental discharge of oil.
 - Should an accidental discharge occur, stop transfer operations, and report the incident to the proper authorities IMMEDIATELY.
 - V. During transfer operations, the mooring lines will be checked and adjusted as necessary at half hour intervals. In situations where moored barges are subject to

OPERATIONAL SPILL PREVENTION (Continued...)

surging due to passing vessels, or where high wind conditions exist, additional mooring lines will be used to insure a safe mooring.

- VI. In the event of an emergency during unloading operations, the transfer of cargo can be stopped by pulling the remote shutdown cable. The remote engine shutdown station will be approximately 50 feet from the engine and marked by a sign indicating its location. Pull the "D" ring to shutdown the engine. Familiarize yourself with the location of the remote engine shutdown before starting the engine. Failure of a transfer hose or shore pump during loading will automatically stop the flow of oil from the barge. During transfers, approved two-way radios must be used by the tankerman-in-charge for communications purposes.
- VII. In the case of a single cargo loading, tanks will be topped off according to their distance from the loading header. Tanks furthest from the leading header will be topped off first and the tanks nearest the loading header will be topped off last. The flow of oil while topping off will be controlled by the compartment valve of the compartment being finished. Definite agreement must be reached with the shore personnel concerning the rate of flow during the loading, while topping off, and for the final shutdown. Be sure that the tanks are not topped off so full that the maximum or desired draft is exceeded, and so that there is enough space to allow for the expansion of the product.
- VIII. As each tank is topped off, the compartment valve should be closed and remain closed until the system is lined up for discharge at the Off-Load Port. After a tank has been finished it should be checked at frequent intervals to insure that the valve is not leading which could result in an overflow. After the loading is complete, close the loading valve and the header line valve.
- IX. Should an accidental discharge of oil on the water occur, notify the National Response Center, 1-800-424-8802 (Toll Free) immediately. A fine can result from failure to notify the National Response Center in a timely manner. Please call Egan Marine Corporation, 1-708-739-0947 and ask for the Barge Dispatcher on duty.
 - X. During transfer operations, each cargo tank shall be vented through an open ullage, portable high level vent, or return vent depending on EPA and USCG requirements. During loading and venting through high level vent or return vent, the emergency overfill valve for that tank shall be in open position. Loading rates must be controlled to prevent opening of PV valves when high level or return venting is employed. Emergency overfill valves must be closed at all times other than during actual loading operations. Following completion of the transfer of material, all cargo tank openings must be closed and secured.

COLLISION

Should the vessel be involved in a collision with another vessel, the Master shall as soon as

possible identify the extent of damage to his own vessel. When a collision occurs, the FIRE ALARM must be sounded immediately for the personnel to muster at their designated positions in case of fire breaking out. The following check list should assist the Master in assessing the situation....Are any tanks penetrated above or below the waterline?If vessel's are dead in the water and interlocked, what is the most prudent, to stay interlocked or separate? Is there any oil spill at present - small or large? Will a separation of interlocked vessels create a larger oil spill than if the vessels stay interlocked?If there is an oil spill, will the separation of the vessels cause sparks that can ignite the oil or other flammable substances leaked out from the vessels?Are the vessels of a greater danger to other traffic in the area if they are interlocked than if separate?What is the danger of either vessel sinking when separating, if vessels have sustained serious damage to tanks below the waterline due to reduced buoyancy? If the vessels are separated, how is the maneuverability of own vessel?If separation of vessels take place, alter course to bring vessel upwind of any oil slick.Shut down all non-essential air intake(s).Isolate penetrated tank by hermetically closing the tank if possible.

FIRE AND EXPLOSION

Should an explosion and a fire occur on board, the vessel's crew will, under the leadership

of the Master, initiate the necessary steps to bring the situation under control.
Such steps will be
Find out immediately where the fire/explosion has taken place.
Try to determine the extent of damage, and if anyone of the compliment is injured or dead.
Deploy the members of the vessel's crew to the position(s) deemed best for fighting the fire.
Use all available means to fight the fire such as:
 {a} Water with spray nozzles {b} Water cannons {c} Dry chemical extinguisher {d} CO2 Extinguishers
Try to contain the fire and prevent it from spreading to other parts of the vessel.
The occurrence shall be reported to the U.S. Coast Guard, informing them about the situation and if the fire cannot be controlled, request outside assistance from shore based assets.
In case of fire and explosion, the following priorities exist when the Damage control measures are initiated
Rescue lives.
Limiting the damage to vessel and cargo.
Preventing environmental pollution.
When alerting the local authority and firefighting contractors, report as per IMO-format (Chapter 2), but most important give:
Name of vessel and nationality.
Location.

FIRE AND EXPLOSION (Continued...)

.....Type of incident and cargo on board.

....If anyone is injured or missing.

.....Any oil spill or threat of spill.

EXCESSIVE LIST

Should the vessel for some reason suddenly start to list excessively during discharge or loading operations, tank cleaning or bunkering, all ongoing operation must be stopped immediately the cause can be determined.

The Master shall inform the terminal {if applicable} by way of agreed Emergency Signal procedure.

The Master shall try to determine the reason for the excessive list, and take steps to rectify the situation.....

-The vessel's Oil Pollution Prevention Team be called out.
-Soundings/ullage to be taken in all tanks.
-Cargo, bunker, and ballast pumps to be made ready.
-If there is reason to believe that the list may cause an oil spill, notify as per Chapter 2.
-When or if the situation is brought under control, inform as necessary.

RECORD KEEPING AND SAMPLING

The Master is responsible for keeping record of events whenever there is a spill or a substantial threat of a spill. All relevant information shall be entered, including but not limited to:

- {1} When, where and what happened.
- {2} Notification made and to whom.
- {3} Efforts made by crew.
- {4} Assistance received and by whom.
- {5} Transfer of authority to Qualified Individual.

Only facts should be logged. Do not speculate as to what has happened!

If possible take pictures and/or video of important factors documenting events.

All spilled oil shall be sampled, safety permitting. Any oil observed on the water, while vessel is at anchor or berth, shall be sampled if possible. Samples shall be properly marked, with date and location, and sealed, and always be made in duplicate. Samples will be most valuable if the sampling is authenticated by someone not part of the crew, i.e., U.S. Coast Guard, Harbor Master, terminal personnel or pilot. One sample may be turned over to the U.S. Coast Guard, if requested, or to a duly authorized owner's representative {Qualified Individual}.

QUALIFIED INDIVIDUAL'S RESPONSIBILITIES

The Primary Qualified Individual(s) are:

Dennis H. Egan

The Alternate Qualified Individual(s) are:

Daniel T. Egan Barre Nall Robin K. Chanda

The above named individuals are representatives of Egan Marine Corporation and additional Qualified Individuals' services are available through that company.

The Qualified Individual(s) have the owner's authority to:

- {a} Activate and engage in contracting with required oil spill removal organization{s};
- {b} Act as liaison with predesignated Federal On-Scene Coordinator {FOSC}; and,
- (c) Obligate, either directly or through prearranged contracts, any funds required to carry out all required or directed oil response activities.

The Qualified Individual(s) are also engaged by the owner to liase with the U.S.C.G. and contract resources during non-emergency times. This includes:

- (a) Quarterly checkout of contract resources, including training and equipment requirements.
- (b) Logkeeping of drills and training sessions involving any contract resources; and,
- (c) Inform the owner of changes that may effect this response plan.

TRANSFER OF RESPONSIBILITY TO SPILL MANAGEMENT TEAM

The Master has the responsibility of implementing this plan as required until such responsibility is formally transferred to the Qualified Individual.

Once the Qualified Individual is notified, and has confirmed such notification to the Master, the Qualified Individual is in charge of all shore based response.

The Master will remain responsible "on scene" until he received notification by the Qualified Individual that he is relieved of such responsibility. This will take place when the Qualified Individual has arrived at the scene, or established a response center at or near the scene. The Qualified Individual shall notify the Master, the Federal OSC and the Owner at that time.

Transfer of responsibility to the Qualified Individual does not relieve the Master from his responsibility for the vessel, its complement and cargo. Furthermore, the Master shall continue his logkeeping and any activities required on board to ensure the safety of the complement, vessel and its cargo, as well as taking all actions required to minimize the effects of any incident.

Transfer of responsibility to the Spill Management Team should be conducted as for transfer between the Master and the Qualified Individual as outlined above.

COORDINATION WITH THE FEDERAL OSC

ROUTINE

The Qualified Individual shall maintain regular contact with the Federal OSC for all areas covered by this plan, and thereby establishing a pre-incident relationship.

DURING SPILLS

The Qualified Individual shall coordinate any response efforts with the Federal OSC.

It is important to recognize that the Federal OSC is the "auditor" of whatever actions are taken, and if he is not satisfied, he may "Federalize" the spill. This may put the owner in a situation of "gross negligence", and therefore unlimited liability.

The Qualified Individual shall keep the Federal OSC updated on developments, by providing twice daily reports, or as mutually agreed as work progresses.

. 4

The Qualified Individual shall permit the Federal OSC free access to all logs and reports, and include him in any response management meetings that may be called.

SPILL MANAGEMENT TEAM

The following management resources are available and will be mobilized as necessary:

Position	Function
Appropriate Government Agency Representative, On Scene Coordinator	In charge of all field activities, directing all cleanup activities.
Dennis H. Egan, Qualified Individual	Approve all actions, specifically those that go beyond the content of this response plan.
Donald Schlyer, Legal/Attorney	Advise on legal matters. Responsible for assuring that the owner fulfill his obligations under the relevant laws.
Robin K. Chanda, Finance	Approve and assure payment of all obligations.
Robin K. Chanda, Public Relations	Issue press releases for approval by owner's representative. Arrange interviews and field trips for the press. Assure that the press and media is correctly informed.
Barre Nall, Communications	In charge of all field communication and logging of same. Arrange for all required communication systems.
Lee Ann Angeloni, Secretarial Services	Arrange all written documentation and necessary facilities for same.
Joe Rousseau Safety	Independent position to assure that all safety regulations (including OSHA) are in compliance.
Barre Nall, Purchasing	In charge of arranging all necessary equipment and services.
Barre Nail, Manager	Contractor's manager in charge of contracted Field resources.

Dennis Egan, EMC Owner, will head the response team. His experience in spill response places him as the natural leader of any possible spill situation.

SPILL MANAGEMENT TEAM (CONTINUED...)

Don Schlyer is EMC's in house attorney and has represented this company many times. He is experienced in dealing with other members of the team and providing legal advice on adherence to laws.


Robin Chanda, EMC Comptroller and Vice-President, will arrange for payment of all obligations, as she does on a continuing daily basis for the company. All press contacts will be directed through her.

Barre Nall, EMC Marine Operations Manager, will arrange for field communications and logging of same. He handles he communications aspects of the company as a regular job function. He will also be in charge of arranging for necessary equipment and services, including contracted resources.

Lee Ann Angeloni, EMC Bookkeeper, will handle all written documentation.

Joe Rousseau, not an EMC employee, will assure that all safety regulations are followed during operations. He has functioned in this capacity in the past for EMC.

Organizational Chart

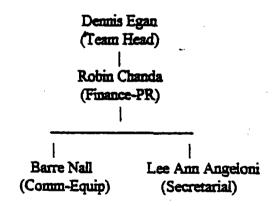

Staff Position - Donald Schiyer (Legal) Staff Position - Joe Rousseau (Safety)

Subordinate Teams will be comprised of EMC personnel who have prior experience in spill activities.

OWNER AND OPERATOR

Vessel Owner.

Egan Marine Corporation PO Box 669

Lemont, Illinois 60441

Business Phone:

Fax:

{708} 739-0947

{708} 739-4455

Dennis H. Egan **Primary Contact** {708} 972-0948 {Home}

{708} 659-6900 {Page}

{708} 975-6900 {Mobile Phone}

INSURANCE REPRESENTATIVES P & I

Egan Marine Corporation's insurance representative is:

Rollins Hudig Hail 100 North Broadway St. Louis, MO 63102

{314} 231-0100	Main
(800) 325-7028	Toll-Free
{314} 231-0423	Fax
(314) 231-0492	24-Hour Marine Department

Anthony M. Bono, Contact Vice President

INSURANCE REPRESENTATIVES H & M

Egan Marine Corporation's insurance representative is:

Rollins Hudig Hull 100 No. Broadway St. Louis, MO 63102

{314} 231-0100	Main
{800} 325-7028	Toll Free
{314} 231-0423	Fax
{314} 231-0492	24-Hour Marine Department

Anthony M. Bono, Contact Vice President

SURVEYORS

Independent Marine Associates, Inc. PO Box 122 Lemont, IL 60439

 {708} 257-6110
 Main

 {708} 257-8916
 Fax

C. Baxter, Jr. and Associates 906 Azalea Road Mobile, AL 36693

{205} 660-9572 Main

GENERAL CONTRACTORS

This facility will contract with the below listed company to provide response to all classes of spills in all areas where this facility will operate:

Name:

Heritage

Address:

319 Marquette Drive

Romeoville, IL 60441

24 Hour Phone:

1-800-487-7455

Fax:

{708} 378-2200

OTHER CONTRACTORS (IDENTIFIED RESOURCES)

The facility's Qualified Individual(s) maintain a complete listing of other available oil spill clean up contractors. It is the Qualified Individual's duty to call out any of these and requests should be made through him.

Best Environmental, Inc. PO Box 576 Channahon, IL 60410 {815} 725-1554 Main

C.E.E. Environmental Services PO Box 1352 Paducah, KY 42002-1352 {502} 898-4052 Main {502} 898-4648 Fax

OTHER CONTRACTORS

Ridel Environmental Services, Inc. 18207 Edison Avenue Chesterfield, MO 63005 {800} 334-0004

Marine Pollution Control 8631 W. Jefferson Detroit, MI 48209 {313} 849-2333

Clean Harbors 11800 So. Stony Island Avenue Chicago, IL 60617 {312} 646-6202

TRAINING PROGRAM

The company training program is based on standards set by the statuary training requirements for the crew with additional training in oil pollution control as discussed in this plan.

Company Officers:

Receive initial training in the use of all parts of this plan that effect them and their crew, and have the responsibility of training their crew with "hands-on" operation on board. The drill program {Chapter 7} constitutes the continuous

part of the training.

Crew:

The crew receive their training as part of their on board duties. Specific training in oil pollution control include the use of the on board equipment.

Qualified Individual(s):

The Qualified Individual (s) are required to be trained in the OSHA standards for emergency response operation, and in the use of this response plan by participating in the drills required.

Staff

The company's staff which is a part of the response management team are selected based on their knowledge of the company and vessel, and their ability to handle crisis situations. By participating in the scheduled drills, they are also training in the specifics of this plan. Any member of the staff that will be involved in oil spill clean-up {except office administration} will have completed OSHA training.

Contracted Personnel:

All personnel that may participate in an oil spill clean-up effort are required to train and maintain that training as required by 29 CFR 1910.120 {OSHA}. The vessel's contracted responder has confirmed this in the contract for the resources.

RECORDS OF TRAINING

The records of training as detailed on Page 62 shall be maintained as follows:

On Board Training

Maintained by Log on Board

Management Training

Maintained by Safety Officer

Contracted Resources
Training {Summary}

Maintained by Qualified Individual

DRILLS.

This plan shall be exercised as follows:

Shore The owner shall exercise the plan involving the spill management team as "tabletop drills" either in full or in part, on an annual basis assuring that the entire plan has been exercised every three years. All drills shall be logged.

The oil spill removal contracted resources are required to be drilled yearly. It is the contractor's responsibility to conduct these drills but drills shall be reported to the Qualified Individual and he will maintain the records {log} for such drills.

RECORDS OF DRILLS

The record of drills as detailed on Page 42 shall be maintained as follows:

On Board Drills

Maintained on Log on Board

Management Drills

Maintained by Safety Officer

Contracted Resources

Maintained by Qualified Individual

UPDATE PROCEDURES

This plan can only be changed and/or updated with the written authorization of

Dennis H. Egan, Owner

All comments, corrections and suggestions shall be directed to the above named individual. All users of the plan have the responsibility of pointing out changes that effect the validity and/or use of the plan.

Major changes in the plan shall be made as soon as possible.

Any changes or updates which require a page change shall be accompanied with a new "Record of Changes" Page 3.

All approved changes shall be sent without delay to all registered copy holders as follows:

Copy Number	Location
1	Owner's Response Group
2	Safety Officer {In Charge of Update}
3	U.S. Coast Guard
4	Qualified Individual(s)
5	Qualified Individual(s)

POST-INCIDENCE REVIEW

Whenever the plan has been put in use in response to an incident, all parties directly involved shall comment on the effectiveness of the plan and its content. The responsible person shall review the comments and if needed make changes or suggest changes to the company's management.

After the completion of the review any changes made to the plan shall be logged in the Record of Changes on Page 3 of this plan.

COTP ZONES - IDENTIFICATION

The U.S. waters are divided into districts and Captain of the Port Zones {COTP} and the facility covered by this plan shall not operate in waters of a COTP zone that is not included in this plan {unless a one-time waiver has been obtained}. The following listing is from the definition of COTP zones found in 33CFR Chapter 1, Part 3. Contact numbers for each District can be found in Chapter 9.

 \mathcal{A}_{i}^{∞} .

COTP NAME

LOCATION

NINTH DISTRICT - CLEVELAND

Cleveland Cleveland, Ohio
Buffalo Buffalo, New York
Detroit Detroit, Michigan
Duluth Milwaukee Milwaukee, Wisconsin
Sault Ste. Marie Sault Ste. Marie, Michigan

Toledo Toledo, Ohio
Chicago Chicago, Illinois
Grand Haven Muskegon, Michigan

TO REPORT ALL OIL OR HAZARDOUS MATERIAL SPILLS OR ACCIDENTS, THE NATIONAL RESPONSE CENTER MUST BE NOTIFIED BY CALLING 1-800-424-8802 AROUND THE CLOCK

Local NRC Offices	Day Number	Night Number
*******	*********	*************
Carrya Christi	£12 999 21 <i>6</i> 2	Samo
Corpus Christi	512-888-3162	Same
Galveston	409-766-3687	Same
Houston	713-672-6639	Same
Port Arthur	409-723-6500	Same
Morgan City	504-384-2406	504-385-2936
Houma	504-868-5595	504-385-2936
New Orleans	504-589-6221	Same
Mobile	205-690-2286	504-690-2121
Baton Rouge	504-389-0271	504-589-6221
Memphis	901-544-3941	901-544-3912
St. Louis	314-539-3823	Same
Keokuk	319-524-7511	Same
St. Paul	612-240-3991	Same
Chicago	708-789-5830	Same
Pittsburgh	412-644-5808	Same
Cincinnati	513-684-3295	Same
Louisville	502-582-5194	502-582-6439
Paducah	502-442-1628	Same
Nashville	615-736-5421	Same
		•

CROSS REFERENCED INFORMATION

The following information is referenced in this response plan and may be located as follows:

	$T_{i}\eta_{i}$
**********	******************

	Location		
Item	Aboard	Home Office	Qualified Individual
Company/Facility Operation Manual	x	x	x
Vessel to Vessel Transfer Guide	x	x	X
Marpol 73/78	x	x	
33CFR Part 155		x	
Damaged Stability Data and Class		X	
Duty Contact List	X	x	x

SAFETY/HAZARDS FOR CARGO/FUEL

Safety and hazard information regarding the cargo and fuel carried on board the vessel is available on board vessel.

EGAN MARINE CORPORATION MOBILE FACILITY OPERATIONS MANUAL


OPERATIONS MANUAL EMC MOBILE FACILITY

PHYSICAL DESCRIPTION

Transfers will be between standard tanker trucks and tank barges. Two (2) ABC Fire Extinguishers will be on site during operations. Life preservers and jackets will also be on site and ready for use.

CONTROL STATION

The transfer control will be by the valve located at the rear of the truck tank.

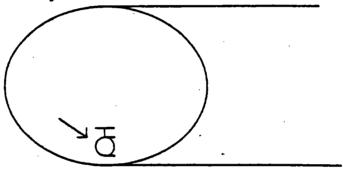

HOURS OF OPERATION

The facility will be capable of operation 24 hours a day, 7 days a week, as needed when barges or trucks are to be received.

SIZES; TYPES; NUMBER OF VESSELS

Individual barge size will be 7,500 Bbls to 50,000 Bbls. All units will be tank barges. Mobile facility will have the ability to deal with two barges at one time.

PHYSICAL CHARACTERISTICS

(i) The products transferred are Soybean Oil, Soapstock, and Tallow.

不成於 明明 中心 中海 。

· 1985年 1

- (ii) (a) The name of the products are:
 - 1. Soybean Oil Soyabean
 - 2. Soapstock Soapstock
 - 3. Tallow Tallow
 - (b) Description of the product is:
 - 1. pale yellow liquid
 - 2. pale yellow liquid
 - 3. dark yellow liquid
 - (c) The odor of the products are:
 - 1. weak odor
 - 2. weak odor
 - 3. waxy odor
 - (d) Heated tallow can burn eyes and skin. No other handling hazards.
 - (e) Follow normal safety procedures. Gloves needed for handling hot hoses.
 - (f) If leak or spill occurs, stop pumping. Contain spill. Scoop up or cover liquid with absorbent.
 - (g) For fire use foam, water, or carbon dioxide. Water may be ineffective, use for cooling exposed containers.

DOCKMAN DUTIES/PROCEDURES

The minimum number of men on duty on shore during pumping will be one (1), anytime loading/unloading is in progress. duties include pre-transfer and during transfer check of:

- 1. Vessel moorings (156-120-A)
- 2. Transfer hoses; length (156-120-B-C)
- 3. Transfer system; alignment (156-120-D)
- 4. Transfer hoses; blanked (156-120-E-F)
- 5. Transfer hoses; condition (156-120-I-J)
- 6. Transfer system; leak-free at facility (156-120-P)
- 7. Communication system and language fluency (156-120-Q-V)
- 8. Emergency shutdown procedures (156-120-R)
- 9. Sufficient personnel with training (156-120-S-T-U)
- 10. Agreement to begin transfer (156-120-W-X)
- 11. Transfer connections (156-130)

EMERGENCY TELEPHONE NUMBERS

Illinois EPA

The following telephone numbers are the people to contact in an emergency:

Egan Marine Corporation Dennis Egan Daniel Egan Barre Nall	708-739-0947 708-972-0948 708-972-1116 815-722-8516
Coast Guard NRC	800-424-8800
Coast Guard M.S.O.	708-789-5830 7:00am - 3:30pm 414-747-7190 4:00pm - 7:30am
Coast Guard Milwaukee	414-747-7181 3:30pm - 7:00am
Fire Department (Lemont)	911

160

COMMUNICATIONS

Continuous two-way voice communication between the person in charge of the vessel transfer and the person in charge of facility transfer is via portable radio device. Radios are intrinsically safe as defined in 46 CFR 110.15-100(i) and meet class I, Group D requirements as defined in 46 CFR 111.80.

DRIP AND DISCHARGE COLLECTION

Collection of product discharge and drip will be by a five (5) gallon bucket located under the valve on the truck tank.

EMERGENCY SHUTDOWN SYSTEMS

During truck to barge transfers, product movement will initially be by portable pump and will be continued by gravity. Should an emergency arise, transfer can be halted by closing the discharge valve on the truck.

During barge to truck transfers, product movement will be by barge cargo pump. Should an emergency arise, transfer can be stopped by use of the emergency shutdown cable located on the barge.

CONTAINMENT EQUIPMENT

Absorbent material will be available to personnel for small spills on dock or barge. This will include individual 16 1/2" x 20" absorbent pads, each capable of 32 oz. of absorption and two (2) 8" x 10' sections of absorbent boom, for immediate containment of any spillage into canal. Containment equipment for immediate use will be located at an area within 5 minutes of deployment. In the event of a possible release of product into waterway, one section of 8" x 10' boom would be placed at the front and rear of barge, extending from barge to dock face wall. This would prevent product from moving up or down stream. Absorbent pads would then be used to absorb product, until professional remediators are on site. Heritage is located all through the Chicago area for quick response.

FIRE EXTINGUISHERS

Two (2) CO₂ fire extinguishers will be on site and will be readily available to personnel. To use them, pull the pin and direct the hose to the base of the fire. Squeeze the handle to release the contents.

MAXIMUM SYSTEM PRESSURE

The maximum system pressure is rated 150 psi.

"PROCEDURES FOR":

Transfer of product will not commence until each person in charge designated under 154.710 and 154.700 has filled out and signed the declaration of inspection form described in paragraph (c) of 156.150. No person in charge may sign declaration unless he or she has determined by inspection, and indicated by initialing in the appropriate space on form. Once transfer is ready to commence, and each person on vessel and shore are ready to receive product, valve on truck is opened and transfer is initiated. Facility and vessel keep constant contact via two-way radio.

After product transfer is complete, tank truck valve is closed and is evacuated of any product while still connected to barge header. Once emptied of product, hose is disconnected from barge header and immediately blanked while over barge spill pan.

TANK TRUCK OIL TRANSFER PROCEDURES

杨婧俊有到一一一 上现的安徽的人

- 1. Personnel Required This tank truck is to be attended by one qualified person and a barge side counterpart who is a U.S.C.G. Licensed Tankerman with appropriate grade as required by the U.S.C.G. Captain of the Port.
- 2. Duties The assigned qualified person shall be in charge and:
 - A.) Make or supervise all cargo connections connecting to the tanker.
 - B.) Make frequent checks and perform minor maintenance on the transfer pump and engine when in use. This is to include but not limited to:
 - 1.) Pump packing
 - 2.) Engine oil and fuel levels, water temperature, oil pressure, RPM, etc.
 - C.) Ensure truck / tanker has brakes locked / engaged and / or tires chocked
- 3. Voice communications between barge tankerman and shore personnel should be maintained at all times.
- 4. Topping-off tanker: No tanker is to be loaded higher than bottom of hatch trunk lip.
- 5. Emergency Follow Emergency Responce Plan posted on tanker: IN CASE OF DISCHARGE OR THREAT OF DISCHARGE
 - 1. PROTECT HUMAN LIFE
 - 2. CONTACT THE EGAN MARINE OWNER / OPERATOR / QUALIFIED INDIVIDUAL AT 1-708-739-0947
 - 3. CONTACT THE NATIONAL RESPONCE CENTER AT 1-800-424-8802
 - 4. STOP AND / OR CONTAIN DISCHARGE—IF IT CAN BE DONE WITHOUT ENDANGERING HUMAN SAFETY.

TANK TRUCK DISCHARGE PROCEDURE CHECKLIST

	Fill out and sign the Declaration of Inspection.
	Ensure tractor / tanker has brakes locked / engaged and / or tires chocked.
	Open top hatch or other suitable method of venting.
	Connect the hose to the tankers discharge piping using proper gasket and fastening components.
	Check communications system to make sure instructions can be understood clearly by everyone before commencing the transfer.
	While transfer is progressing - Stay alert for leaks at connections and position of hose.
	Upon completion of transfer close all valves, disconnect the hose and blind / cap accordingly using proper gasket and appropriate fastening components.
<u>·</u>	 Before embarking, the tanker should be secured as follows: A.) Dog all hatches, vents, etc. B.) Drain and wipe clean as necessary all discharge containment systems. C.) Secure booms, cargo hose and any other gear that is not a
	permanent part of the tanker.

TANK TRUCK LOADING PROCEDURE CHECKLIST

	Fill out and sign the Declaration of Inspection.	
	Ensure tractor / tanker has brakes locked / engaged and / or tires chocked.	
	Open top hatch or other suitable method of venting.	
	Connect the hose to the tankers loading piping system using proper gasket and fastening components.	F
	Check communications system to ensure instructions can be understood clearly by everyone before commencing the transfer.	
	While transfer is progressing - Stay alert for leaks at connections are proper position of hose.	ıd
<u>·</u>	Upon completion of transfer close all valves, disconnect the hose a blind / cap accordingly using proper gasket and appropriate fastenic components.	
	Before embarking, the tanker should be secured as follows: A.) Dog all hatches, vents, etc. B.) Drain and wipe clean as necessary all discharge containment systems.	
٠.	C.) Secure booms, cargo hose and any other gear that is not a permanent part of the tanker.	

EMERGENCY PHONE NUMBERS

In the event of an emergency, cellular communication will be used to contact Egan Marine Corporation office, followed by Coast Guard, NRC, and fire departments if need be.

CONTAINMENT PROCEDURE

In case of a spill in the water immediate containment would be handled by EMC and consists of the following:

Initial containment of any spillage into the canal would consist of placing sections of absorbent boom at the front and rear of vessel, extending from dock face wall to vessel. Absorbent pads and pillows would be used to absorb product until professional remediators arrive on site. Simultaneously the following contacts would be made as needed:

1 - Coast Guard National Response Center	800-424-8800
2 - Coast Guard 7:30am - 4:00pm	708-789-5830
4:00pm - 7:30am	414-747-7190
3 - Egan Marine Corporation	708-739-0947
4 - Heritage	708-385-0515
5 - Fire department (if required)	911
6-EPA	708-345-9780

HAZARDOUS MATERIAL POLLUTION LAWS

Federal Regulations prohibit the discharge of oil in harmful quantities in or on any waters of the United States. Harmful quantity has been defined as sufficient oil to create a sheen. Presently, penalties up to \$10,000.00 are assessed by the Coast Guard for any person, firm or corporation who causes a discharge. Included in this act, is the provision for the Coast Guard to conduct cleanup action and later bill the polluter if the polluter is slow or delinquent in the cleanup of a pollution incident.

Other provisions of this Act include the extension of Coast Guard jurisdiction. That is, oil spilled on any waters of the United States is subject to this Act and the Coast Guard's enforcement of the Act. Also, there is a referral provision for possible criminal prosecution for any person who fails to immediately notify the Coast Guard of a spill. This is, of course, providing the person is in charge of the activities that produced the spill.

State Laws pertaining to water pollution are enforced by the Illinois Environmental Protection Agency. Although the State of Illinois claims jurisdiction over all Illinois rivers, streams and waterways relative to discharging of polluting materials to these waters, they have not attempted to duplicate the efforts of the U.S. Coast Guard of the Metropolitan Sanitary District in the surveillance of oil transfers and the arrest and prosecution of those accused of spilling oil or other hydrocarbon liquids accidentally or otherwise to the Sanitary and Ship Canal. They are more concerned with discharges which affect the quality of water as opposed to spillages which have only a temporary effect.

The Metropolitan Sanitary District of Greater Chicago has in its books a Sewage and Waste Control Ordinance. This ordinance is to provide for abatement and prevention of pollution by regulating and controlling the quantity and quality of sewage and industrial wastes admitted to or discharged into the sewage systems, sewage works and natural outlets under the jurisdiction of the Metropolitan Sanitary District of Greater Chicago. Hereinafter to be known as "The Sewage and Waste Control Ordinance". Approved and adopted by the board of trustees of the

Metropolitan Sanitary District of Greater Chicago on September 18, 1969.

This ordinance, promulgated by the Metropolitan Sanitary District of Greater Chicago, hereinafter called the Sanitary District, has as it purpose the protection of the public health and safety by abating and preventing pollution through the regulation and control of the quantity and quality of sewage and industrial wastes admitted to or discharged into the sewage systems, sewage works, waters, water courses and natural outlets under the jurisdiction of the Sanitary District.

Whoever fails to comply with an order of the Sanitary District issued in pursuance of this ordinance, shall be fined \$100.00. Each day's continuance of such failure is a separate offense. The penalties so imposed are recoverable by the Sanitary District upon its suit, as debts are recoverable at law.

PROCEDURES FOR LIGHTING

Portable lighting will be directed such that it does not interfer with water traffic. Lights will be pointed away from the river whenever possible. When not possible, shutters will be used to direct the light in a manner so that boats will not be hingered.

PERSONS IN CHARGE

- (a) No person may serve, and the facility operator may not use the services of a person, as person in charge of facility transfer operations unless:
 - All persons in charge have been designated so by facility operator.
 - All persons will have in excess of 48 hours of experience in transfer operations.
 - Persons in charge know the hazards of each product to be transferred; rules in parts 145, and 156; facility operating procedures as described in operations manual; vessel transfer systems, in general; each facility transfer system to be used; local discharge reporting procedures; the facility's contingency plan for discharge, reporting, and containment.

Persons In Charge:

Dennis Egan
Daniel Egan
Barre Nall
Joseph Rogers
Robert Wondowlowski
John Harmon
Andrew Chanda
William Rodgers
Tom Renardo, Sr.

Informational records of all Persons In Charge are available at the Egan Marine Corporation office.

Drills

Drills will be scheduled in accordance with 33 CFR 154.1050.

Monthly - Facility personnel and qualified individual notification drills.

Semiannually - Facility equipment deployment drills

Yearly - Spill management team tabletop drill.

Annual - Unannounced drill during which the spill removal organizational and spill management team shall be activated.

ATTACHMENT 6:

Written Commitment of Resources

SERVICE WELDING AND SHIP BUILDING NE Canal Bank Road, Lemont, Illinois

SPCC PLAN -- COMMITMENT OF RESOURCES (12/2000)

I hereby certify that the enclosed SPCC Plan was prepared under my direction and supervision and that I am familiar with the provisions of the SPCC Plan developed for the Service Welding and Ship Building Bulk Storage Plant Operations.

I additionally certify that Service Welding and Ship Building will commit the necessary resources (manpower, equipment and materials) required to expeditiously control and remove any harmful quantity of oil discharged as outlined within the enclosed SPCC Plan.

Dennis Egan, Owner

Name/Title

Signature

12/21/00

Date

Service Welding, Lemont, IL SPCC Plan. 12/2000 Attachment 6 **ATTACHMENT 7:**

Inspection Procedures and Forms

SERVICE WELDING N.E. CANAL BANK ROAD, LEMONT, ILLINOIS SPCC PLAN - ATTACHMENT 7

DAILY INSPECTION REQUIREMENTS

GENERAL FACILITY PREMISES

AT BEGINNING OF EACH WORK DAY

•

- A. Check Fence, gates and signs for good repair and signs being present.
- B. Check buildings for unauthorized entries, damage and missing equipment.
- C. Check emergency equipment fire extinguishers are present and have covers on them (outdoor extinguishers).
- D. All trucks and trailers on the property to be checked for leaks.
- E. Barge transfer area for irregularities?
- F. Alarm Systems/Communications Systems accessible and working?
- G. Are good housekeeping practices being observed?
- H. Report all problems to your supervisor and take corrective action as necessary.

TANK FARMS

EVERY WORK DAY (Both at the start and end of your shift).

- A. Visually inspect the tank farm for changes, since your last inspection. Specifically check for:
 - a. Are all tanks' valves property closed?
 - b. Are any tanks' valves leaking?
 - c. Are temperature of the tanks within their proper ranges?
 - d. Tank construction any erosion, corrosion, leaking fittings seams?
 - e. Area surrounding tank look for signs of leaks?
 - f. Any noticeable defects in secondary containment devices?
- B. Visually inspect the barge transfer area.
- C. Inspect all areas to insure that good housekeeping is maintained.
- D. Fill out Inspection Forms at the End of the Day, if necessary.
- E. Report all problems to your supervisor and take corrective action as necessary.

SERVICE WELDING N.E. CANAL BANK ROAD, LEMONT, ILLINOIS SPCC PLAN - DAILY INSPECTION SCHEDULE - 12/2000

•			
DATE:	INSPECTOR:	 SIGNATURE:	_

the control of the first term of the first term

		COMMENTS		
ITEM	INSPECTION ELEMENT/TYPE OF PROBLEM	Description of Problem Noted	Repairs Implemented/Date	
	GENERAL ITEMS			
Fence	*Inspect entire perimeter for breaches or damage.			
Gales	*Check for proper gate lock function.			
Buildings	*Check for unauthorized entries, damage, and missing equipment.			
	SAFETY & EMERGENCY EQUIPMENT			
Alarm Systems	*Check accessibility.		1,-	
•	*Check for proper operation.			
Internal/External (Phone and Radio)	*Check accessibility.			
Communication Systems	*Check for operation			
Fire Extinguishers	*Check accessibility, present			
	TANK STORAGE INSPECTION			
	*Check for evidence of spills or releases in unloading area(s)			
•	*Check for removal of spill absorbent and cleanup materials			
GENERAL AREAS	*Inspect vacuum tanker hoses for deterioration or leakage			
	*Inspect containment system(s) for deterioration			
;	*Check for cracks and gaps in base, dike, and sumps			
	*Check for evidence of seepage outside containment (e.g. discoloration)			

SERVICE WELDING N.E. CANAL BANK ROAD, LEMONT, ILLINOIS SPCC PLAN - DAILY INSPECTION SCHEDULE -- 12/2000

(x,y) (x,y)

			COMMENTS	
ITI	EM	INSPECTION ELEMENT/TYPE OF PROBLEM	Description of Problem Noted	Repairs Implemented/Date
		*Check for debris, cleanup residue, improperly stored equipment		
		*Inspect exterior for cracks, leaks, discoloration, and obvious deformation		
Boller Fuel	B-1	Access Hatches, Vents, and Sampling Ports - *Check for leaks		
Tanks	B-2	*Check for damage Fill/Drain and Overflow Piping -		
	B-3	*inspect piping for leaks *inspect valve seals for leaks *Check that handles are not bent or damaged		
	B-4	Tank integrity - *Inspect exterior for cracks, leaks,		
Fuel Tanks	8	discoloration, and obvious deformation Liquid Levels -		
	9.	*Check if operators log book is up to date *Check liquid tank levels		
	10	Ali Anciliary Equipment - *Visual inspection for leaks		122
	40-1			
Product	40-2			
Tanks - Temp. Storage	40-3		•	
-	40-4			
	40-5			
	40-6			
Ì	40-7			

SERVICE WELDING N.E. CANAL BANK ROAD, LEMONT, ILLINOIS

SPCC PLAN (12/2000) - ATTACHMENT 7 WEEKLY INSPECTION PROCEDURES

In the addition to the daily inspection, a more detailed (logged) weekly inspection is to be conducted. The items listed below are to be checked to ensure that there is no potential release of materials into the environment, that all safety and emergency equipment is present and operational, that all materials and secondary containment systems are structurally sound, that all monitoring equipment is operating and recalibrated as required, that all processing equipment is in good working order, and that security structures and signs are present and intact.

ITEMS TO BE CHECKED:

Security Structures

- 1. Fence
- 2. Gates
- 3. Warning signs

Containment and Secondary Containment

- 1. Tanks
- 2. Truck Unloading Area(s)
- 3. Barge Transfer Area

Safety Equipment

- 1. First Aid Stations
- 2. Emergency Shower
- 3. Eye Wash Station
- 4. Personal Protective Equipment

Emergency Equipment

- 1. Fire Extinguishers
- 2. Alarm System
- 3. Spill Control Materials (Boom, Pads, Oil- Dri, etc.)

Monitoring Equipment

- 1. Temperature Gauges
- 2. pH Meters
- 3. Tank Levels (Manual)

Processing Equipment

- 1. Pumps
- 2. Heavy Equipment
 - a. Bobcat
 - b. End Loaders
 - c. Backhoe
 - d. Bulldozer

REPORT ALL PROBLEMS TO YOUR SUPERVISOR AND TAKE ACTION AS NEEDED - ATTACHED FORMS ARE TO BE USED

SERVICE WELDING N.E. CANAL BANK ROAD, LEMONT, ILLINOIS SPCC PLAN - WEEKLY INSPECTION SCHEDULE -- 12/2000

The first term \mathbf{t} is the first term \mathbf{t} in \mathbf{t} . The first \mathbf{t} is the \mathbf{t}

DATE:	INSPECTOR:	SIGNATURE:

ITEM	INSPECTION ELEMENT/TYPE OF PROBLEM	DESCRIPTION OF PROBLEM	DESCRIPTION OF REPAIRS/DATE
		GENERAL ITEMS	
Lighting System	*Check lights for operability.		
	SAFETY &	EMERGENCY EQUIPMENT	
Protective Gear(e.g.,	*Check accessibility.		
Helmets, Goggles, Boots, Gloves,	*Check for adequate supply.		·
Disposable suits, Disposable Bags)	*Check for deterioration, damage.		
Breathing Apparatus (e.g., Half-Face	*Check for accessibility. *Check for adequate supply, full charge on canisters, and all air tanks.		· · · · · · · · · · · · · · · · · · ·
Respirators, Cartridges)	*Check for deterioration and damage. *Check for function.		
First Aid Kits	*Check accessibility. *Check for adequate supply.		
Portable Eyewash	*Check accessibility. *Check for adequate supply.		
Water Lines	*Check for adequate pressure.		
Fire Extinguishers	*Check pressure gauge for full charge indication. *Check inspection tag to insure annual maintenance by outside fire service is up-to-date.		
	*Check seal to ensure no one has used extinguisher. *Check for deterioration.		
	*Check for adequate supply. *Check accessibility.		

SERVICE WELDING N.E. CANAL BANK ROAD, LEMONT, ILLINOIS SPCC PLAN - WEEKLY INSPECTION SCHEDULE -- 12/2000

of the transfer to the property of the state of

ITEM	INSPECTION ELEMENT/TYPE OF PROBLEM	DESCRIPTION OF PROBLEM	DESCRIPTION OF REPAIRS/DATE
Absorbent Supply	*Check for adequate supply.		
Recovery Drums	*Check for adequate supply.		
Other Emergency and Decontamination Equipment	*Check accessibility. *Check for proper operation *Check for deterioration/damage.		
Pumps	*Check for proper operation. *Inquire with maintenance department.		
Heavy Equipment	*Check for proper operation. *Inquire with maintenance department.		

SERVICE WELDING AND SHIP BUILDING NE Canal Bank Road, Lemont Illinois

SPCC PLAN (12/2000) - ATTACHMENT 7

ANNUAL TANK INSPECTION

DATE:		
PERFORMED BY:		•
ORDERED BY:		
TANK NO:		
•		
	VISUAL INSPECTIONS	
ITEMS:	COMMENTS:	
A: EXTERIOR:		
LADDER: (RUNGS, ANCHORS)		
EXTERIOR OF VESSEL:		
ROOF:		
INSULATION:		
B: INTERIOR:	•	
MANWAY: (COVER & GASKETS)		
FLOOR: (WELDS)		
WALLS: (WELDS)		
COILS: (TEST UNDER PRESSURE)		
C: VALVES:		
PACKING:		
MANUAL OPERATION:		
TEST VALVES UNDER PRESSURE:		
AJOINING PIPING UNDER PRESSURE:		
D: VENTS:		
VAC:		
PRESSURE:		

PRESSURE RELIEF VALVES:

SERVICE WELDING AND SHIP BUILDING NE Canal Bank Road, Lemont Illinois

SPCC PLAN (12/2000) - ATTACHMENT 7

VISUAL / ANNUAL TANK INSPECTION INSTRUCTIONS

Tank must be empty and cleaned before this inspection.

When inspecting the tank all confined space entry regulations must be followed, refer to Safety Manual.

Tank to have continuous LEL/02 monitoring during inside inspection.

All valves on the inlet and discharge must be secured closed before entry to tank.

When making visual inspection record all rust, pitting, cracks. discolored paint (which may indicate leaks) in the comment space provided.

all comment area's are to be filled out; Example (Exterior or vessel) if tank is insulated, indicate it is.

Additional Comments:		•
·		· · · · · · · · · · · · · · · · · · ·
	· · · · · · · · · · · · · · · · · · ·	·
	:#	
	Reviewing Supervisor	•

ATTACHMENT 8:

<u>. 31</u> .

Training Log Forms

SERVICE WELDING AND SHIP BUILDING NE Canal Bank Road, Lemont Illinois

SPCC PLAN (12/2000) - ATTACHMENT 8

TRAINING LOG RECORDS

IRED DATE:		· ·	*.	
.TE	TYPE OF TRAINING	* SIGNATURE / SL	JPERVISOR - (TRAINER)	*SIGNATURE / EMPLOYEE
		 		, <u> </u>
·				
		 		· ··· —
;				·
·			·	

^{*} The signature confirms that the employee has received the appropriate training as outlined in the SPCC Plan.